# 2/ 4 03-28-13;04:58PM; :9134225029

## KANSAS CITY PETERBILT

8915 Woodend Kansas City, KS 66111 Phone: (800) 489-1122

(913) 441-2888 Fax: (913) 422-5029



## REPRINT CUSTOMER INVOICE

INVOICE DATE 09-12-11

>>>> KS26619 <<<<

REPAIR ORDER NUMBER

CUSTOMER NAME NUMBER 100T CASH SALE TAXABLE PHONE 816 262-6384

PRIDE CO. P.O. NO.

8008 SE. SAXON-EASTON RD. COMPLETE 09-12-11 OPEN 09-12-11 SVC WTR SC \*PG

ST. JOE. MO

1XPHD49X338D769464 UNIT NO. 47 SERIAL NO. MILEAGE 612717

YEAR/MAKE/MODEL - 08 PETE 386 ENGINE/MODEL/SERL CUMMINS 79285207

TRNS/MODEL/SERL -

RXLS MODEL/SERL - HU00973602

DEL DATE 02-04-08 SELL DLR

LICENSE CPL/ARRG R RATIO TAG #

DEL MILE

1 PERFORM VIS CHECK & DOWNLOAD PRINTED ECM DOWNLOAD

>> NO CHARGE <<

CUSTOMER STATES THAT THE JAKES ARE NOT WORKING. CHECK & ADVISE VERIFIED ENGINE BRAKES NOT OPERATING. CHECKED ECM CONFIGURATION-CORRECT. FOUND ECM NOT RECOGNIZING THE JAKE SWITCHS, BRAKE SWITCH, FAN OVERRIDE SWITCH, CRUISE SWITCH, ETC. HOOKED UP TO ESA AND CHECKED CECU PROGRAMMING FOR CAB CONTROLLER. PROGRAMMING WAS CORRECT, BUT SOFTWARE OUTDATED. REFLASHED CECU-STILL FOUND SAME PROBLEMS. FOUND THAT TRUCK HAD BEEN WELDED ON RECENTLY-CECU HAD CODE FOR OVER-VOLTAGE. CONNECTED TEST CECU TO DETERMINE IF CURRECT CECU HAD BEEN DAMAGED. ALL ITEMS WORKING PROPERLY WITH TEST CECU-FOUND CURRECT CECU HAS INTERNAL DAMAGE. REMOVE AND REPLACE CECU, REASSEMBLED DASH, PROGRAMMED SOFTWARE AND PARAMETERS INTO NEW CECU. ALL ITEMS WORKING PROPERLY AFTER REPAIR. THSI REPAIR COVERED STEPS 2-6.

> TOTAL LABOR TOTAL PARTS

\$264.00

\$1,065.99

Q21-1075-2-100

MODULE AS \$1,065.99

- IT IS ALSO NOTED THAT THE CRUISE CONTROL IS NOT WORKING. CHECK& ADVISE REPAIRED ON STEP 2
- 4 CUSTOMER HAS STATED THTAT THE ENGINE FAN WILL NOT STOP RUNNING. CHECK & ADVISE REPAIRED ON STEP 2

CONTINUED