

615C

Sales Link - Sales Reps

Rodney Warren

Launch Accounts Issues Leads Opportunities Activities Requests Sales Inventory Quotes Links

Look For Customers with Customer Name that Contains in General Line (G) View Mine Search Adv. Search

All A E G R T
General Line

NOMUG CONSTRUCTION LLC (017105)

Work Order History

Tel: 620 431 3742 City: CHANUTE Branch: 00 Acct Type: DBS 5 Business Type: End-User

Customer Info
Customer Profile
Sales Analysis

Stock No: 13B041	Make: AA	Model: 615C	Serial No: 09XG00366	Division: G	FPC: J
Eq Sts: X	Inv Sts:	Last SMU: 1980 H	SMU Date: Jun 06, 2012 12:00 AM		
Eng Make: AA	Eng Model: 3306	Eng S/N: 008X69171	Eng Arr No: 4P4730	Trans Make:	Trans S/N: 1AX00532 8E6665

Issues

Lead(0)

Opportunities(0)
Bids (0)Sales Rep Notes(0)
Documents(1)

Rental Equipment (0)

Equipment List

Latest Work Orders

UCC Information(0)

Accounts Receivable

New (0)

Done

Hold (0)

Invalid (0)

Follow-up Required (0)

Follow-up Completed (0)

Activities Outstanding(0)

Activities Completed (65)

Surveys(5)

Lost Sales Report

COMPARE Report

Segment View Invoice View

Cust:	Job	Comp
All	Code: All	Code: All

Customer	Open Date	Hours	Work Order	A/I	Job	COMP	Pt	Cust	Lbr	Cust	Misc	Cust	Seg	Total	Notes
017105	Jun 01, 2012 12:00 AM	1980	2104793 - 01	C	035	7000								376.54	COMPLAINT: LIGHT ON DASH CAUSE: COOLANT FLOW LIGHT WAS ON AND SWITCH HAD FAILED CORRECTION: CUSTOMER HAD LIGHT ON DASH AND IT WAS FINE FOR COOLANT. TEST WIRES AND THEY WERE FINE DRAINED COOLANT TO REPLACE SWITCH AND REFILLED AND STARTED MACHINE. LIGHT STAYED OFF.
			2104793 - 02	C	510	1438		992124H	992124H	992124H				320.78	COMPLAINT: NONE CAUSE: HOUSING WAS NOT MADE FLAT SO WHEN SWITCH WAS BOLTED DONE IT CRACKED AND LEAKED COOLANT. CORRECTION: HAD A WATER LEAK AFTER NEW SWITCH WAS INSTALLED. DRAINED COOLANT AND REMOVED SWITCH. LOOKED AT GASKET AND IT WAS FINE. LOOKED SWITCH OVER AND FOUND HOUSING FOR SWITCH WAS NOT MADE FLAT SO WHEN SWITCH WAS INSTALLED HOUSING CRACKED. AND COOLANT WOULD LEAK I USE A NEW SWITCH TO VERIFY HOUSING PROBLEM. INSTALLED NEW SWITCH WITH NEW GASKET. FILLED MACHINE WITH COOLANT AND RAN MACHINE. HAD NO LEAKS.
WO Total:														697.32	
017105	Jan 30, 2012 12:00 AM	1977	3102833 - 01	C	023	4284								242.01	COMPLAINT: MACHINE HAS A AIR LEAK AND PARK BRAKE WON'T RELEASE CAUSE: BRAKE CONTROL VALVE WAS LEAKING AIR OUT EXTERNALLY. AND WOULD NOT MOVE CONTROL VALVE TO SEND AIR TO PARK BRAKE. CORRECTION: REMOVED VALVE AND INSTALLED NEW ONE.

615C

				STARTED MACHINE TO BUILD AIR PRESSURE. SHUT OFF	
				MACHINE AND CHECKED FOR LEAKS THERE WAS NONE	
				WO Total:	242.01
017548	Jul 22, 2010 12:00 AM	1900	2101262 - 01 C 035 1250	284.11	
			2101262 - 02 C 010 1251	240.00	
			2101262 - 03 C 023 1251	472.49	
			2101262 - 04 C 041 1000	85.90	
			2101262 - 05 C 510 4257	257.70	
				WO Total:	1,340.20
017548	Apr 19, 2010 12:00 AM	1888	2100792 - 01 C 510 1061	796.63	COMPLAINT: RUSTED OUT EXHAUST CAUSE: RUSTED OUT EXHAUST CORRECTION: THE EXHAUST STACK AND ATTACHING PIPES WERE REPLACED WITH NEW ONES
			2100792 - 02 C 035 1450	652.70	COMPLAINT: HARD STARTING CAUSE: LEAKING NOZZELS CORRECTION: THE OLD NOZZELS WERE REMOVED AND 6 NEW NOZZELS WERE INSTALLED THE STARTING TROUBLE WAS FIXED.
			2100792 - 03 C 510 1054	76.72	COMPLAINT: NEEDS AIR FILTER REPLACED CAUSE: NEEDS AIR FILTER REPLACED CORRECTION: REPLACED OUTER AIR FILTER AND INSPECTED INNER FILTER
			2100792 - 04 C 510 1269	40.51	COMPLAINT: THE THROTTLE RETURN SPRING IS BROKEN CAUSE: THE THROTTLE RETURN SPRING IS BROKEN CORRECTION: THE THROTTLE RETURN SPRING WAS REPLACED
				WO Total:	1,566.56