	K.					1	rai cortado, acion	4	mar en jungs mild	Section (Control Control	estic of est
TU41550	02-10	-10 10 1	5 10			1 0 2.1		20 1.6	(01 > 42)	.086	
AX 66 CO	252B	*EAT0252	BVSCP02	32*	11*1	£4,3045	\$ \$ 6 E W	164.0	324	C2284	18
RESULTANT : NONE REPAIR PRO	9	MMENTS:	-		•	* *			innari Ana An eng	Par de	*12.00
DROVE MACH UP E.T SAW SPEC ON MA BY RAISING MACHINE DI CAB AND RE	TWO SECTIONS AT THE CARD NOT E	EED NOT IN IND HOW IT IB AND CHEC IAVE TWO SE	STALLED. WAS SHIE KING VAI	LOOKI PPED TE IVE. TE	ED UP Vertfiei Ie Mari	):	erez en 1 Britis ( Brever)	Merchats Merchats Merchats Merchan	riotensia Sito siaa Sito si Sitomor	er i des Marie este Herriste es Marie este es	ta i Oper Clar Cour
UP E.T SAW SPEC ON MA BY RAISING MACHINE DI	TWO SECTIONS A THE CA D NOT E MOVED E	EED NOT IN IND HOW IT IB AND CHEC IAVE TWO SE	STALLED. WAS SHIE KING VAI PEED TRAV	LOOKE PPED TE LVE. TE VEL. LO	ED UP VERTFIEI IE CAN DWERED	SEG.	**************************************	Sidiri Malakata Vereni Vereni Vereni	ACTOR CONTRACT CONTRA	61.62	ed i Syner Cear Costa Total
UP E.T SAW SPEC ON MA BY RAISING MACHINE DI CAB AND RE	TWO SI CHINE A THE CA D NOT B MOVED B	EED NOT IN IND HOW IT IB AND CHEC IAVE TWO SE	STALLED. WAS SHIE KING VAI PEED TRAV	LOOKE PPED TE LVE. TE VEL. LO LABOR	ED UP PRIFIEI E WERED TOTAL	SEG.	With A	Sieven Markets Verver Verver	ACTOR CONTRACT CONTRA	ERLANDS MARIES HERBER MARINER PARMS	eri Gymre Gymre Gymre Gymre Tota
UP E.T SAW SPEC ON MA BY RAISING MACHINE DI CAB AND RE	TWO SECHINE ATHE CAND NOT E	EED NOT IN IND HOW IT IB AND CHEC IAVE TWO SE	STALLED. WAS SHIE KING VAI PEED TRAV TOTAL SEGME	LOOKE PPED A IVB. TO VBL. LO VBL. LO LABOR	ED UP FERTFIEI IE WERED TOTAL	SEG	等款件 5.64 0.3	Sieven Markets Verver Verver	ACTOR CONTRACT CONTRA	61.62	ida ida ida ida ida ida ida ida ida ida
UP E.T SAW SPEC ON MA BY RAISING MACHINE DI CAB AND RE	TWO SECHINE ATHE CAND NOT E	EED NOT IN IND HOW IT IB AND CHEC IAVE TWO SE	STALLED. WAS SHIE KING VAI PEED TRAV TOTAL SEGME	LOOKE PPED AT LVE. TE LABOR ENT 03  OMENTAL	ED UP FERTFIEI E WERED TOTAL FEE	SEG.	等款件 5.64 0.3	Sieven Markets Verver Verver	ACTOR CONTRACT CONTRA	61.62	ta distriction of the second o

WO100067397	02@19-10	5832200	19% 202	2008	105 G	06 2 2
TU41550	02-10-10 1	0 15 10	Part (All John College)			
AA .	252B 1 + CAT	0252BVSCP0233	2*		6164:0	C22848 44
RAISED CAB CONTROL HAN HOOKED UP I FUNCTIONING WAS UNABLE	ITCH DAMAGE: CESS COMMENTS REMOVED RIGH NDLE INSTALLE E.T AND VERIF J. INSTALLED TO OPERATE A	S: IT SIDE CONSOL ID NEW CONTROL IED THAT SWIT CONSOLE, AND LUXILIARY CIRC	E. REMOVED HANDLE CH.WAS LOWERED CAB UIT WITH A	CONTRACTOR	BOD	
WORK TOOL I 1 231-42		AVEING PROPER CONT GP-HA			188.15	188.15
	Steen on the	TOTAL F		SEG. 02	ger . eqtimentics	188.15 *
7.7.183		TOTAL I	ABOR 1 AND 12	SEG. 02		339.70 *
· · · · · · · · · · · · · · · · · · ·	*	SEGMEN	T 02 TOTAL	$(((a_i))^{-1}J_iJ_iV^{T_i}(i))$	<b>3</b>	527.85 T

**《西班班》**(1915年)

TROUBLESHOOT SPEED CONTROL

CUSTOMER COMPLAINT: TWO SPEED NOT WORKING CAUSE OF FAILURE: NONE

CONT'D

WO100067397	02-19-10	5832200	r errende t	202	u de entes. Di contres. Sur di contres.	10	406	<b>2</b>	. <b>1</b>
TU41550	02-10-10	10 15 10							
Marin San	\$52B *(	CAT0252BVSC	P02332*	ing policy ben in d	distribution de la constant		<b>4 .</b> Oyan jeda (a	C22848	5

## TROUBLESHOOT AUXILIARY HYD CIRCUIT

CUSTOMER COMPLAINT:

AUX. HYD. DON'T FUNCTION

CAUSE OF FAILURE:

CONTROL SWITCH

RESULTANT DAMAGE:

NONE

REPAIR PROCESS COMMENTS:

CHECKED OPERATION, MACHINE DID NOT FUNCTION AT ALL IN AUXILIARY HYD CIRCUIT. HOOKED UP B.T NO ACTIVE CODES, AND THE CONTROL SWITCH WAS NOT REGISTERING EITHER. RAISED CAB, REMOVED RIGHT SIDE CONSOLE. CHECKED VOLTAGE TO THE SWITCH, HAD VOLTAGE TO THE SWITCH BUT NONE COMING OUT OF SWITCH WHEN ACTIVATED. SWITCH WAS BAD.

TOTAL LABOR SEG. 01 466.10 \*

as telepated to the body to the parties that a real telepated to the contract of the contract of the contract of if I wanted the second of the section of the sectio

Labor to all a property. assi sum, codini, komo cum qua fasca de siperu e e tuto.

A CONTROL OF THE STATE OF THE PROPERTY OF THE STATE OF TH

of the control of high property that it is not an 

The second of the first test of the second o

tales of the entrance parameters between the ratio of the

grape removales balled in Albadal because and research V

SEGMENT 01 TOTAL

CUSTOMER COMPLAINT:

AUX. HYD. DON'T FUNCTION

CONT'D