

K1003

Invoice To Account No: Deliver To:			SERVICE INVOICE			
Internal Used	Internal Used		Invoice Number:			
			Invoice Date:	2/12/2013		
			Location:	6		
			Work Order Number:	11146		
			Payment Type:	Account		
Bus Phone:	Bus Phone:					
Prv Phone:	Prv Phone:		Page:	1 of 3		
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:		
JOHN DEERE	10JZ S78 JAR SS	1H0612CCEA0735644	46988W			

Inspection Internal

COMPLAINT:

THIS JOB CODE FOR INSPECTION

CORRECTION:

U-INT FROM BURGARDT 612

INSPECTION

**INSPECTED

++++YUOR TECHS WERE JR LANGFITT & BRET SWANSON

Service Accessories

Labor: \$79.50 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$79.50

Repair Internal

COMPLAINT:

U-INT 612 FROM BURGARDT - REPAIR AS INSTRUCTED AFTER INSPECTION (BURGARDTS SAID SLIP CLUTCH/CHOPPING UNIT IS BAD ON ROW 9 - THEY PAY FOR THIS REPAIR) PAINT AS NEEDED - PUT ON LOT

CORRECTION:



K1003

Invoice To Account No:	Deliver To:		SERVICE INVOICE			
Internal Used	Internal Used		Invoice Number:			
			Invoice Date:	2/12/2013		
			Location:	6		
			Work Order Number:	11146		
			Payment Type:	Account		
Bus Phone:	Bus Phone:					
Prv Phone:	Prv Phone:		Page:	2 of 3		
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:		
JOHN DEERE , 10JZ S7	8 JAR SS	1H0612CCEA0735644	46988W			

Repair Internal

U-INT FROM BURGARDT 612

- *CLEANED OUT ALL THE LARGE DEBRIS FROM THE GATHERING CHAIN AREAS AND FROM THE UNDERSIDE OF HEAD AROUND THE SLIP CLUTCHES
- *POWER WASHED CORNHEAD
- *REPLACED 2 INNER EAR SAVERS AND 2 OUTER EAR SAVERS
- *ADJUSTED ALL THE GATHERING CHAINS
- *REPLACED 12 OF THE GATHERING CHAIN IDLER SPROCKETS AND 14 OF THE BEARING CAPS
- *REPLACED SLIP CLUTCH ON ROW 7 & ROW 12
- *HAD TO REPLACE THE TIE ROD ASSEMBLY ON THE DECK PLATE INDICATOR
- *ADJUSTED BOTH OF THE ROW UNIT DRIVE CHAINS
- *REPLACED THE IDLER SPROCKET ON THE RIGHT HAND CHAIN
- *CHECKED BOTH OIL BATH LEVELS
- *HAD TO HEAT UP AND STRAIGHTEN THREE DIFFERENT SPOTS OF THE AUGER FLIGHTING
- *REPLACED BOTH AUGER DRIVE CHAINS AND BOTH IDLER SPROCKETS
- *REPLACED CHOPPING KNIVES
- *REPLACED BOTH STALK MASTER END FLAPS
- *HAD TO REPLACE BULB IN THE RIGHT HAND FLASHER
- *CHECKED/FILLED OIL LEVELS IN THE FRONT AND REAR STALK MASTER GEAR BOXES
- *CHECKED/FILLED GREASE LEVELS IN ROW UNIT GEAR BOXES
- *PAINTED AUGER AND FLOOR

++++YOUR TECHS WERE JR LANGFITT & BRET SWANSON

<u>Part Number</u> 15H666	<u>Description</u> PIPE PLUG	Quantity 8.00	<u>List Price</u> 2.69	Net Price 2.69	Extended Price \$21.52	Taxed Ind N
A31867	LOCK NUT	24.00	1.32	1.32	\$31.68	N
AD2062R	BULB	1.00	2.66	2.66	\$2.66	N
AH159809	LINKAGE	1.00	41.91	41.91	\$41.91	N
AH222291	ROLLER CHAIN	2.00	98.27	98.27	\$196.54	N
AH231386	IDLER SPROCK	12.00	57.00	57.00	\$684.00	N
AXE15284	IDLER SPROCK	2.00	81.90	81.90	\$163.80	N

^{**}REPAIR AFTER INSPECTION**



K1003

nvoice To Account No:	Deliv	er To:		SERVICE INVOICE				
Internal Used	Inte	rnal Used		Invoice Nun	nber:			
				Invoice	Date:	2/1	2/2013	
				Loca	ation:		6	
				Work Order Nur	mber:		11146	
				Payment 7	Type:	Α	ccount	
Bus Phone:	1	Phone:		_	_			
Prv Phone:	Prv	Prv Phone:		Page:		3 of 3		
Make/Model:		Meter:	Serial Number:	Eq ID:	F	leet No:		
JOHN DEERE	10JZ S78 JAR SS		1H0612CCEA0735644	46988W				
Repair Internal								
AXE23427	Idler Sprocket		1.00	78.00	78.00	\$78.00	N	
H219002	DEFLECTOR		1.00	34.93	34.93	\$34.93	N	
H227244	SHIELD		1.00	109.92	109.92	\$109.92	N	
H233284	BUSHING		24.00	14.75	14.75	\$354.00	N	
HXE25730	Bearing Cap		14.00	7.37	7.37	\$103.18	N	
HXE33313	GATE		1.00	7.87	7.87	\$7.87	N	
HXE36504	BLADE		24.00	19.82	19.82	\$475.68	N	
HXE38892	Gate		2.00	7.87	7.87	\$15.74	N	
KXE10109	SLIP CLUTC		2.00	343.97	343.97	\$687.94	N	
TY25624	GREEN SPRA		9.00	9.49	9.49	\$85.41	N	
TY6296	90WT QT		3.00	7.75	7.75	\$23.25	N	
Labor: \$2,544.07	Parts: \$3,118.03	OL&M:	\$0.00 Misc	: \$0.00	Sub-Total:	\$5,662.10		
Miscellaneous Charges: Service Accessories							\$30.00	
					Labor:	\$2,6	323.57	
Customer PO No:					Parts:	\$3,1	18.03	
Tax Exempt No:					OL&M:		\$0.00	
Advisor:					Misc:	\$	30.00	
							\$0.00	

TERMS AND CONDITIONS

Parts and Service are due on the 10th of the month following the month of purchase. A Service Charge of 1.65% per month which is an ANNUAL PERCENTAGE RATE of 19.8% will be assessed to all past due accounts (30 days).

All claims and returned goods must be accompanied by this bill. There will be a 20% charge on all special ordered parts and attachments not accepted or returned. No special ordered parts or attachments returned after 30 days.