

Nebraska Harvest Center
925 280th Street
Seward NE 68434
Phone: (402) 643-4050
Fax: () -
Email: inquiry@nebharv.com
www.nebharv.com

Doc/Invoice: 01-28888
Date: 8/11/2015
Customer Id: CLAAS FINANCIAL
Phone:
Customer PO:
Salesperson:
User:

SERVICE INVOICE

Claas Financial Services LLC

Ship To:
Claas Financial Services LLC

Opened: 8/11/2015
Work Order No: 01-30666
My Reference: 750TT C4800623

Responsible Tech: TLong
Pickup Date:
Delivery Date:

Recon					
Item/Tag	Type	Description/Model/Serial Number	Quantity	Tax Price	Net Price
01 Full Service					
Unit: 2903 750TT, C4800623, Combine, Used 675.0 Hours					
I performed a full service on this machine. I changed all heavy oils, changed hydraulic and engine oil and filters, all fuel filters, and air filters. I also greased the machine, and checked all other fluid levels					
	SL	Customer - In Shop			N
1R-1808	PA	OTH - Oil Filter	1.00	N	
0773672	PA	CLA - FILTER ELEMENT	1.00	N	
0773821	PA	CLA - FILTER SAFETY CAR	1.00	N	
1474300	PA	CLA - AGRISHIFT MT 80W-90	1.00	N	
1474370	PA	CLA - AGRIGREASE EP 2 - (24	2.00	N	
5596460	PA	CLA - POCKET FILTER	2.00	N	
5100852	PA	CLA - HIGH.PRESS.FILTER	1.00	N	
5100541	PA	CLA - FILTER ELEMENT	1.00	N	
1R-0749	PA	OTH - Fuel Filter TIER 4	2.00	N	
423-8524	PA	OTH - FUEL FILTER	1.00	N	
2393870	PA	CLA - CONTACT WASHER	6.00	N	
2361700	PA	CLA - HEXAGONAL NUT	4.00	N	
2362000	PA	CLA - HEXAGONAL BOLT	2.00	N	
2373410	PA	CLA - HEXAGONAL BOLT	3.00	N	
Total 01 Full Service					
02 Engine Valve					
Unit: 2903 750TT, C4800623, Combine, Used 675.0 Hours					
I blew off the valve cover, and cleaned the area around it. I then removed the cover, and turned the engine over to find rock-over. I then adjusted valves and injector heights to spec. I then turned the engine over 360 degrees and repeated on the rest of the valves and injectors. I then started the machine and listened to make sure it ran smoothly.					
	SL	Customer - In Shop			N
Total 02 Engine Valve					

IL ✓
CI ✓
W/C ✓

Nebraska Harvest Center
925 280th Street
Seward NE 68434
Phone: (402) 643-4050
Fax: () -
Email: inquiry@nebharv.com
www.nebharv.com

Doc/Invoice: 01-28888
Date: 8/11/2015
Customer Id: CLAAS FINANCIAL
Phone:
Customer PO:
Salesperson:
User:

SERVICE INVOICE

Claas Financial Services LLC

Ship To:
Claas Financial Services LLC

Opened: 8/11/2015
Work Order No: 01-30666
My Reference: 750TT C4800623

Responsible Tech: TLong
Pickup Date:
Delivery Date:

Recon

03 Concave

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

I cleaned out around the concave and in between the moving concaves. I also repeatedly lubed the moving arms. I then checked that the cylinder was all the way in and accumulator pressure was in spec, I then adjusted the concave to spec

SL	Customer - In Shop	N
----	--------------------	---

Total 03 Concave

04 Window Washe

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

I removed the washer tank, and disconnected the supply line and the electric wires. I thoroughly washed the tank to filled with washer fluid, and installed the cap. I then ran the windshield sprayers to test.

SL	Customer - In Shop	N
----	--------------------	---

WF	PA	OTH - Washer Fluid	1.00	N
----	----	--------------------	------	---

5461650	PA	CLA - COVER	1.00	N
---------	----	-------------	------	---

Total 04 Window Washe

05 Light

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

I replaced the light cover on the LH side that was broken. I also ran the machine and checked that it worked.

SL	Customer - In Shop	N
----	--------------------	---

6581760	PA	CLA - POSITION LIGHT	1.00	N
---------	----	----------------------	------	---

Total 05 Light

06 Face Plate

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

Replaced front cracked face plate under cab. I removed the old one, and installed the new one. I then measured an

SL	Customer - In Shop	N
----	--------------------	---

1141160	PA	CLA - STICKER	1.00	N
---------	----	---------------	------	---

5063570	PA	CLA - FRONT PANEL	1.00	N
---------	----	-------------------	------	---

Total 06 Face Plate

Nebraska Harvest Center
925 280th Street
Seward NE 68434
Phone: (402) 643-4050
Fax: () -
Email: inquiry@nebharv.com
www.nebharv.com

Doc/Invoice: 01-28888
Date: 8/11/2015
Customer Id: CLAAS FINANCIAL
Phone:
Customer PO:
Salesperson:
User:

SERVICE INVOICE

Claas Financial Services LLC

Ship To:
Claas Financial Services LLC

Opened: 8/11/2015
Work Order No: 01-30666
My Reference: 750TT C4800623

Responsible Tech: TLong
Pickup Date:
Delivery Date:

Recon

07 CEBIS

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

Removed the CEBIS to replace the speaker, split the CEBIS in half and found were the speaker plugs in at was broken off and was not repair able, I backed up the files from the old CEBIS, Then I put the new CEBIS in, and loaded old files on the new one. Then I ran all updates, and loaded all configuration settings. I then ran the machine and learned all speeds and settings.

	SL	Customer - In Shop		N
0178340	PA	CLA - MONITOR	1.00	N

Total 07 CEBIS

08 FH Bushings

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

I removed the driven pulley, then replaced and greased the bushings behind it. I then picked out the small bushi
reinstalled the drive pulley, and the hydraulic actuator and ran the machine.

	SL	Customer - In Shop		N
6032710	PA	CLA - BEARING BUSH	2.00	N

Total 08 FH Bushings

09 Rotor bushin

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

I removed the access door and floor panel of upper walk way, then I removed the rotor drive and driven belt, and
driven pulley, and installed new ones, I then greased and reinstalled the pulley. On the driving pulley, I picked ou
then installed the belt and the wishbone arm. I put the floor and door back on, and finally greased rotors and ran

	SL	Customer - In Shop		N
2378410	PA	CLA - HEXAGONAL BOLT	1.00	N
6609110	PA	CLA - BUSHING	6.00	N
6032710	PA	CLA - BEARING BUSH	2.00	N

Total 09 Rotor bushin

10 Threshing Bu

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

I removed the threshing drive belt and hydraulic actuator, and replaced the 3 bushings. I then removed the supp
bushings in there. I also replaced the rubber wear shoes. I then reinstalled the driven pulley, and put the belt bac

	SL	Customer - In Shop		N
0085430	PA	CLA - BUSHING	4.00	N

Nebraska Harvest Center
 925 280th Street
 Seward NE 68434
 Phone: (402) 643-4050
 Fax: () -
 Email: inquiry@nebharv.com
 www.nebharv.com

Doc/Invoice: 01-28888
 Date: 8/11/2015
 Customer Id: CLAAS FINANCIAL
 Phone: (
 Customer PO:
 Salesperson:
 User:

SERVICE INVOICE

Claas Financial Services LLC

Ship To:
 Claas Financial Services LLC

Opened: 8/11/2015
 Work Order No: 01-30666
 My Reference: 750TT C4800623

Responsible Tech: TLong
 Pickup Date:
 Delivery Date:

Recon

2356580	PA	CLA - SPRING PIN	7.00	N
6032710	PA	CLA - BEARING BUSH	2.00	N
6033090	PA	CLA - GLIDING SHOE	3.00	N

Total 10 Threshing Bu

11 Air Box

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours
 Installed cap on air intake box.

	SL	Customer - In Shop		N
7836550	PA	CLA - COVERING	1.00	N

Total 11 Air Box

13 Recon Kit

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

Installed recon kit, put tools, and literature, in tool box. I also put the sign on the front, and the recon stickers on the

	SL	Customer - In Shop		N
CLFRR700	PA	CLA - FRR KIT - 700 SERIES	1.00	N

Total 13 Recon Kit

14 Clean Machin

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

I thoroughly cleaned the cab of the machine, and washed the windows. I soaped and scrubbed the outer panels of the machine and took photos for sales. I then removed shields and washed thoroughly, especially grease and oil stains. I washed engine compartment sides of the machine. I then washed shields and put back on, before rinsing it all again. I then ran the machine again to assure proper working condition.

	SL	Customer - In Shop		N
--	----	--------------------	--	---

Total 14 Clean Machin

15 Belts/Chains

Unit:2903 750TT, C4800623, Combine, Used 675.0 Hours

Put all belts and chains on, and tightened to correct tension.

	SL	Customer - In Shop		N
--	----	--------------------	--	---

Total 15 Belts/Chains

Nebraska Harvest Center
925 280th Street
Seward NE 68434
Phone: (402) 643-4050
Fax: () -
Email: inquiry@nebharv.com
www.nebharv.com

Doc/Invoice: 01-28888
Date: 8/11/2015
Customer Id: CLAAS FINANCIAL
Phone:
Customer PO:
Salesperson:
User:

SERVICE INVOICE

Claas Financial Services LLC

Ship To:
Claas Financial Services LLC

Opened: 8/11/2015
Work Order No: 01-30666
My Reference: 750TT C4800623

Responsible Tech: TLong
Pickup Date:
Delivery Date:

Recon

16Chopper Knife

Unit: 2903 750TT, C4800623, Combine, Used 675.0 Hours

I removed the lower transverse pan, and flipped all knives. I also cleaned out the metal bushings where needed to allow them to swing. I also found that the two central spreader fins that were cracked out. I painted them and adjusted them properly. I then reinstalled the transverse pan and aligned it back up. ran the machine and the chopper plug sensor was going off, installed a new sensor adjusted, ran the machine and the code was staying off

	SL	Customer - In Shop		N
3518610	PA	CLA - SPREADING PLATE L	1.00	N
0104115	PA	CLA - TRACER	1.00	N

Total 16Chopper Knife

Customer Id: CLAAS FINANCIAL

ON Account

Signature: _____