

IN-SERVICE

Date: 9/10/106

Customer Name: Lee Brothers Trucking Inc

Unit #: FRT

License Number: OK 287-908

Truck Model FLC

Truck Serial Number: 1FUY4DYB0H4309034

Engine Model Number: 7FB 92509 3406 B Caterpillar

AR#: 7C0147

PERF Spec: 0T6597

MAX Alt: 2250m

OEM#: 201-16012-49

350 Hp @ 1800 RPM's

Fuel Timing: 240 BTC

Transmission Model: RTO 12609BR
9-speed Fuller

Transmission Serial Number: 20008812

#2 { Rear axle Model: QP

Rear Axle Serial Number: AVA 87062772

Ratio 4:44 Rockwell 100NX168

Rear Axle Model: QR

Rear Axle serial Number: AVA 87062835

Ratio 4:44 Rockwell 100NX307

Rear Ratio: 4:44

#1 Steering
Front Axle

Model: FF

NC 916006

Rockwell

Batteries - Number: 4 Size: Gr 31 750 CCP

Tire Sizes: Front 11R 22.5
Rear 11R 22.5

Filter Numbers: 1-LFP 777B (Oil) 1-LFP 440F (Fuel)
1-LFP 4005 (Oil) 1-LFF 5803B (Fuel)

Air Cleaner Number: PA 2704 Baldwin 1-Air filter #454

Oil: Mystic 15/50

Belts: 2-GT 17512 (Alternator-A/C)
2-GT 22591

Clutch: 107034-32 DRE00

Starter: 42MT - Model # 1990489

Alternator: Delco 25 DI 85amp

Fuel Tanks: Left 80 gals - Right 100 gals

DT-9034 (DT#2) - 1987

Year: 1987
Make: FRHT
Model: YO9238
Mileage 80,520
Unit #: DT-9034 (DT#2)
VIN #: 1FUYYSYB0HH309034
Type: Dump Truck
Color: White
Driver: ,
Notes:

(click to define)
(click to define)
(click to define)
(click to define)

Fleet Information

Category: Cars & Trucks
Location: Your Company Location #1
Status: Active
Schedule: Dump Trucks

Cars & Trucks

Your Company Location #1

DT-9034 (DT#2) - 1987

1987 FRHT YO9238

Vehicle #: DT-9034 (DT# Serial #: 1FUYYSYB0HH309034

Tag #: 50964Y

Mileage 80,520

Date	Mileage	Notes	Vendor	Employee	Total Cost
3/19/2009	23,380				\$0.00
Maintenance Performed					Cost
Oil and Filter					\$0.00
Total:					\$0.00
4/9/2009	24,050				\$0.00
Maintenance Performed					Cost
Fuel Filter					\$0.00
Total:					\$0.00
7/22/2009	28,000				\$0.00
Maintenance Performed					Cost
Fuel Filter					\$0.00
Oil and Filter					\$0.00
Total:					\$0.00
2/23/2010	33,900				\$0.00
Maintenance Performed					Cost
Fuel Filter					\$0.00
Oil and Filter					\$0.00
Total:					\$0.00
12/17/2010	63,030				\$0.00
Maintenance Performed					Cost
Fuel Filter					\$0.00
Oil and Filter					\$0.00
Total:					\$0.00
12/16/2011	80,520				\$0.00
Maintenance Performed					Cost
Oil and Filter					\$0.00
Fuel Filter					\$0.00
Total:					\$0.00
10/14/2013	80,520				\$0.00
Maintenance Performed					Cost
Check air filter, axel oil, lube, trans oil, water filter					\$0.00
Total:					\$0.00
2/24/2014	80,520				\$0.00
Maintenance Performed					Cost
Check air filter, axel oil, lube, trans oil, water filter					\$0.00
Fuel Filter					\$0.00
Oil and Filter					\$0.00
Air Filter					\$0.00
Total:					\$0.00

Part	Name	Used	Unit Cost	Cost
Napa 1792	Oil Filter	1	\$0.00	\$0.00
Napa 3352	Fuel Filter	1	\$0.00	\$0.00
Napa 3674	Fuel Filter	1	\$0.00	\$0.00
Total:				\$0.00

3/10/2015 80,520 Odmeter does not work.

\$298.90

Maintenance Performed				Cost
Oil and Filter				\$249.23
Fuel Filter				\$49.67
Total:				\$298.90

Part	Name	Used	Unit Cost	Cost
Napa 1749	Oil Filter - Dump Truck	1	\$56.18	\$56.18
Oil 15W40	Oil 15W40 or Hyd Oil- Diesel Tks & Equip/not min	44	\$3.20	\$140.80
Napa 1792	Oil Filter - Dump Truck	1	\$52.25	\$52.25
Napa 3674	Fuel Filter - DT#2	1	\$27.08	\$27.08
Napa 3352	Fuel Filter - Dump Truck 2	1	\$22.59	\$22.59
Total:				\$298.90

4/8/2015 80,520

\$254.53

Maintenance Performed				Cost
Wipers, Seat Belt, Antifreeze, Injector Cleaner				\$254.53
Total:				\$254.53

4/15/2015 80,520

\$223.63

Maintenance Performed				Cost
Install new pipe exhaust				\$223.63
Total:				\$223.63

9/28/2015 80,520

\$694.90

Maintenance Performed				Cost
Seal Kit & Hydraulic Oil				\$694.90
Total:				\$694.90

12/8/2015 80,520

\$163.65

Maintenance Performed				Cost
alternator				\$163.65
Total:				\$163.65

1/25/2016 80,520

\$2,001.56

Maintenance Performed				Cost
Replace Clutch Assembly				\$2,001.56
Total:				\$2,001.56

1/29/2016 80,520

\$11.91

Maintenance Performed				Cost
Replaced halogen lamp				\$11.91
Total:				\$11.91

Total: Cost Per Mi/Km/Hr: \$0.05 \$3,649.08

Grand Total: \$3,649.08

Date: 3/10/2009
 Inv. No: 21844
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 023380
 Auth No:

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price
Total Parts		0.00

Sublet	Price
Total Sublet	0.00

Description of Repairs	Labor Price
Labor to check for water in oil. Removed oil pan and thrust plate. Pressure check cooling system and found #2 liner leaking. Removed cylinder head and pulled #2 cylinder. Called for pricing.	983.25

34601105
CKP 1575

Total Labor	983.25
Misc Supplies	0.00
Washing	20.00
Environmental Chg.	0.00
Total Parts	0.00
Total Sublet	0.00
Tax	0.00
TOTAL	1,003.25

GREAT PLAINS CONSTRUCTION
24101 North Mac Arthur, #14
Edmond, OK 73025

Date: 3/19/2009
Inv. No: 21869
Unit No: 02
Vin. No:
Lic. No: Y09-238
Mileage: 023380
Auth No:

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
6	9Y9497 Rod Bearings	144.36	Labor per bid estimate to replace all piston cylinder kits, main and rod bearings. Changed oil, filters and lubed driveline. Washed engine and road test operation. F/R 41.5 hrs.	3,548.25
1	2339474 Gsk Kit	271.94		
4	2N2766 Lock Nut	15.52		
4	8M2295 Bolt	22.48		
6	OR2694 Cyl Kit	2,918.70		
2	4N1151 Gsk Pan	32.16		
1	8C3248 Gsk Kit	21.16		
7	317876 Main Bearings	285.86		
1	2531752 Thrust Plate	29.43		
11	Gal 15/40 Oil	126.72		
1	P55777 Oil Filter	22.40		
1	P554005 Oil Filter	15.25		
1	440F Fuel Filter	6.25		
1	58238 Fuel Filter	11.75		
1	LP20 Cond	3.50		
1	Lubricants	6.00		
2	LP20 Cond	MISC		
14	Roloc Pads	MISC		
1	Engine Assy Grease	MISC		
1	STP Assy Grease	MISC		
24	Plastic Ties	MISC		
5	Gal Solvent Cleaner	MISC		
2	Brake Cleaner	MISC		
2	Scotbrite Pads	MISC		
1	Lacquer Thinner	MISC		
1	Gal 85/140 Gear Oil	MISC		
Total Parts		3,933.48		
Sublet		Price	Total Labor	
			Misc Supplies	
			Washing	
			Environmental Chg.	
			Total Parts	
			Total Sublet	
Total Sublet		0.00	Tax	
			TOTAL	

3/19/09
24101 North Mac Arthur, #14
Edmond, OK 73025

3,548.25
100.00
30.00
15.00
3,933.48
0.00
338.01
7,964.74

GREAT PLAINS CONSTRUCTION
24101 North Mac Arthur, #14
Edmond, OK 73025

Qty.	Description of Parts	Price
6	9Y3368 Liner Shims	337.20
6	Gals Antifreeze	70.43
8	3.5 in Hose Clamps	8.56
1	PA2704 Air Element	52.24
5	Yellow Engine Paint	MISC
1	Manifold Bolt	2.50
2	Lower Radiator Hose	19.00
1	Black Paint	MISC
Total Parts		489.93

Sublet	Price
Total Sublet	0.00

Description of Repairs	Labor Price
NOTE: Extras not on original bid. 22.50 hours totaling 1923.75 at no charge per our phone conversation 3/19/09 for additional labor. Customer to pay parts as noted. Cleaned parts with solvent/brush. Flush and oil prime air compressor, oil pump and turbo. Installed liner shims and replaced lower radiator hoses/clamps. Replaced air cleaner element and clamp. Cleaned engine and painted. Road test operation.	0.00
2. Adjusted clutch free travel.	0.00
3. Drained cooling system and flushed. Winterized and installed LP20 conditioner.	0.00
4. Tighten left rear engine mounts. Bolts all loose to frame. Secured all 4 bolts.	0.00
Total Labor	0.00
Misc Supplies	0.00
Washing	0.00
Environmental Chg.	0.00
Total Parts	489.93
Total Sublet	0.00
Tax	41.06
TOTAL	530.99

Handwritten: Q 4101/09 like 1575

Date: 4/9/2009
 Inv. No: 21909
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage:
 Auth No:

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
1	Cat Fuel Filter	19.45	Check for low power. Replaced both fuel filters and open right fuel tank crossover. Washed and test. No problems Notified.	85.50
1	440F Fuel filter	6.50		
Total Parts		25.95		
Sublet <div> <i>(R) 5/15/09</i> <i>64/628</i> <i>S</i> </div>				85.50
				0.00
				0.00
				0.00
				25.95
				0.00
Total Sublet				0.00
TOTAL				113.62
				Tax 2.17

GREAT PLAINS CONSTRUCTION
24101 North Mac Arthur, #14
Edmond, OK 73025

[illegible]

Sublet	Price
Total Sublet	0.00

Description of Repairs	Labor Price
Adjust all brakes and measure push rod travel. (Note; unit needs brakes on #3 axle replaced. Notified customer).	42.75
Adjust clutch free travel and check stop brake operation. Lube T/O bearing and fork shaft bushings.	85.50
Check transmission for hanging in reverse gear. Possible snap ring damage on gear. Needs transmission remove to inspect inside main box. (Notified customer, no repairs made at this time.)	42.75
Total Labor	171.00
Misc Supplies	0.00
Washing	0.00
Environmental Chg.	0.00
Total Parts	0.00
Total Sublet	0.00
Tax	0.00
TOTAL	171.00

Date: 12/21/2009
 Inv. No: 22252
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 002106
 Auth No: Brannon

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price
1	Lubricants	6.00
1	LP20 Conditioner	3.50
Total Parts		9.50

Sublet	Price
Total Sublet	0.00

Description of Repairs	Labor Price
Performed Dry PM Service Worksheet. Adjusted brakes. Load test all batteries. Washed engine and chassis. Adjusted alternator belts.	299.25

12/31/09
 CK 2/20

Total Labor	299.25
Misc Supplies	20.00
Washing	0.00
Environmental Chg.	0.00
Total Parts	9.50
Total Sublet	0.00
Tax	2.47
TOTAL	331.22

Date: 12/21/2009
 Inv. No: 22253
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 002106
 Auth No: Brannon

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
2	ABEX 4515 Q Kits	138.50	Adjust clutch free travel and lube T/O bearing. Adjust stop brake.	85.50
1	Washing	MISC		
2	Solvent Cleaner	14.00		
1	Axle lock washer	2.00		
1	3090173 Wheel Seal	44.25	Remove rear axle wheels/drums and replace brake kits on #3 axle. Secure wheels and lube s/cams.	384.75
2	Emery Cloth	MISC	Returned brake cores. Had to replace left rear wheel seal leaking into drum. Had trouble getting axle shaft to come out. Heated to remove. Clean and inspect bearings and secured seal. Refilled levels and road test operation.	
1	Heating Supplies	MISC		
1	Silicone Sealant	MISC		
1	85/140 Gear Oil	5.50		
			DOT Federal Inspection.	85.00
Total Parts		204.25		
Sublet		Price		
Total Sublet		0.00		
Total Labor				555.25
Misc Supplies				35.00
Washing				0.00
Environmental Chg.				15.00
Total Parts				204.25
Total Sublet				0.00
Tax				20.05
TOTAL				829.55

12/31/09
 (KR 2/20)

Date: 12/18/2010
 Inv. No: 22805
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 6303
 Auth No:

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price
1	Lubricants	6.00
4	50W Synethic Oil	39.40
1	1/2 Gal. Antifreeze	11.40
1	Washing Supplies	MISC
Total Parts		56.80

Description of Repairs	Labor Price
Performed Dry PM Service Worksheet. Cleaned battery cables and load test all batteries. Filled cooling system and transmission. Wash engine and chassis. Road test and recheck all levels.	299.25
DOT Federal Inspection.	85.00

Sublet	Price
Total Sublet	0.00

Total Labor	384.25
Misc Supplies	20.00
Washing	0.00
Environmental Chg.	0.00
Total Parts	56.80
Total Sublet	0.00
Tax	6.43
TOTAL	467.48

3 01/07/2011
 CK 2462

Date: 12/16/2011
 Inv. No: 23475
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 8052
 Auth No:

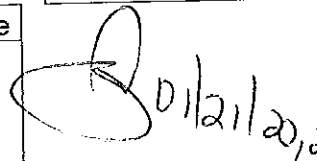
GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price
1	777B Oil Filter	22.40
1	5823B Fuel Filter	15.95
1	4005 Oil Filter	19.69
11	Gal. Rotella Oil	154.54
1	Lubricants	6.00
1	LP20 Conditioner	4.00
1	Half Gallon Antifreeze	8.85
1	2704 Air Element	64.80
1	85/140 Gear	30.40
1	50W gear oil	17.55
1	P/S Fluid	5.50
2	Hub Cap Centers	8.00
1	Washing Supplies	MISC
1	440F Fuel Filter	6.50
Total Parts		364.18

Description of Repairs	Labor Price
Performed Full PM Service Worksheet. Load test and secured all battery cables. Pressure check cooling system and refilled. Refilled #3 axle and transmission. Wash engine, cab and chassis. Road test and recheck all levels.	380.00
Repair rear bed lights on both sides. Replaced air cleaner element. Replaced leaking front center hub caps and adjust front brake push rod travel.	142.50
DOT Federal Inspection .	85.00

Sublet	Price
Total Sublet	0.00

Total Labor	607.50
Misc Supplies	25.00
Washing	0.00
Environmental Chg.	15.00
Total Parts	364.18
Total Sublet	0.00
Tax	32.61
TOTAL	1,044.29


 01/21/2012
 Ckt 3799

Date: 12/10/2012
 Inv. No: 23967
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 010221
 Auth No: GPP12857

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
1	777 Oil Filter	22.40	Performed Full PM Service Worksheet. Load test all batteries. Cleaned terminal and cable ends. Washed engine and road test. Rechecked levels.	380.00
1	Cat Fuel Filter	15.95		
1	Cat Oil Filter	19.69		
11	Gals Rotella Oil	154.55		
1	Lubricants	6.50	Removed both front wheels. Cleaned and inspected wheel bearings. Changed wheel seals and brake hardware kits. Washed axle and hubs. Secured wheels. Returned cores. Refilled levels. Road test for leaks.	380.00
1	LP20 Conditioner	4.00		
2	80/140 Synthetic	25.00		
2	Hub Cap Centers	8.00		
1	440 Fuel Filter	6.50		
2	370001 Wheel Seal	83.70		
4	1308 Brake Shoes	109.00	DOT Federal Inspection.	85.00
1	Washing Supplies	MISC		
Total Parts		455.29		
Sublet		Price		
Total Sublet		0.00		
				845.00
				35.00
				0.00
				15.00
				455.29
				0.00
				Tax 41.09
TOTAL				1,391.38

12/21/12
 CK 11823

Date: 2/4/2013
 Inv. No: 24053
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 010464
 Auth No:

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
2	4F7387 Seal	13.02	Pressure washed engine and under frame. Road test for oil leak on right side engine. Drained cooling system. Removed engine tubing and hoses to remove oil filter assembly and oil cooler element. Cleaned housing and element as needed. Picked up parts at dealership and Warren Cat for repairs. Assemble right side engine and secured all hoses. Refilled cooling system and oil filter. Road test to operating temperature. Pressure test cooling sytem. Rechecked all levels.	665.00
1	4N0641 Gasket	3.18		
2	232251 O Ring	17.80		
2	3P0650 Seal	40.40		
1	Gal Antifreeze	17.70		
1	Cat Water Cond	10.50		
1	Loctite Sealant	MISC		
4	Plastic Ties	MISC		
1	Emery Cloth	MISC		
1	3 In Sand Disc	MISC		
1	Washing Supplies	MISC		
Total Parts		102.60		
Sublet Price 03/09/2013 (L# 5043)				
Total Labor				665.00
Misc Supplies				35.00
Washing				0.00
Environmental Chg.				0.00
Total Parts				102.60
Total Sublet				0.00
Total Sublet				0.00
Tax				11.53
TOTAL				814.13

Date: 9/15/2008
 Inv. No: 21504
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 021360
 Auth No:

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
10	Gals 15/50 Oil	115.20	Drained oil, Changed oil and filters. Cleaned crank case breather and refilled all levels.	85.50
1	77713 Filter	22.40		
1	4005 Filter	15.25	Rotated right rear tire to air up both tires.	42.75
1	Misc Electrical	3.00	Repaired rear light wiring and all lights on rear.	85.50
2	1157 Bulbs	3.00	Wash engine. Road test to operating temperature and rechecked all levels.	85.50
Total Parts		158.85		
Sublet		Price		
Total Sublet		0.00		
Total Labor Misc Supplies Washing Environmental Chg. Total Parts Total Sublet				299.25 20.00 20.00 10.50 158.85 0.00
TOTAL				Tax 14.99 523.59

10/21/08
 LCA 1330

Date: 9/12/2008
 Inv. No: 21499
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 021360
 Auth No:

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
4	Fuel Clamps	35.72	Removed air compressor to replace leaking fuel seal.	0.00
1	Fuel Nut	24.76	Found rail damage and lifter tip broken. Had to	
1	P/S Seal Kit	28.05	remove fuel pump and sublet to have repairs made.	
1	Gal Oil	11.52	Removed P/S unit and installed shaft seal and refilled	0.00
			system.	
			NOTE: Notified customer of water in oil. No warranty	0.00
			on fuel pump repairs because of previous water	
			damage inside pump. Also notice low oil pressure	
			when idling. Possible water damage to all bearings.	
Total Parts		100.05		
Sublet		Price		
Sublet Repairs		1,293.61		
Total Sublet		1,293.61		
Total Labor				0.00
Misc Supplies				0.00
Washing				0.00
Environmental Chg.				0.00
Total Parts				100.05
Total Sublet				1,293.61
Tax				8.38
TOTAL				1,402.04

3/10/07/08
 1333

Date: 7/15/2008
 Inv. No: 21374
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 020614
 Auth No:

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price
1	Air Switch	31.41
1	LP20 Conditioner	3.50
1	Gal Antifreeze	17.80
1	Axle Filter	5.10
Total Parts		57.81

Description of Repairs	Labor Price
Road test to check for noise in transmission or axles. Check popping or gear tooth noise when in a pull. Drained all boxes and checked for metal. Very little metal found. Refilled boxes. Checked power divider for engage and release. Found problem with air switch. Power divider partial engaging. Removed and replaced defective air switch. Road test and rechecked operation.	342.00
Pressure wash axle housing and replaced front axle lube filter. Tightened driveline caps and lubed driveline. Checked all levels. Filled radiator.	171.00

Sublet	Price
Total Sublet	0.00

Total Labor	513.00
Misc Supplies	25.00
Washing	20.00
Environmental Chg.	12.00
Total Parts	57.81
Total Sublet	0.00
Tax	6.94

TOTAL

634.75

8/26/08
 LKH 1284
 5

Date: 5/3/2008
 Inv. No: 21156
 Unit No: 02
 Vin. No:
 Lic. No: Y09-238
 Mileage: 17562
 Auth No:

GREAT PLAINS CONSTRUCTION
 24101 North Mac Arthur, #14
 Edmond, OK 73025

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
11	Gals 15/50 Mystic	126.72	Performed PM Worksheet. Repairs noted on worksheet. This unit needs follow-up repairs and is not road ready.	342.00
1	777B Oil Filter	22.40		
1	4005 Oil Filter	15.25		
1	440F Fuel Filter	6.25		
1	5823B Fuel Filter	11.75	Adjusted clutch free travel.	85.50
1	Lubricants	6.00		
1	Gal Antifreeze	17.80	Repair cab lights. Picked up parts at Freightliner.	85.50
1	LP20 Conditioner	3.50	Replaced cab lens.	
2	Cab Lights	18.00		
2	Cab Lights	2.00		
Total Parts		229.67		
Sublet		Price		
Total Sublet		0.00		
Total Labor Misc Supplies Washing Environmental Chg. Total Parts Total Sublet				513.00 20.00 20.00 15.00 229.67 0.00
TOTAL				Tax 20.92 818.59

5/10/08
 CK# 1167

Date: 10/2/2007
 Inv. No: 20684
 Unit No: 1096
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 012901
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price
1	King Pin Set	263.30
1	*Cylinder Hone	MISC
2	*Sanding Stones	MISC
1	*Lubricants	MISC
2	*Solvent Cleaner	MISC
1	*3080836 W/Seal	38.48
1	*Heating Supplies	MISC
2	*Cotter Keys	MISC
1	*Sealant	MISC
1	*NOT ON ORIGINAL BID	MISC
Total Parts		301.78

Sublet	Price
Total Sublet	0.00

Description of Repairs	Labor Price
Bid estimate to replace king pin on left front only. Pressure clean axle. Removed brakes, wheels to replace. Could not get pin freed. Removed hub and brake backing plate to drive out king pin. Installed king pin set and secured spindle. Replaced wheel seal and installed brakes. Secured wheel and lubed. Adjusted all brakes per specification. (Note: Bid estimate 4.0 hrs. Actual time 8.0 hrs. Billed 5.0 hrs.)	427.50
Performed DOT Federal Inspection.	85.00

Total Labor	512.50
Misc Supplies	30.00
Washing	10.00
Environmental Chg.	0.00
Total Parts	301.78
Total Sublet	0.00
Tax	27.80

TOTAL

882.08

LEE BROTHERS TRUCKING INC.
Rick Lee
7850 N W 192nd Street
Edmond, OK 73003

Sublet	Price
Total Sublet	0.00

Description of Repairs	Labor Price
Perform PM Service Worksheet. Repairs noted on work sheet. This unit needs follow-up repairs and is not road ready.	342.00
Perform DOT Federal Inspection. (Note; this unit failed inspection and IS NOT ROAD READY)	0.00
NOTE; No follow-up repairs made at this time. See attach work sheet for repairs and parts needed. Reschedule !!!	0.00
Total Labor	342.00
Misc Supplies	20.00
Washing	0.00
Environmental Chg.	15.00
Total Parts	222.11
Total Sublet	0.00
Tax	20.29
TOTAL	619.40

Date: 9/18/2007
 Inv. No: 20640
 Unit No: 1096
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 012002
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price
2	Brake Boosters	127.96
2	BC Disposal	10.00
Total Parts		137.96

Description of Repairs	Labor Price
Replace rear axle brake chambers. Springs broken in boosters. Replaced both rear axle boosters and secured air lines. Adjusted all brakes. Rechecked operation.	240.00

Sublet	Price
Total Sublet	0.00

Total Labor	240.00
Misc Supplies	15.00
Washing	0.00
Environmental Chg.	0.00
Total Parts	137.96
Total Sublet	0.00
Tax	12.82
TOTAL	405.78

9/18/07
CKA 2123

Date: 6/15/2007
 Inv. No: 20491
 Unit No: 1096
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 007719
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price
2	Auto Slack Adjuster	178.90
Total Parts		178.90

Sublet	Price
Total Sublet	0.00

Description of Repairs	Labor Price
Checked front brake adjuster clearance at 1 3/4 but right front brake still dragging. Removed auto slack adjusters and replaced both front wheel adjusters. Reset and rechecked clearance.	80.00

6/15/07
UKH 2089

Total Labor	80.00
Misc Supplies	0.00
Washing	0.00
Environmental Chg.	0.00
Total Parts	178.90
Total Sublet	0.00
Tax	14.99
TOTAL	273.89

Date: 6/15/2007
 Inv. No: 20490
 Unit No: 1096
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 007719
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price
1	Heating Supplies	5.00
2	Tie Rod Ends	68.00
1	Lubricants	5.00
1	Front Brake Shoes	68.00
3	Cotter Keys	3.00
3	Mounting Bolts	MISC
1	Wheel Seal 308-0836	38.47
1	Wheel Lock	3.75
2	85/140 Gear Oil	8.30
1	Silicone Sealant	MISC
2	Frame bolts	MISC
Total Parts		199.52

Description of Repairs	Labor Price
Adjusted clutch free travel and stop brake.	80.00
Removed tie rod and replaced both ends. Reset tow in and secured tie rod. Lubed and checked operation.	160.00
Removed right front wheel and inspected brake shoe lining for possible dragging. Replaced shoes and wheel seal. Secured wheel. Refilled levels.	160.00
Replaced missing bolts in frame and tightened cross over support as needed.	80.00

Sublet	Price
Total Sublet	0.00

*Ok 1/18/07
 OK 2059*

Total Labor	480.00
Misc Supplies	30.00
Washing	0.00
Environmental Chg.	20.00
Total Parts	199.52
Total Sublet	0.00
Tax	19.23
TOTAL	748.75

Date: 6/14/2007
 Inv. No: 20489
 Unit No: 1096
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 007719
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price
11	Gals 15/50 Mystic	119.90
1	777 Oil Filter	22.40
1	LFP4005 Oil Filter	15.25
1	LFP440F Fuel Filter	6.25
1	LFP5823B Fuel Filter	11.75
1	Gal Antifreeze	10.98
2	LP20 Conditioner	7.00
1	67 Bulb	1.00
1	Distill Water	MISC
1	Lubricants	5.00
2	Battery cables	MISC
8	3/8 Nuts	MISC
3	1/4 Althread	MISC
12	1/4 Nuts	MISC
Total Parts		199.53

Description of Repairs	Labor Price
Performed PM Service worksheet and adjusted all brake auto adjusters. Removed batteries and installed wood bottom to hold batteries. Cleaned cable ends and installed batteries. Repaired all lights. Pressure check cooling system for leaks. Tightened top radiator hoses. Refilled levels. Washed engine and undercarriage.	400.00
Replace battery cables on positive side and metal hold down for all batteries. Filled levels and wash off all batteries. Seal nuts and recheck charging system.	0.00

Sublet	Price
Total Sublet	0.00

Total Labor	400.00
Misc Supplies	20.00
Washing	15.00
Environmental Chg.	15.00
Total Parts	199.53
Total Sublet	0.00
Tax	18.40
TOTAL	667.93

6/18/07
CK 2059

Date: 1/25/2007
 Inv. No: 20257
 Unit No: 1096
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 004061
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
1	LFP777B Oil Filter	18.25	Performed PM Service worksheet and washed engine. Checked for water contamination in engine. Checked coolant condition and water test strip and adjust levels. Cleaned engine vent tube. Notified customer of possible causes. No repairs made for water in oil problems at this time. Painted engine and road test operation. Rechecked levels.	253.05
1	LFP4005 Oil Filter	15.25		
1	LFP440F Fuel Filter	6.25		
1	LFF5823B Fuel Filter	11.75		
2	Water Conditioner	7.00		
1	Water Test Strip	2.50	Adjusted all belts and checked charging system. Two inside batteries test borderline, but ok.	0.00
11	Mystic 15/50 Oil	114.18		
1	Lubricants	5.00		
1	Solvent Cleaner	MISC	Adjusted all brakes.	0.00
			Adjusted tire pressures.	0.00
Total Parts		180.18		
Sublet		Price		
Total Sublet		0.00		
Total Labor				253.05
Misc Supplies				20.00
Washing				15.00
Environmental Chg.				15.00
Total Parts				180.18
Total Sublet				0.00
Tax				16.78
TOTAL				500.01

Date: 1/24/2007
 Inv. No: 20256
 Unit No: 1096
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 004061
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
1	Used Cover	75.00	Repaired oil leak at rear engine cover. Picked up used cover at salvage and cleaned and painted cover. Pressure washed engine and transmission and replaced engine cover. Road test for leaks at cover. Found rear main seal leaking at transmission bell housing. Cleaned crankcase breather and engine vent tube. Notified customer of water condensation and discussed possible causes. No further repairs at this time.	211.67
1	Engine Paint	6.50		
Total Parts		81.50		
Sublet		Price	Total Labor 211.67 Misc Supplies 0.00 Washing 0.00 Environmental Chg. 0.00 Total Parts 81.50 Total Sublet 0.00 Tax 6.83 TOTAL 300.00	
Total Sublet		0.00		

Date: 1/3/2007
 Inv. No: 20235
 Unit No: 1096
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage:
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
			Service call out to check for air leak at transmission. Found air lines on foot brake valve off. Installed lines. Rechecked for air leak.	120.00
Total Parts		0.00		
Sublet		Price		
Total Sublet		0.00		
Total Labor				120.00
Misc Supplies				0.00
Washing				0.00
Environmental Chg.				0.00
Total Parts				0.00
Total Sublet				0.00
Tax				0.00
TOTAL				120.00

Date: 9/18/2006
 Inv. No: 20074
 Unit No: 1096
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 490264
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
1	Air Compressor	415.00	Check for slow air recovery rate at air compressor. Found oil in compressor and air volume weak, also air dryer plug with oil. By-passed air dryer and re-test air recovery, but would not pass test. Drain cooling system and replaced air compressor. Refilled system and pressure check for leaks. Re-test recovery rate with air dryer still by-passed and system pass recovery test. Replace D-2 governor valve and set air pressure. Secured all hoses as needed. (4.0)	280.00
1	D-2 Governor	25.00		
3	Drain Valves	MISC		
6	Plastic loom	MISC		
12	Plastic ties	MISC		
1	Used air dryer	MISC		
4	Brake diaphragms	MISC		
32	5/16 Fuel line	MISC		
15	5/16 Oil line	MISC		
			Replaced two (2) defective hoses on air compressor and chaffed lines as needed. (1.5)	0.00
			Installed take off air dryer and plumb air fittings as needed. Secured air lines and check purge valve operation. (2.0)	0.00
			Check for air leak on rear brake chambers at times when applying brakes. Found diaphragms defective on service side. Replace both rear diaphragms and recheck operations. (2.5)	0.00
			Replace air tank drain valves on two (2) air tanks and secured lines. (.5)	0.00
Total Parts		440.00		
Sublet		Price	Total Labor 280.00 Misc Supplies 25.00 Washing 0.00 Environmental Chg. 12.00 Total Parts 440.00 Total Sublet 0.00 Tax 38.97 TOTAL 795.97	
Total Sublet		0.00		

9/19/06
 UK# 5021

Date: 9/1/2006
 Inv. No: 20061
 Unit No: FRT
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 489901
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
1	LFP777B Oil Filter	18.25	#1 Performed PM Service Worksheet and washed engine for painting. Clean crankcase breather and road test operation. Recheck all levels.	240.00
1	LFP4005 Oil Filter	15.25		
1	LFP440F Fuel Filter	6.25		
1	LFF5823B Fuel Filter	11.75		
2	LP 20 conditioner	7.00	#2 Paint engine caterpillar yellow.(1.0)	0.00
2	Water Test Strip	5.00		
1	Lubricants	5.00	#3 Pressure cooling system and replace defective cap. (.5)	0.00
10	Gals 15/50 Mystic	90.00		
4	*#2 Engine paint	MISC		
1	*#2 Black paint	MISC	#4 Adjust clutch free travel to 1.5 inch, was 4.5 inch. (1.0)	0.00
1	*#3 Radiator cap	7.65		
1	*#6 Air drain valve.	MISC		
2	*#6 Brake diaphragm	17.30	#5 Drain fuel separator and refilled. (.25)	0.00
1	*#7 PH454 filter	6.25	#6 Replace leaking 30/30 brake diaphragms on #2 axle boosters and replace air tank pull valve on secondary air tank. (1.5)	0.00
			#7 Replace #2 axle gear lube filter and secured cover.	0.00
			#8 In-Service-Sheet for customer records. (.5)	0.00
Total Parts		189.70		
Sublet		Price	Total Labor	
			Misc Supplies	
			Washing	
			Environmental Chg.	
			Total Parts	
			Total Sublet	
Total Sublet		0.00	Tax	
			TOTAL	
			508.11	

Date: 9/1/2006
 Inv. No: 20060
 Unit No: FRT
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 489901
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price	
1	#1 Welding Supplies	MISC	#1 Spot welded frame on left rear as needed and straightened right rear plate. Weld as needed. Install mud flaps. Used H/D flaps.	120.00	
2	*#1 HD Mud Flaps	30.16			
1	*#1 Painting supplies	MISC			
8	*#1 Mounting bolts	MISC	#2 Installed battery hold downs and rubber flap in tray of box. Cut off defective cables and filled all levels. Rechecked charging system.	80.00	
1	#2 Shop Supplies	MISC			
1	*#2 All Thread	1.85			
2	*#3 4034 Frt Hub Caps	59.88	#3 Cleaned front axle hubs. Could not clean hub caps. Replaced both caps and refilled levels.	40.00	
1	#4 Shop Supplies	MISC			
1	#5 Speedo End	MISC			
Total Parts		91.89	#4 Straightened right front spring and torqued all u-bolts.	80.00	
			#5 Road test speedometer. Defective after 40 mph. Check and replaced tip end at transmission. Removed head and found defective. Needs part # SW-P-550SW speedometer head @ 105.80 plus freight. Secured dash and cable ends. NO REPAIR PARTS ORDERED.	120.00	
			Total Labor		440.00
			Misc Supplies		35.00
			Washing		0.00
			Environmental Chg.		20.00
			Total Parts		91.89
			Total Sublet		0.00
Total Sublet		0.00	Tax		10.63
				TOTAL	597.52

Sublet	Price
Total Sublet	0.00

Date: 8/31/2006
 Inv. No: 20058
 Unit No: FRT
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 489901
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
1	2.5 Gals Gear Oil	41.50	#8 Labor to remove axles and hubs to replace wheel seals. Cleaned and inspected wheel bearings. Pressure cleaned hubs and axle shafts. Replaced seals and secured hubs and wheels. Road test and rechecked levels.	160.00
2	Axle Gaskets	5.80		
1	Lubricants	MISC		
2	392-9131 Seal	53.00		
2	Wheel Locks	5.08		
2	Solvent Cleaner	11.50		
1	Silicone Sealant	MISC	#9 Checked air loss in dash and advise of needed repairs. Parts needed. (1) HP03P air control valve @ 35.10 (1) RKN-20001 axle lock valve @ 34.09 (1) FSC17491121 Axle lock switch @ 11.26. NO REPAIRS MADE AT THIS TIME.	0.00
Total Parts		116.88		
Sublet		Price	Total Labor 160.00 Misc Supplies 0.00 Washing 10.00 Environmental Chg. 5.00 Total Parts 116.88 Total Sublet 0.00 Tax 9.79 TOTAL 301.67	
Total Sublet		0.00		

Date: 8/31/2006
 Inv. No: 20057
 Unit No: FRT
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 489901
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
4	#1 Amber Reflector	4.00	#1 Install reflectors on box and repaired right front hood light pigtail socket as needed.	120.00
4	#1 Red Reflector	4.00		
12	#1 Mounting Hardware	3.60	#2 Secured air brake hoses on rear axle and adjusted all brakes.	120.00
1	#1 Electrical Supplies	MISC		
4	#2 Hose Dividers	9.00		
6	#2 Plastic Ties	MISC	#4 Repaired city horn. Found relay under dash and horn defective. Replaced and secured wiring.	120.00
4	#3 Brake Shoes	105.00		
2	#3 Spring Brake Kits	25.00	#3 Replaced #2 axle brake shoes and drums. Found wheel seals leaking on both hubs. Checked fluid levels and found #2 axle 1 gallon low and #3 axle 1.5 gallons low. Cleaned axles and replaced brakes and drums. (see *8).	240.00
2	#3 A/M 66895 Drum	205.06		
1	#4 A/M City Horn	17.50		
1	#4 Horn Relay	10.50		
6	*#5 Washer Hose	9.72		
1	#5 Washer Switch	33.95	#5 Removed washer reservoir and cleaned pump and all lines. Replaced missing hoses and secured. Replaced broken tee fittings and washer control switch. Refilled reservoir and checked operation.	140.00
1	*#5 Tee Fitting	2.91		
6	#5 Plastic Ties	MISC	#6 Replaced lower steering u-joint and lubed shaft.	80.00
1	#6 Steering U-Joint	16.50		
1	#7 Misc Air Supplies	20.00	#7 Checked for air leaks. Repaired air leak at transmission slave valve and secured hoses. (See #9 for repairs needed.)	80.00
Total Parts		466.74		
Sublet		Price	Total Labor	900.00
			Misc Supplies	35.00
			Washing	0.00
			Environmental Chg.	30.00
			Total Parts	466.74
			Total Sublet	0.00
Total Sublet		0.00	Tax	42.05
TOTAL				1,473.79

Date: 8/30/2006
 Inv. No: 20056
 Unit No: FRT
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 489901
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price	
10	#5 Steel Hose 1/2	40.80	*5. Removed defective fuel hose behind cab and made up new hoses and re-route and chaffed lines behind engine and under exhaust. Made up brackets and changed fuel fitting at separator. Re-position separator. Refilled and checked operation. *6. Removed defective starter to replace solenoid and repair ground strap to starter. Picked up solenoid and ground strap and installed. Fit strap as needed. Secured and checked operation. *7. Drained radiator. Replaced wrong size fitting on separator for water and re-route heater core hoses away from exhaust. Replaced burnt hoses as needed and installed brackets as needed. Chaffed all lines. Added LP20 conditioner to water and refilled system. * Denotes extras not on original bid estimate.	160.00	
4	#5 Fuel Hose Ends	25.20		200.00	
1	#5 90 Degree Fuel Fitting	MISC			
14	#5 1 1/2 Plastic Loom	19.04			
1	#5 Lge Pkg Ties	MISC			
1	#6 Solenoid	77.21			
1	#6 Ground Strap	MISC			
2	#7 3/4 Nipple	MISC			
2	#7 5/8 90 Fitting	MISC			
6	#7 3/4 Hose Clamps	MISC			
3	#7 LP20 Conditioner	10.50			
14	#7 Hose Clamps	MISC			
3	#7 5/8 Heater Hose	MISC			
Total Parts		172.75			0.00
Sublet		Price	Total Labor	560.00	
			Misc Supplies	0.00	
			Washing	0.00	
			Environmental Chg.	0.00	
			Total Parts	172.75	
			Total Sublet	0.00	
Total Sublet		0.00	Tax	14.48	
			TOTAL	747.23	

Date: 8/30/2006
 Inv. No: 20055
 Unit No: FRT
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 489901
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price
2	#1 P/S Fittings	20.42
3	#1 Steel Hose	15.30
1	#1 Electrical Supplies	MISC
24	#1 Plastic Ties	3.60
2	#1 Plastic Loom	1.02
2	#1 Hose Clamp	MISC
2	#1 Qts 15/40 Oil	4.50
24	#2 Plastic Ties	3.60
1	#2 Hose Clamp	MISC
2	#3 GT17512 Belt	20.50
2	#3 GT22591 Belt	34.50
1	#4 Misc Supplies	MISC
Total Parts		103.44

Description of Repairs	Labor Price
1. Labor to secure wiring and hoses on left side engine. Remove P/S hoses and replaced. Secured hoses and refill P/S system. Could not tighten starter wiring. Found solenoid burnt into. Also fuel line behind engine too short and needs replaced. (See *5 for fuel line and *6 for starter).	220.00
2. Secured water hoses on right side frame rail. Made up brackets and secured A/C hoses. Need to re-route water hoses burned by exhaust. (See *7).	80.00
3. Replaced defective engine belts and adjust.	80.00
4. Removed TPV and plug air lines as needed. Secured air hoses and hydraulic hoses behind transmission as needed.	160.00

Sublet	Price
Total Sublet	0.00

Total Labor	540.00
Misc Supplies	35.00
Washing	0.00
Environmental Chg.	30.00
Total Parts	103.44
Total Sublet	0.00
Tax	11.60
TOTAL	720.04

Date: 8/28/2006
 Inv. No: 20054
 Unit No: FRT
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 489901
 Auth No:

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Qty.	Description of Parts	Price	Description of Repairs	Labor Price
1	FL12099A Elbow	52.10	Labor to cut off exhaust system to repair. Could only reuse one elbow under cab and at turbo. Replace all other piping. *Extra time (1.0) to repair elbow at turbo and replace lower stack piping and elbow. Braze weld elbow at turbo. Added 4 u-bolts to secure muffler stack and lower piping. Paint exhaust piping with temperature paint and check for leaks. (7.5 hrs).	480.00
2	Stainless Flex Piping	61.24		
8	Band Clamps	90.32		
2	Exhaust U-Bolts	8.40		
1	Turbo V-Clamp	20.11		
1	Exhaust Muffler	67.50		
1	Cutting Supplies	MISC		
1	Welding Supplies	MISC		
4	*Exhaust U-Bolts	16.80		
1	*10545 Elbow 45 degree	30.75		
1	*Lower Stack Piping	48.60		
12	*Washer/Lock	MISC		
1	*Brazing Rod	MISC		
1	*High Temp Paint	MISC		
Total Parts		395.82		

Sublet	Price
Total Sublet	0.00

Total Labor	480.00
Misc Supplies	35.00
Washing	0.00
Environmental Chg.	20.00
Total Parts	395.82
Total Sublet	0.00
Tax	36.08
TOTAL	966.90

LEE BROTHERS TRUCKING INC.
 Rick Lee
 7850 N W 192nd Street
 Edmond, OK 73003

Date: 8/24/2006
 Inv. No: 20046
 Unit No: FRT
 Vin. No: HH309034
 Lic. No: 287-908
 Mileage: 489901
 Auth No:

Qty.	Description of Parts	Price
Total Parts		0.00

Sublet	Price
Total Sublet	0.00

Description of Repairs	Labor Price																
#1 Performed DOT Federal Inspection on 1987 Freightliner #HH309034. Unit would not pass inspection. See attached list of needed repairs.	75.00																
#2 Pressure wash engine and front axle and made list of needed repairs for customer.	0.00																
<table> <tr> <td>Total Labor</td><td>75.00</td></tr> <tr> <td>Misc Supplies</td><td>0.00</td></tr> <tr> <td>Washing</td><td>0.00</td></tr> <tr> <td>Environmental Chg.</td><td>0.00</td></tr> <tr> <td>Total Parts</td><td>0.00</td></tr> <tr> <td>Total Sublet</td><td>0.00</td></tr> <tr> <td>Tax</td><td>0.00</td></tr> <tr> <td>TOTAL</td><td>75.00</td></tr> </table>		Total Labor	75.00	Misc Supplies	0.00	Washing	0.00	Environmental Chg.	0.00	Total Parts	0.00	Total Sublet	0.00	Tax	0.00	TOTAL	75.00
Total Labor	75.00																
Misc Supplies	0.00																
Washing	0.00																
Environmental Chg.	0.00																
Total Parts	0.00																
Total Sublet	0.00																
Tax	0.00																
TOTAL	75.00																