

DA0530

Repair Order Detail TranSpec Leasing, Inc.

1 of 7

| | | |
|-----------------------------------|------------------------------|-----------------------------------|
| Repair Order: OMA-00043990 | Status: CLOSED | Repair Class: NONSCHEDULED |
| Shop: OMA | | Repair Site: FACILITY |
| Unit: 1342 | Customer: TRALEA | Opened: 8/24/2015 |
| 2009 PETERBILT 386 | I/CO-TL - TRANSPEC | Closed: 9/28/2015 |
| Domicile: OMA | Make: PTRBL | Completed: 9/26/2015 |
| Cost Cntr: 1101 OMA | Model: 386 | Odometer: 1,000,170 |
| License: | Year: 2009 | |
| VIN: 1XPHD49X79D770456 | In Service: 11/6/2009 | |

| | | |
|-------------------------------|---------------------------------|------------------|
| Section: 1 | Complaint: INOPERATIVE | Comments: |
| Priority: 5 | Rep Reason: DRIVERREPORT | CEL |
| Component: 045-021 | Unit War: None | |
| Electronic Engine Controls | | |
| War. Type: NO WARRANTY | | |

| | |
|-----------------------|--------------|
| Vendor: MHCOMA | MHC OF OMAHA |
|-----------------------|--------------|

Comments

| Date: | Comment Text | Vendor |
|----------|---|--------|
| 08/24/15 | pulled truck in and checked for codes. Has active code for dpf face plugged. performed trouble shooting tree and wanted | N |
| 08/24/15 | me to trouble shoot any egr or turbo codes. had two inactive codes for turbo speed . performed trouble shooting tree | N |
| 08/24/15 | for turbo speed and found that egr cooler could be plugged. [THOBLO] | N |
| 08/24/15 | drained coolant and removed turbo, exhaust manifold and egr cooler. found cooler is leaking also found valve seals | N |
| 08/24/15 | starting to leak. ordered parts [THOBLO] | N |
| 08/27/15 | helped TJ move truck to repair row [JACHEN] | N |
| 08/27/15 | ran injector leak down test and all passed. pulled truck out and ran. performed injector cut out test and cylinder | N |
| 08/27/15 | performance test. all passed [THOBLO] | N |
| 08/27/15 | started checking fuel system and found out of spec by 15 psi on the high side. when to check regulator and had to | N |
| 08/27/15 | remove line. when removing line it developed a kink. took hose off. part will not be here till tuesday. pushed truck | N |
| 08/27/15 | into hole on repair row [THOBLO] | N |
| 09/02/15 | performed trouble shooting steps for truck blowing white smoke. got down to performing injector cut out test and all | N |
| 09/02/15 | passed. [THOBLO] | N |
| 09/02/15 | then went to swaping actuators and truck is still blowing white smoke [THOBLO] | N |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00043990 **Unit:** 1342

| | | |
|----------|---|---|
| 09/03/15 | pulled truck out and performed regen. shut truck off and turned back on. truck started to blow white smoke again. | N |
| 09/03/15 | pulled up to shop and checked for codes, found one active code for vgt. let truck run and code went away. took truck | N |
| 09/03/15 | for test drive around the lot and could not get truck to go above 1400rpms in low gears. possible ecm calibration needs | N |
| 09/03/15 | done [THOBLO] | N |

Labor

| Date: | Mechanic | Description | Vendor | Hours | Rate | Total |
|----------|----------|--|--------|-------|---------|---------|
| 08/24/15 | THOBLO | Electronic Engine Controls, DISASSEMBLE | N | 0.12 | \$25.00 | \$3.00 |
| 08/24/15 | THOBLO | Electronic Engine Controls, DISASSEMBLE | N | 2.88 | \$25.00 | \$72.00 |
| 08/24/15 | THOBLO | Electronic Engine Controls, DISASSEMBLE | N | 1.15 | \$25.00 | \$28.75 |
| 08/24/15 | THOBLO | Electronic Engine Controls, DISASSEMBLE | N | 0.42 | \$25.00 | \$10.50 |
| 08/24/15 | THOBLO | Electronic Engine Controls, DISASSEMBLE | N | 0.38 | \$25.00 | \$9.50 |
| 08/27/15 | JACHEN | Electronic Engine Controls | N | 0.57 | \$25.00 | \$14.25 |
| 08/27/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 3.93 | \$25.00 | \$98.25 |
| 08/27/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 2.42 | \$25.00 | \$60.50 |
| 09/02/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 2.48 | \$25.00 | \$62.00 |
| 09/02/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 0.02 | \$25.00 | \$0.50 |
| 09/02/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 0.08 | \$25.00 | \$2.00 |
| 09/02/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 0.02 | \$25.00 | \$0.50 |
| 09/02/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 1.07 | \$25.00 | \$26.75 |
| 09/02/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 0.73 | \$25.00 | \$18.25 |
| 09/03/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 3.87 | \$25.00 | \$96.75 |
| 09/03/15 | THOBLO | Electronic Engine Controls, INSPECTED | N | 0.12 | \$25.00 | \$3.00 |
| 09/11/15 | THOBLO | Electronic Engine Controls, LEAKING, INSPECTED | N | 0.02 | \$25.00 | \$0.50 |

Services

| Date: | Description | Vendor | Charge | Total |
|----------|------------------|--------|--------|--------|
| 08/25/15 | egr cooler parts | Y | \$0.00 | \$0.00 |

| | | |
|------------------------|------------------------|--------------------|
| Section: 2 | Complaint: INOPERATIVE | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | replace egr cooler |
| Component: 043-001 | Unit War: None | |
| Emission Controls | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|----------|---|
| 08/25/15 | removed the fuel doser valve from the engine removed all EGR cooler coolant pipes [DOURE] |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00043990 **Unit:** 1342

| | |
|----------|--|
| 08/26/15 | assisted Doug w with the turbo and the Exhaust filter removal [CURHAU] |
| 08/26/15 | replaced the EGR cooler [DOURE] |
| 08/26/15 | reinstalled cooler and all coolant orings for the EGR cooler [DOURE] |
| 08/26/15 | installed the exhaust manifold and torqued the bolts to the specified torque of 44 ftlbs [DOURE] |
| 08/26/15 | installed the turbo [DOURE] |
| 08/26/15 | reinstalled the electronic turbo actuator follow ing procedure and calibrated the actuator to the turbo [DOURE] |
| 08/26/15 | reinstalled all coolant lines and the oil pressure and drain line [DOURE] |
| 08/26/15 | reinstalled the fuel doser w with new gasket and new bolts and reinstalled on the exhaust pipe [DOURE] |
| 08/26/15 | removed the DPF from the truck for cleaning [DOURE] |
| 08/26/15 | disassembled dpf and checked for coolant inside the DPF found none took filter to the cleaning machine and cleaned the |
| 08/26/15 | DPF [DOURE] |
| 08/26/15 | cleaned the DOC and installed new gaskets for the dpf and the DOC and tightend the clamps and reinstalled the |
| 08/26/15 | differantal pressure tubes [DOURE] |
| 08/26/15 | finnished hooking up lines to the 7th injector. installed air intake tubeing. filled w with coolant. [MICRUF] |
| 08/26/15 | secured w iring for turbo [MICRUF] |
| 08/26/15 | cleaned aftertreatment and exhaust connections/ finnished asm. ATD and installed onto unit. / connected exhaust w with |
| 08/26/15 | new seals [MICRUF] |
| 08/26/15 | connected aand secured all ATD wiring. installed ATD cover and final Exhaust w with new seal and new band clamp [MICRUF] |
| 08/26/15 | started unit and checked for leaks/ found no leaks/ pulled unit outside and ran to temp to top off coolant [MICRUF] |
| 08/26/15 | w hile unit w as running - cleaned bay [MICRUF] |
| 08/26/15 | reset ATD and cleared codes/ started regen [MICRUF] |
| 08/26/15 | regen finnished and stacks still smoking bad. cleared out repair row and parked 1342 in repair row . [MICRUF] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-------------------|-------|---------|---------|
| 08/25/15 | DOUREI | Emission Controls | 2.92 | \$25.00 | \$73.00 |
| 08/25/15 | DOUREI | Emission Controls | 0.00 | \$25.00 | \$0.00 |

Repair Order Detail

TranSpec Leasing, Inc.

| | |
|-----------------------------------|-------------------|
| Repair Order: OMA-00043990 | Unit: 1342 |
|-----------------------------------|-------------------|

| | | | | | |
|----------|--------|---------------------------------------|------|---------|----------|
| 08/25/15 | DOUREI | Emission Controls | 0.90 | \$25.00 | \$22.50 |
| 08/26/15 | CURHAU | Emission Controls | 1.40 | \$25.00 | \$35.00 |
| 08/26/15 | DOUREI | Emission Controls | 3.90 | \$25.00 | \$97.50 |
| 08/26/15 | MICRUF | Emission Controls | 4.53 | \$25.00 | \$113.25 |
| 08/26/15 | MICRUF | Emission Controls, WORN OUT, ADJUSTED | 0.05 | \$25.00 | \$1.25 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|----------------|----------------------------|-----------|-------|------------|-----------|
| 08/24/15 | 43-3102314 | TURBOCHARGER GASKET | Y | 1.00 | \$9.91 | \$9.91 |
| 08/24/15 | 43-3682710 | ISX EXH GASKET | Y | 3.00 | \$11.64 | \$34.92 |
| 08/24/15 | 45-3101268 | GSKT,FLG | Y | 1.00 | \$3.36 | \$3.36 |
| 08/25/15 | 43-3102314 | TURBOCHARGER GASKET | Y | -1.00 | \$10.08 | \$-10.08 |
| 08/25/15 | 43-3682710 | ISX EXH GASKET | Y | 1.00 | \$11.64 | \$11.64 |
| 08/25/15 | 43-3682710 | ISX EXH GASKET | Y | 1.00 | \$11.64 | \$11.64 |
| 08/25/15 | 43-3682940 | EXH GASKET | Y | 1.00 | \$11.81 | \$11.81 |
| 08/25/15 | 43-3683607 | Molded exhaust seal | Y | 1.00 | \$2.85 | \$2.85 |
| 08/25/15 | 43-4032194 | Actuator Kit for unit 1570 | Y | 1.00 | \$103.65 | \$103.65 |
| 08/25/15 | 43-4309398NX | kit exh rcn cooler | | 1.00 | \$1,204.40 | \$1204.40 |
| 08/25/15 | 43-4309398NXCR | kit exh rcn cooler core | | 1.00 | \$192.31 | \$192.31 |
| 08/25/15 | 43-4934279 | Sealing Washer | Y | 4.00 | \$2.75 | \$11.00 |
| 08/25/15 | 45-3627695 | o ring seal | Y | 2.00 | \$5.84 | \$11.68 |
| 08/25/15 | 45-3678786 | O-RING | Y | 1.00 | \$2.46 | \$2.46 |
| 08/25/15 | 45-3678912 | SEAL, O-RING | Y | 1.00 | \$7.78 | \$7.78 |
| 08/25/15 | 45-3922794 | turbo o ring seal | Y | 1.00 | \$2.15 | \$2.15 |
| 08/26/15 | 43-2866337 | exhaust gasket 5 in. | Y | 3.00 | \$5.00 | \$15.00 |
| 08/26/15 | 43-2871453 | adapter gasket | Y | 2.00 | \$19.86 | \$39.72 |
| 08/26/15 | 43-2871453 | adapter gasket | Y | 4.00 | \$19.86 | \$79.44 |
| 08/26/15 | 43-3684355 | exhaust gasket out | Y | 1.00 | \$9.51 | \$9.51 |
| 08/26/15 | 43-90-0012 | exhaust clamp on turbo | Y | 1.00 | \$12.32 | \$12.32 |
| 08/26/15 | 43-EC50PLS | ss exhaust clamps | Y | 1.00 | \$8.79 | \$8.79 |
| 08/26/15 | 45-3101268 | GSKT,FLG | Y | -1.00 | \$3.98 | \$-3.98 |

| | | |
|-------------------------------|-------------------------------|----------------------------|
| Section: 3 | Complaint: INOPERATIVE | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | WARRANTY TURBO REPLACEMENT |
| Component: 043-004 | Unit War: None | |
| Turbocharger | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|----------|---|
| 09/03/15 | talked to justin from cummins w hen he w as dow n here for 1585 and asked him what w ould be causing the truck to |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00043990 **Unit:** 1342

09/03/15 constantly blow white smoke he hooked his computer up to the truck with it running and tried to actuate the VGT on the

09/03/15 turbo and it would not actuate so he removed the actuator without draining the coolant and tried to move the VGT and

09/03/15 it would not move at all [DOURE]

09/03/15 drained the coolant [DOURE]

09/03/15 removed the turbo cac pipe [DOURE]

09/03/15 removed the actuator [DOURE]

09/03/15 removed coolant lines from actuator [DOURE]

09/03/15 removed air intake pipe to turbo [DOURE]

09/03/15 removed oil drain line and oil pressure tube and removed the exhaust pipe off of the turbo and removed turbo from

09/03/15 exhaust manifold [DOURE]

09/08/15 pulled off down pipe off turbo found that the truck needs go to cummins [CURHAU]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-------------------------------------|-------|---------|---------|
| 09/03/15 | DOUREI | Turbocharger | 2.57 | \$25.00 | \$64.25 |
| 09/03/15 | DOUREI | Turbocharger | 0.87 | \$25.00 | \$21.75 |
| 09/08/15 | CURHAU | Turbocharger | 0.17 | \$25.00 | \$4.25 |
| 09/12/15 | DOUREI | Turbocharger | 0.00 | \$25.00 | \$0.00 |
| 09/14/15 | DOUREI | Turbocharger, CRACKED, REPLACED NEW | 0.00 | \$25.00 | \$0.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|--------------|----------------|-----------|------|------------|-----------|
| 09/03/15 | 43-4298220 | TURBO STUD | Y | 2.00 | \$9.80 | \$19.60 |
| 09/17/15 | 43-4309077RX | Turbo- Charger | Y | 1.00 | \$2,973.35 | \$2973.35 |

Section: 4 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT need wires fixed on light bar
Component: 034 **Unit War:** None
 Lighting System
War. Type: NO WARRANTY

Comments

Date: Comment Text

09/16/15 fixed the 2 broken wires on the right tail lights [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|--------|
| 09/16/15 | DOUREI | Lighting System, CRACKED, REPLACED NEW | 0.20 | \$25.00 | \$5.00 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00043990 **Unit:** 1342

| | | |
|----------------------------------|--------------------------|------------------------------------|
| Section: 5 | Complaint: LOOSE | Comments: |
| Priority: 5 | Rep Reason: DRIVERREPORT | Remove seat to return to Bob Morse |
| Component: 002-027 | Unit War: None | |
| Seat Frames & Springs | | |
| War. Type: NO WARRANTY | | |

Comments

Date: Comment Text

| | |
|----------|--|
| 09/16/15 | there is no seat upstairs labeled for 1342. There are no seats that completely match the passenger seat. [KYLTAU] |
| 09/22/15 | installed used seat that Rich Nevins picked out [CURHAU] |
| 09/22/15 | found that one of the air switches was missing for the seat went up stairs and found switches to replace it [CURHAU] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 09/16/15 | JIMBRE | Seat Frames & Springs, LOOSE, DISASSEMBLE | 0.92 | \$25.00 | \$23.00 |
| 09/16/15 | KYLTAU | Seat Frames & Springs | 0.28 | \$25.00 | \$7.00 |
| 09/22/15 | CURHAU | Seat Frames & Springs | 0.32 | \$25.00 | \$8.00 |
| 09/22/15 | CURHAU | Seat Frames & Springs, NOT CONNECTE, | 1.27 | \$25.00 | \$31.75 |

| | | |
|-------------------------------|--------------------------|-------------------|
| Section: 6 | Complaint: BROKEN | Comments: |
| Priority: 5 | Rep Reason: DRIVERREPORT | replace antenna's |
| Component: 052-003 | Unit War: None | |
| Radio Equipment | | |
| War. Type: NO WARRANTY | | |

Comments

Date: Comment Text

| | |
|----------|------------------------------------|
| 09/22/15 | replaced both cb antennas [DOUREI] |
|----------|------------------------------------|

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 09/21/15 | DOUREI | Radio Equipment | 0.50 | \$25.00 | \$12.50 |
| 09/22/15 | DOUREI | Radio Equipment, NOT CONNECTE, REPLACED | 0.00 | \$25.00 | \$0.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|----------|---------------|-----------|------|------------|---------|
| 09/21/15 | 02-AU4-B | BLACK ANTENNA | Y | 2.00 | \$7.23 | \$14.46 |

Repair Order Detail
TranSpec Leasing, Inc.

Repair Order: OMA-00043990 **Unit:** 1342

Totals Repair Order OMA-00043990

| | |
|--------------------------------|-----------------|
| Total Parts Issued: | 36.00 |
| Total Labor Hours: | 41.08 |
| Total Part Charges: \$ | 4,779.69 |
| Total Labor Charges: | 1,027.00 |
| Total Tax Charges: | 0.00 |
| Total Fee Charges: | 0.00 |
| Total Service Charges: \$ | 0.00 |
| Repair Total: | 5,806.69 |

Repair Order Detail TranSpec Leasing, Inc.

1 of 4

| | | |
|-----------------------------------|------------------------------|-----------------------------------|
| Repair Order: OMA-00042387 | Status: CLOSED | Repair Class: NONSCHEDULED |
| Shop: OMA | | Repair Site: FACILITY |
| Unit: 1342 | Customer: TRSPLF | Opened: 5/1/2015 |
| 2009 PETERBILT 386 | TRANSPEC LEASE FLEET | Closed: 6/23/2015 |
| Domicile: OMA | Make: PTRBL | Completed: 5/4/2015 |
| Cost Cntr: 1101 OMA | Model: 386 | Odometer: 998,176 |
| License: | Year: 2009 | |
| VIN: 1XPHD49X79D770456 | In Service: 11/6/2009 | |

| | | |
|-------------------------------|-----------------------|------------------|
| Section: 1 | Complaint: PM | Comments: |
| Priority: 5 | Rep Reason: PM | A Service, R-ups |
| Component: 000-002 | Unit War: None | |
| Pm Level A | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|-------|--------------|
|-------|--------------|

| | |
|----------|-----------------|
| 05/01/15 | A SERV [MATGIL] |
|----------|-----------------|

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---------------------------|-------|---------|---------|
| 05/01/15 | MATGIL | Pm Level A, PM, PERFORMED | 1.73 | \$25.00 | \$43.25 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|----------------|-------------------------|-----------|-------|------------|---------|
| 05/01/15 | 34-194 | LIGHT BULB | Y | 1.00 | \$0.32 | \$0.32 |
| 05/01/15 | 44-BF7760 | FUEL FILTER | Y | 1.00 | \$8.06 | \$8.06 |
| 05/01/15 | 44-BF7766 | FUEL FILTER | Y | 1.00 | \$10.40 | \$10.40 |
| 05/01/15 | 45-BD7154 | OIL FILTER | Y | 1.00 | \$20.66 | \$20.66 |
| 05/01/15 | 53-3909 | OIL SAMPLE | | 1.00 | \$11.68 | \$11.68 |
| 05/01/15 | 53-CD550 | 15W/40 ENGINE OIL | | 10.00 | \$7.71 | \$77.10 |
| 05/01/15 | 53-HD2 | CHASSIS LUBE | | 2.00 | \$2.32 | \$4.64 |
| 05/01/15 | 53-WASHERFLUID | WINDSHIELD WASHER FLUID | | 1.00 | \$1.78 | \$1.78 |

| | | |
|-------------------------------|-----------------------|------------------|
| Section: 2 | Complaint: PM | Comments: |
| Priority: 5 | Rep Reason: PM | DPF service |
| Component: 000-007 | Unit War: None | |
| DPF/SCR SERVICE | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|-------|--------------|
|-------|--------------|

| | |
|----------|-------------------------------------|
| 05/01/15 | went to kenworth for parts [JACHEN] |
|----------|-------------------------------------|

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00042387 **Unit:** 1342

05/01/15 drained coolant and removed fuel doser. doser w as old part number and replaced as per e-mail. [MICRUF]

05/01/15 had to removed coolant line and clean corrosion and rust to re-install. replaced all o-rings [MICRUF]

05/01/15 removed base of right stack to remove steps to get to ATD [MICRUF]

05/01/15 removed and seperated ATD and found that the DPF w as cracked. put DPF in machine w hile Frank got OK to replace [MICRUF]

05/01/15 cleaned all exhaust mounting surfaces and re-asm. ATD. [MICRUF]

05/01/15 had trouble getting A TD to line up on mounts but secured. connected all electrical connections and secured w iring

05/01/15 [MICRUF]

05/01/15 re-installed steps and exhaust. ran regen [MICRUF]

05/01/15 cleared codes [MICRUF]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--------------------------------|-------|---------|----------|
| 05/01/15 | MICRUF | DPF/SCR SERVICE | 5.78 | \$25.00 | \$144.50 |
| 05/01/15 | JACHEN | DPF/SCR SERVICE | 0.77 | \$25.00 | \$19.25 |
| 05/01/15 | MICRUF | DPF/SCR SERVICE, PM, PERFORMED | 3.75 | \$25.00 | \$93.75 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-----------------|----------------------------|-----------|------|------------|-----------|
| 05/01/15 | 42-3684091 | grommet seal for egr valve | | 1.00 | \$1.49 | \$1.49 |
| 05/01/15 | 42-3684091 | grommet seal for egr valve | | 1.00 | \$1.49 | \$1.49 |
| 05/01/15 | 42-3684091 | grommet seal for egr valve | | 1.00 | \$1.49 | \$1.49 |
| 05/01/15 | 43-2866337 | exhaust gasket 5 in. | Y | 1.00 | \$4.90 | \$4.90 |
| 05/01/15 | 43-2866337 | exhaust gasket 5 in. | Y | 2.00 | \$5.10 | \$10.20 |
| 05/01/15 | 43-2871453 | adapter gasket | Y | 3.00 | \$16.90 | \$50.70 |
| 05/01/15 | 43-90-0013 | TUBRO EXHAUST CLAMP | Y | 1.00 | \$13.92 | \$13.92 |
| 05/01/15 | 43-EC50PLS | ss exhuaust clamps | Y | 1.00 | \$6.04 | \$6.04 |
| 05/01/15 | 44-4309349RX | kit aft injector | Y | 1.00 | \$278.06 | \$278.06 |
| 05/01/15 | 43-5297522NXCUM | dpf filter | Y | 1.00 | \$2,085.36 | \$2085.36 |

| | | | | | |
|--------------------------|-------------|--------------------|--------------|-------------------|--|
| Section: | 3 | Complaint: | INOPERATIVE | Comments: | |
| Priority: | 5 | Rep Reason: | DRIVERREPORT | Replace EGR valve | |
| Component: | 043-001 | Unit War: | None | | |
| Emission Controls | | | | | |
| War. Type: | NO WARRANTY | | | | |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00042387 **Unit:** 1342

Comments

Date: Comment Text

05/04/15 remove EGR valve and clean EGR tubes w aiting for parts [LONWIL]

05/04/15 install EGR valve EGR tubes [LONWIL]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 05/04/15 | LONWIL | Emission Controls | 1.13 | \$25.00 | \$28.25 |
| 05/04/15 | LONWIL | Emission Controls, NO PROBLEM, REPAIRED | 1.23 | \$25.00 | \$30.75 |
| 05/04/15 | LONWIL | Emission Controls | 0.50 | \$25.00 | \$12.50 |
| 05/04/15 | LONWIL | Emission Controls, WORN OUT, REPLACED NEW | 2.00 | \$25.00 | \$50.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|--------------|-------------|-----------|------|------------|----------|
| 05/04/15 | 43-4955969RX | EGR KIT | | 1.00 | \$798.37 | \$798.37 |

| | | | | | |
|-----------------------------------|-------------|--------------------|--------------|---|--|
| Section: | 4 | Complaint: | IMPROPERLY A | Comments: | |
| Priority: | 5 | Rep Reason: | DRIVERREPORT | Fix drivers arm rest | |
| Component: | 002-011 | Unit War: | None | | |
| Cab Accessories - Interior | | | | replaced spring retaining clip inside of arm rest. [KYLTAY] | |
| War. Type: | NO WARRANTY | | | arm rest is now operable. [KYLTAY] | |

Comments

Date: Comment Text

05/01/15 replaced spring retaining clip inside of arm rest. [KYLTAY]

05/01/15 arm rest is now operable. [KYLTAY]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|--------|
| 05/01/15 | KYLTAY | Cab Accessories - Interior, LOOSE, INSPECTED | 0.38 | \$25.00 | \$9.50 |

| | | | | | |
|--------------------------------------|-------------|--------------------|--------------|--|--|
| Section: | 5 | Complaint: | IMPROPERLY A | Comments: | |
| Priority: | 5 | Rep Reason: | DRIVERREPORT | Bumper rubs on left side hood and is loose | |
| Component: | 014-002 | Unit War: | None | | |
| Bumpers & Attaching Parts | | | | | |
| War. Type: | NO WARRANTY | | | | |

Comments

Date: Comment Text

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00042387 **Unit:** 1342

05/04/15 straighten bumper [LONWIL]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 05/04/15 | LONWIL | Bumpers & Attaching Parts, NO PROBLEM, | 0.55 | \$25.00 | \$13.75 |

Section: 6 **Complaint:** MISSING **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT Hook up PerformX cable to P/N
Component: 063-005 **Unit War:** None
 Transceiver / Antenna System
War. Type: NO WARRANTY

Comments

Date: Comment Text

05/02/15 installed perform-x cable [LONWIL]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 05/02/15 | LONWIL | Transceiver / Antenna System, NOT CONNECTE, | 1.27 | \$25.00 | \$31.75 |

Section: 7 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT hook up front blinkers
Component: 034-007 **Unit War:** None
 Signaling Devices
War. Type: NO WARRANTY

Comments

Date: Comment Text

05/01/15 turn signals are already operable. [KYLTAY]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|--------|
| 05/01/15 | KYLTAY | Signaling Devices, NO PROBLEM, INSPECTED | 0.33 | \$25.00 | \$8.25 |

Totals Repair Order OMA-00042387

| | |
|------------------------|-----------------|
| Total Parts Issued: | 32.00 |
| Total Labor Hours: | 19.42 |
| Total Part Charges: | \$ 3,386.66 |
| Total Labor Charges: | 485.50 |
| Total Tax Charges: | 0.00 |
| Total Fee Charges: | 0.00 |
| Total Service Charges: | \$ 0.00 |
| Repair Total: | 3,872.16 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00042047

Shop: OMA

Unit: 1342
2009 PETERBILT 386

Status: CLOSED

Customer: TRSPLF
TRANSPEC LEASE FLEET

Repair Class: NONSCHEDULED

Repair Site: OUTSIDE COMP

Opened: 3/25/2015

Closed: 4/7/2015

Completed: 4/7/2015

Odometer: 983,792

Domicile: OMA

Cost Cntr: 1101 OMA

License:

VIN: 1XPHD49X79D770456

Make: PTRBL

Model: 386

Year: 2009

In Service: 11/6/2009

| | | | |
|--------------------------------|---------------------------------|----------------------------|----------------------|
| Vendor: CUMCEN | | CUMMINS CENTRAL POWER, LLC | |
| PO Number: OMA-00016107 | | Estimate: \$0.00 | Promise Date: |
| Section: 1 | Complaint: LEAKING | Comments: | |
| Priority: 5 | Rep Reason: DRIVERREPORT | | |
| Component: 045 | Unit War: None | | |
| Power Plant | | | |
| War. Type: NO WARRANTY | | | |

Services

| Date: | Description | Vendor | Charge | Total |
|----------|---|--------|------------|-----------|
| 03/25/15 | REMOVE FRONT GEAR HOUSING, REPLACE HOUSING & RESEAL | Y | \$6,919.58 | \$6919.58 |

Totals Repair Order OMA-00042047

| | |
|---------------------------|-----------------|
| Total Parts Issued: | 0.00 |
| Total Labor Hours: | 0.00 |
| Total Part Charges: \$ | 0.00 |
| Total Labor Charges: | 0.00 |
| Total Tax Charges: | 0.00 |
| Total Fee Charges: | 0.00 |
| Total Service Charges: \$ | 6,919.58 |
| Repair Total: | 6,919.58 |

10440

Repair Order Detail

TranSpec Leasing, Inc.

| | | |
|-----------------------------------|-----------------------|----------------------------|
| Repair Order: OMA-00037236 | Status: CLOSED | Repair Class: NONSCHEDULED |
| Shop: OMA | | Repair Site: FACILITY |
| Unit: 1342 | Customer: TRSPLF | Opened: 10/16/2014 |
| 2009 PETERBILT 386 | TRANSPEC LEASE FLEET | Closed: 3/31/2015 |
| Domicile: OMA | Make: PTRBL | Completed: 3/31/2015 |
| Cost Cntr: 1101 OMA | Model: 386 | Odometer: 971,615 |
| License: | Year: 2009 | |
| VIN: 1XPHD49X79D770456 | In Service: 11/6/2009 | |

| | | |
|-------------------------------|------------------------|-----------------|
| Section: 1 | Complaint: INOPERATIVE | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | install battery |
| Component: 032-001 | Unit War: None | |
| Battery & Cables | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|----------|--|
| 10/16/14 | put 2 used battery in truck started [PAUPAR] |
| 12/13/14 | installed 3 new batteries and checked operation of the alternator and it failed so replaced alternator [DOURE] |
| 01/08/15 | found that the battery cable were all corroded. cleaned all battery cables that were able to clean. |
| 01/08/15 | the neagative cables were also corroded. batteries and alternator were charging and tested good. starter is good |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 10/16/14 | PAUPAR | Battery & Cables, WORN OUT, DISASSEMBLE | 0.93 | \$25.00 | \$23.25 |
| 12/02/14 | DOURE | Battery & Cables | 2.23 | \$25.00 | \$55.75 |
| 12/13/14 | DOURE | Battery & Cables, WORN OUT, REPLACED NEW | 0.02 | \$25.00 | \$0.50 |
| 12/29/14 | DOURE | Battery & Cables, NO PROBLEM, REPAIRED | 1.57 | \$25.00 | \$39.25 |
| 01/08/15 | CURHAU | Battery & Cables | 2.07 | \$25.00 | \$51.75 |
| 01/08/15 | PAUPAR | Battery & Cables, WORN OUT, INSPECTED | 0.63 | \$25.00 | \$15.75 |
| 02/20/15 | THOBLO | Battery & Cables, NO PROBLEM, INSPECTED | 0.30 | \$25.00 | \$7.50 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|--------------|-------------|-----------|------|------------|----------|
| 12/02/14 | 32-F31S-1000 | BATTERY | E | 3.00 | \$76.66 | \$229.98 |

| | | |
|---|------------------------|-------------------------------------|
| Section: 2 | Complaint: INOPERATIVE | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | A/C Blower motor, cab and bunk inop |
| Component: 001-006 | Unit War: None | |
| Heater and A/C - Combination Unit, Cab | | |
| War. Type: NO WARRANTY | | |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Comments

| Date: | Comment Text |
|----------|--|
| 12/15/14 | fixed the rear connections and got the blow er to w ork properly [DOUREI] |
| 12/15/14 | removed the front blow er motor and found that the squirrel cage w as broken off of the blow er motor [DOUREI] |
| 12/15/14 | ordered new cage and installed w hen parts recieved [DOUREI] |
| 12/15/14 | reinstalled blow er motor in the truck [DOUREI] |
| 12/15/14 | blew out evaporator [DOUREI] |
| 12/17/14 | replaced cab air filter [DOUREI] |
| 12/22/14 | replaced blow er motor [DOUREI] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 12/11/14 | DOUREI | Heater and A/C - Combination Unit, Cab | 2.28 | \$25.00 | \$57.00 |
| 12/15/14 | DOUREI | Heater and A/C - Combination Unit, Ca, CRACKED, REPLACED NEW | 1.00 | \$25.00 | \$25.00 |
| 12/17/14 | DOUREI | Heater and A/C - Combination Unit, Cab, | 0.02 | \$25.00 | \$0.50 |
| 12/19/14 | DOUREI | Heater and A/C - Combination Unit, Cab | 0.60 | \$25.00 | \$15.00 |
| 12/22/14 | DOUREI | Heater and A/C - Combination Unit, Cab | 0.23 | \$25.00 | \$5.75 |
| 12/22/14 | DOUREI | Heater and A/C - Combination Unit, Cab, LOOSE, | 1.22 | \$25.00 | \$30.50 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-----------------|-----------------------|-----------|------|------------|----------|
| 12/11/14 | 30-CC1305 | 5 AMP CIRCUIT BREAKER | | 1.00 | \$6.00 | \$6.00 |
| 12/11/14 | 01-HC16250 | BLOWER MOTOR WHEEL | | 1.00 | \$17.59 | \$17.59 |
| 12/15/14 | 5362 | a/c compressor | | 1.00 | \$220.46 | \$220.46 |
| 12/16/14 | 01-23-15619 | HVAC AIR FILTER | | 1.00 | \$12.48 | \$12.48 |
| 12/19/14 | 01-Q21-6000-001 | hvac controul module | | 1.00 | \$564.36 | \$564.36 |
| 12/22/14 | 01-9830 | BLOWER MOTOR | | 1.00 | \$79.10 | \$79.10 |

| | | | |
|---------------------------|-------------|--------------|-------------------------------|
| Section: 3 | Complaint: | IRREGULAR WE | Comments: |
| Priority: 5 | Rep Reason: | INSPECTION | Check drive tires for replace |
| Component: 017-001 | Unit War: | None | |
| Tire - Pneumatic | | | |
| War. Type: | NO WARRANTY | | |

Comments

| Date: | Comment Text |
|-------|--------------|
|-------|--------------|

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

12/06/14 all rear drives at or below 4/32. RRI and LFI are at 1/32 [MICRUF]

12/06/14 needs tires [MICRUF]

12/18/14 installed steer tires and torqued the nuts to 450ftlbs [DOURE]

12/18/14 josh dismantled drive tires and installed new drive tires [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 12/06/14 | MICRUF | Tire - Pneumatic | 0.15 | \$25.00 | \$3.75 |
| 12/09/14 | MICRUF | Tire - Pneumatic | 0.02 | \$25.00 | \$0.50 |
| 12/11/14 | MICRUF | Tire - Pneumatic | 0.02 | \$25.00 | \$0.50 |
| 12/18/14 | DOURE | Tire - Pneumatic | 1.42 | \$25.00 | \$35.50 |
| 12/18/14 | DOURE | Tire - Pneumatic, WORN OUT, REPLACED NEW | 0.87 | \$25.00 | \$21.75 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-----------------------|-------------------------------------|-----------|------|------------|-----------|
| 12/16/14 | 17-LP 24.5 BFG | LP 24.5 BFG DR444 | | 8.00 | \$448.00 | \$3584.00 |
| 12/18/14 | 17-24.5 LP MICH STEER | MICHELIN LP 24.5 XZA3 STEER (28791) | | 2.00 | \$433.22 | \$866.44 |

| | | | | |
|--------------------------------|-------------|--------------------|--------------|--|
| Section: | 4 | Complaint: | LOW ON FLUID | Comments: |
| Priority: | 5 | Rep Reason: | INSPECTION | check drive brakes and drums for replace |
| Component: | 013-002 | Unit War: | None | |
| Rear Brakes & Drums | | | | |
| War. Type: | NO WARRANTY | | | |

Comments

| Date: | Comment Text |
|----------|---|
| 12/06/14 | recomend new drums and shoes. [MICRUF] |
| 12/09/14 | installed new brake shoes and drums on 3 out of four drive tires. Front drive left side still needs new shoes and a new |
| 12/09/14 | drum. [KYLTAY] |
| 12/09/14 | torqued all drive wheels but left front drive wheel to 475 ft-lbs [JACHEN] |
| 12/09/14 | adjusted slack adjusters on the three sets of brakes that I changed. [KYLTAY] |
| 12/10/14 | installed left front drive tire brake drum and shoes. [KYLTAY] |
| 12/10/14 | torqued lug nuts on front left drive tires to 475 ft lbs. [KYLTAY] |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 12/06/14 | MICRUF | Rear Brakes & Drums | 0.20 | \$25.00 | \$5.00 |
| 12/09/14 | KYLTAY | Rear Brakes & Drums | 0.55 | \$25.00 | \$13.75 |
| 12/09/14 | KYLTAY | Rear Brakes & Drums | 0.10 | \$25.00 | \$2.50 |
| 12/09/14 | KYLTAY | Rear Brakes & Drums | 3.63 | \$25.00 | \$90.75 |
| 12/09/14 | JACHEN | Rear Brakes & Drums | 1.62 | \$25.00 | \$40.50 |
| 12/09/14 | KYLTAY | Rear Brakes & Drums | 0.02 | \$25.00 | \$0.50 |
| 12/10/14 | KYLTAY | Rear Brakes & Drums, WORN OUT, REPLACED | 1.57 | \$25.00 | \$39.25 |
| 12/11/14 | DOUREI | Rear Brakes & Drums, WORN OUT, REPLACED | 0.02 | \$25.00 | \$0.50 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-----------------|----------------------|-----------|------|------------|---------|
| 12/09/14 | 13-OTR1601B | HUB PILOT BRAKE DRUM | | 1.00 | \$82.17 | \$82.17 |
| 12/09/14 | 13-OTR1601B | HUB PILOT BRAKE DRUM | | 1.00 | \$82.17 | \$82.17 |
| 12/09/14 | 13-OTR1601B | HUB PILOT BRAKE DRUM | | 1.00 | \$82.17 | \$82.17 |
| 12/09/14 | 13-OTR4709E2RED | BRAKE SHOES | | 1.00 | \$53.57 | \$53.57 |
| 12/09/14 | 13-OTR4709E2RED | BRAKE SHOES | | 1.00 | \$53.57 | \$53.57 |
| 12/09/14 | 13-OTR4709E2RED | BRAKE SHOES | | 1.00 | \$45.42 | \$45.42 |
| 12/10/14 | 13-OTR1601B | HUB PILOT BRAKE DRUM | | 1.00 | \$82.17 | \$82.17 |
| 12/10/14 | 13-OTR4709E2RED | BRAKE SHOES | | 1.00 | \$53.57 | \$53.57 |

Section: 5 Complaint: BROKEN Comments:
Priority: 5 Rep Reason: INSPECTION Step tool box latch missing
Component: 014-010 Unit War: None
 Toolbox Mounting
War. Type: NO WARRANTY

Vendor: PETCB PETERBILT OF CB

Comments

| Date: | Comment Text | Vendor |
|----------|---|--------|
| 12/06/14 | left latch missing and right side unservicable/ did not have correct latches in stock/ ordered parts [MICRUF] | N |
| 12/11/14 | replaced both step toolbox latches [DOUREI] | N |

Labor

| Date: | Mechanic | Description | Vendor | Hours | Rate | Total |
|----------|----------|--------------------------------------|--------|-------|---------|---------|
| 12/06/14 | MICRUF | Toolbox Mounting | N | 0.33 | \$25.00 | \$8.25 |
| 12/11/14 | DOUREI | Toolbox Mounting | N | 0.65 | \$25.00 | \$16.25 |
| 12/11/14 | DOUREI | Toolbox Mounting, BENT, REPLACED NEW | N | 0.37 | \$25.00 | \$9.25 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Parts

| Date: | Part ID | Description | After Mkt | Vendor | Qty | Unit Price | Total |
|----------|----------------|---------------------|-----------|--------|------|------------|---------|
| 12/08/14 | NON STOCK PART | NON STOCK PART ITEM | | N | 1.00 | \$2.51 | \$2.51 |
| 12/08/14 | NON STOCK PART | NON STOCK PART ITEM | | N | 1.00 | \$73.95 | \$73.95 |

Services

| Date: | Description | Vendor | Charge | Total |
|----------|----------------|--------|--------|--------|
| 12/08/14 | TOOL BOX LATCH | Y | \$0.00 | \$0.00 |

Section: 6 Complaint: PM Comments: A service
Priority: 5 Rep Reason: INSPECTION
Component: 000-002 Unit War: None
Pm Level A
War. Type: NO WARRANTY

Comments

| Date: | Comment Text |
|----------|--|
| 12/15/14 | changed oil and filters and changed the fuel filters [DOURE] |
| 12/15/14 | still needs greased [DOURE] |
| 12/18/14 | greased the truck [DOURE] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---------------------------|-------|---------|---------|
| 12/15/14 | DOURE | Pm Level A | 1.48 | \$25.00 | \$37.00 |
| 12/18/14 | DOURE | Pm Level A, PM, PERFORMED | 0.28 | \$25.00 | \$7.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-----------|-------------------|-----------|-------|------------|---------|
| 12/15/14 | 44-BF7760 | FUEL FILTER | Y | 1.00 | \$8.06 | \$8.06 |
| 12/15/14 | 44-BF7766 | FUEL FILTER | Y | 1.00 | \$10.40 | \$10.40 |
| 12/15/14 | 45-BD7154 | OIL FILTER | Y | 1.00 | \$20.66 | \$20.66 |
| 12/15/14 | 53-CD550 | 15W/40 ENGINE OIL | | 11.00 | \$8.01 | \$88.11 |
| 12/15/14 | 53-HD2 | CHASSIS LUBE | | 3.00 | \$2.32 | \$6.96 |
| 01/07/15 | 53-3909 | OIL SAMPLE | | 1.00 | \$11.50 | \$11.50 |

Section: 7 Complaint: PM Comments: Annual inspection
Priority: 5 Rep Reason: INSPECTION
Component: 000-005 Unit War: None
Annual Tractor Dot Inspection
War. Type: NO WARRANTY

Comments

Date: Comment Text

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

12/15/14 preformed DOT INSPECTION [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|--------|
| 12/15/14 | DOURE | Annual Tractor Dot Inspection, PM, FEDERAL INS | 0.02 | \$25.00 | \$0.50 |

Section: 8 Complaint: INOPERATIVE Comments:
Priority: 5 Rep Reason: INSPECTION Repair CB antennas and wires
Component: 052-005 Unit War: None
Transmitter
War. Type: NO WARRANTY

Comments

Date: Comment Text

12/09/14 installed new CB COAX AND antennas [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|------------------------------------|-------|---------|---------|
| 12/06/14 | MICRUF | Transmitter | 1.15 | \$25.00 | \$28.75 |
| 12/08/14 | DOURE | Transmitter | 3.18 | \$25.00 | \$79.50 |
| 12/09/14 | DOURE | Transmitter | 1.03 | \$25.00 | \$25.75 |
| 12/09/14 | DOURE | Transmitter, SHORTED, REPLACED NEW | 1.10 | \$25.00 | \$27.50 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|-------------------------------|-----------|------|------------|---------|
| 12/06/14 | 02-AU4-B | BLACK ANTENNA | Y | 2.00 | \$7.23 | \$14.46 |
| 12/06/14 | 02-K365-117 | antenna lead | Y | 2.00 | \$36.71 | \$73.42 |
| 12/06/14 | 02-K365-56 | LEADWIRE DUEL | Y | 1.00 | \$38.57 | \$38.57 |
| 12/06/14 | 02-P20-1143 | 90 DEGREE CB ANTENNA HARDWARE | | 2.00 | \$35.06 | \$70.12 |

Section: 9 Complaint: LEAKING Comments:
Priority: 5 Rep Reason: INSPECTION Check front cover leaks
Component: 045-001 Unit War: None oil leaks 2/ 17/ 15
Front Covers
War. Type: NO WARRANTY

Comments

Date: Comment Text

12/02/14 marked w ires attached to bumper. [KYLTAY]
 12/02/14 removed bumper [KYLTAY]
 12/02/14 removed bumper brackets [KYLTAY]
 12/02/14 removed CAC and intake tubes. [KYLTAY]
 12/02/14 removed air cleaner [KYLTAY]

Repair Order Detail **TranSpec Leasing, Inc.**

| | |
|-----------------------------------|-------------------|
| Repair Order: OMA-00037236 | Unit: 1342 |
|-----------------------------------|-------------------|

| | |
|----------|---|
| 12/02/14 | drained oil [KYLTAY] |
| 12/02/14 | took oil sample [KYLTAY] |
| 12/02/14 | drained coolant. [KYLTAY] |
| 12/02/14 | saved coolant. Coolant can be reused if a bottle of pencool is added. [KYLTAY] |
| | |
| 12/02/14 | disconnected A/C lines. [KYLTAY] |
| 12/02/14 | removed coolant reservoir. [KYLTAY] |
| 12/02/14 | removed washer fluid tank [KYLTAY] |
| 12/02/14 | removed a/c condensor. [KYLTAY] |
| 12/02/14 | attached condensor mounting bolts to condensor so that they would not get lost. [KYLTAY] |
| 12/02/14 | taped over open A/C lines and ports including condensor. [KYLTAY] |
| | |
| 12/02/14 | removed radiator and air to air cooler. [KYLTAY] |
| 12/02/14 | placed bumper, bumper brackets and radiator and air to air cooler in container #5 [KYLTAY] |
| 12/02/14 | removed fan. [KYLTAY] |
| 12/02/14 | removed fan shroud. [KYLTAY] |
| 12/02/14 | removed accessory and fan belts [KYLTAY] |
| 12/02/14 | all bolts and washers are labeled and in the tray on the table next to the truck. [KYLTAY] |
| | |
| 12/02/14 | removed hood [DOURE] |
| 12/02/14 | drained A/c system [DOURE] |
| 12/04/14 | removed fan hub [DOURE] |
| 12/04/14 | removed alternator [DOURE] |
| 12/04/14 | removed a/c compressor [DOURE] |
| 12/04/14 | removed the upper cover [DOURE] |
| 12/04/14 | removed crank pulley [DOURE] |
| 12/04/14 | removed vibration dampner [DOURE] |
| 12/04/14 | put in timing w edges [DOURE] |
| 12/04/14 | removed camshaft gears [DOURE] |
| 12/04/14 | removed front cam covers to replace oring [DOURE] |
| 12/04/14 | cleaned mounting surface for the new orings and the cam covers [DOURE] |
| | |
| 12/04/14 | installed new cam gear orings [DOURE] |
| 12/04/14 | reinstalled the cam gear covers and torqued bolts to 30 ftlbs [DOURE] |
| | |
| 12/04/14 | emery clothed the front crank to make sure that the new front main seal is ready for installation [DOURE] |

Repair Order Detail

TranSpec Leasing, Inc.

| | |
|----------------------------|------------|
| Repair Order: OMA-00037236 | Unit: 1342 |
|----------------------------|------------|

| | |
|----------|--|
| 12/08/14 | installed new low er cover and installed the front main seal and torqued the main seal bolts to 71 inch lbs and torqued |
| 12/08/14 | the low er front cover to 21 ftlbs [DOURE] |
| 12/08/14 | installed the upper front cover and torqued the bolts to 21 ftlbs [DOURE] |
| 12/08/14 | reoved timing w edges from the cam shafts and reinstalled the valve cover [DOURE] |
| 12/09/14 | reinstalled vibration dampner and the crank shaft pulley [DOURE] |
| 12/09/14 | torqued to 140 ftlbs [DOURE] |
| 12/09/14 | installed the alternator mount bracket [DOURE] |
| 12/09/14 | installed new pulleys and idlers [DOURE] |
| 12/09/14 | ordered a new a/c compressor [DOURE] |
| 12/09/14 | installed new alternator [DOURE] |
| 12/09/14 | rew ired alternator w ires to work properly [DOURE] |
| 12/09/14 | installed fan hub [DOURE] |
| 12/09/14 | installed new belts [DOURE] |
| 12/09/14 | installed air cleaner. [KYLTAY] |
| 12/09/14 | installed air cleaner to turbo pipe. [KYLTAY] |
| 12/09/14 | installed and zip tied dash air cleaner vacuum gauge air line. [KYLTAY] |
| 12/11/14 | installed radiator [DOURE] |
| 12/11/14 | bolted the radiator back into the orginal place [DOURE] |
| 12/11/14 | PULLED RADIA TOR BACK OFF TO GET AND CAC SENT OUT TO GET FIXED FOUND BROKEN PLACTIC FITTING ON THE TOP OF RADIA TOR AND |
| 12/11/14 | AIR LEAKS AT CAC [DOURE] |
| 12/16/14 | reinstalled new radiator and CAC and reinstalled condenser [DOURE] |
| 12/16/14 | reinstalled A/C lines to condenser and to the A/C compressor [DOURE] |
| 12/16/14 | vacumn A/c system and recharge system w ith 3 lbs of R134A [DOURE] |
| 02/25/15 | fixed oil leaks at valve cover and at the cam cover orings [DOURE] |
| 03/24/15 | truck w ent back to cummins for CRANKCASE PRESSURE SENSOR FAULT CODES 1942 [DOURE] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--------------|-------|---------|---------|
| 12/02/14 | DOURE | Front Covers | 1.33 | \$25.00 | \$33.25 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236

Unit: 1342

| | | | | | |
|----------|--------|-------------------------------------|------|---------|----------|
| 12/02/14 | KYLTAY | Front Covers | 2.88 | \$25.00 | \$72.00 |
| 12/02/14 | KYLTAY | Front Covers | 3.45 | \$25.00 | \$86.25 |
| 12/04/14 | DOUREI | Front Covers | 1.30 | \$25.00 | \$32.50 |
| 12/04/14 | DOUREI | Front Covers | 4.05 | \$25.00 | \$101.25 |
| 12/05/14 | DOUREI | Front Covers | 0.12 | \$25.00 | \$3.00 |
| 12/05/14 | DOUREI | Front Covers | 0.35 | \$25.00 | \$8.75 |
| 12/05/14 | DOUREI | Front Covers | 2.18 | \$25.00 | \$54.50 |
| 12/08/14 | DOUREI | Front Covers | 0.13 | \$25.00 | \$3.25 |
| 12/08/14 | DOUREI | Front Covers | 3.27 | \$25.00 | \$81.75 |
| 12/08/14 | DOUREI | Front Covers | 0.10 | \$25.00 | \$2.50 |
| 12/08/14 | DOUREI | Front Covers | 0.62 | \$25.00 | \$15.50 |
| 12/09/14 | DOUREI | Front Covers | 3.08 | \$25.00 | \$77.00 |
| 12/09/14 | DOUREI | Front Covers | 0.43 | \$25.00 | \$10.75 |
| 12/09/14 | DOUREI | Front Covers | 0.43 | \$25.00 | \$10.75 |
| 12/09/14 | KYLTAY | Front Covers | 0.55 | \$25.00 | \$13.75 |
| 12/09/14 | KYLTAY | Front Covers | 0.85 | \$25.00 | \$21.25 |
| 12/11/14 | DOUREI | Front Covers | 1.23 | \$25.00 | \$30.75 |
| 12/11/14 | DOUREI | Front Covers | 0.23 | \$25.00 | \$5.75 |
| 12/15/14 | DOUREI | Front Covers | 0.67 | \$25.00 | \$16.75 |
| 12/16/14 | DOUREI | Front Covers | 1.87 | \$25.00 | \$46.75 |
| 12/17/14 | DOUREI | Front Covers | 1.45 | \$25.00 | \$36.25 |
| 12/18/14 | DOUREI | Front Covers | 1.03 | \$25.00 | \$25.75 |
| 12/18/14 | DOUREI | Front Covers | 0.78 | \$25.00 | \$19.50 |
| 12/18/14 | DOUREI | Front Covers | 2.28 | \$25.00 | \$57.00 |
| 12/19/14 | DOUREI | Front Covers | 0.27 | \$25.00 | \$6.75 |
| 12/19/14 | DOUREI | Front Covers | 0.85 | \$25.00 | \$21.25 |
| 12/19/14 | DOUREI | Front Covers, CRACKED, DISASSEMBLE | 0.00 | \$25.00 | \$0.00 |
| 02/24/15 | DOUREI | Front Covers | 1.75 | \$25.00 | \$43.75 |
| 02/24/15 | DOUREI | Front Covers | 4.00 | \$25.00 | \$100.00 |
| 02/25/15 | DOUREI | Front Covers | 3.87 | \$25.00 | \$96.75 |
| 02/25/15 | DOUREI | Front Covers | 1.60 | \$25.00 | \$40.00 |
| 02/25/15 | DOUREI | Front Covers, LEAKING, DISASSEMBLE | 0.50 | \$25.00 | \$12.50 |
| 03/24/15 | DOUREI | Front Covers, NO PROBLEM, INSPECTED | 0.22 | \$25.00 | \$5.50 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|------------|---------------------------|-----------|------|------------|---------|
| 12/02/14 | 53-3909 | OIL SAMPLE | | 1.00 | \$11.66 | \$11.66 |
| 12/04/14 | 31-3047579 | alt. bolt | | 1.00 | \$6.23 | \$6.23 |
| 12/04/14 | 45-3093936 | screw hex flange head cap | Y | 1.00 | \$11.95 | \$11.95 |
| 12/04/14 | 45-3679931 | gasket camshaft cover | Y | 1.00 | \$8.81 | \$8.81 |
| 12/04/14 | 45-3679932 | gasket camshaft cover | Y | 1.00 | \$6.23 | \$6.23 |

Repair Order Detail

TranSpec Leasing, Inc.

| | | | |
|----------------------------|--|------------|--|
| Repair Order: OMA-00037236 | | Unit: 1342 | |
|----------------------------|--|------------|--|

| | | | | | | |
|----------|------------------|--|---|-------|----------|----------|
| 12/04/14 | 45-3682229 | idler pulley | | 1.00 | \$62.32 | \$62.32 |
| 12/04/14 | 45-4299124 | O Ring seal | Y | 1.00 | \$7.82 | \$7.82 |
| 12/04/14 | 45-4299125 | O ring seal | Y | 1.00 | \$9.96 | \$9.96 |
| 12/04/14 | 45-4955383 | FRONT MAIN SEAL, ISX | Y | 1.00 | \$63.62 | \$63.62 |
| 12/04/14 | 45-4962721 | seal rectangular st upper seal | Y | 1.00 | \$14.81 | \$14.81 |
| 12/04/14 | 45-4962722 | FRONT GEAR COVER SEAL, ISX low er seal | Y | 1.00 | \$14.71 | \$14.71 |
| 12/04/14 | 45-89440DYC | belt & alt tensioner | Y | 1.00 | \$158.15 | \$158.15 |
| 12/04/14 | 45-89448DYC | tensioner | | 1.00 | \$148.81 | \$148.81 |
| 12/05/14 | 45-3683670 | GROMMET SEAL | Y | 1.00 | \$4.03 | \$4.03 |
| 12/05/14 | 45-3688114 | low er front cover plug | Y | 1.00 | \$5.49 | \$5.49 |
| 12/05/14 | 45-4973081 | FRONT GEAR COVER, BOTTOM ISX | Y | 1.00 | \$55.20 | \$55.20 |
| 12/08/14 | 41-CV50633FLG | VENTILATION FILTER | | 1.00 | \$48.36 | \$48.36 |
| 12/08/14 | 42-186780 | thermostat seal | | 1.00 | \$11.02 | \$11.02 |
| 12/08/14 | 42-3682673 | THERMOSTAT HOUSING GASKET CUMMINS | | 1.00 | \$15.10 | \$15.10 |
| 12/08/14 | 42-4318947 | thermostat n14-isx | | 1.00 | \$32.17 | \$32.17 |
| 12/08/14 | 3104392 | valve cover gasket | Y | 1.00 | \$41.93 | \$41.93 |
| 12/08/14 | 45-4026684 | pan gasket | Y | 1.00 | \$149.96 | \$149.96 |
| 12/09/14 | 31-8700018 | 35SI 12V REMAN 140A PAD ALT | | 1.00 | \$323.14 | \$323.14 |
| 12/09/14 | 45-3683004 | ALTERNATOR PULLEY | Y | 1.00 | \$44.84 | \$44.84 |
| 12/10/14 | 45-3684460 | BREATHING TUBE CUMMINS | Y | 1.00 | \$5.00 | \$5.00 |
| 12/15/14 | 02-9382001 | Stud-Hood Spring | Y | 2.00 | \$49.04 | \$98.08 |
| 12/16/14 | 53-134A | FREON | | 3.25 | \$2.73 | \$8.88 |
| 12/16/14 | 53-ANTIFREEZE | ANTIFREEZE | | 2.00 | \$9.00 | \$18.00 |
| 12/16/14 | 42-FLA-529 | RADIATOR | | 1.00 | \$675.00 | \$675.00 |
| 12/16/14 | 42-SRM PB20G-P | CHARGE AIR COOLER | | 1.00 | \$750.00 | \$750.00 |
| 12/16/14 | 43-M66-7091-0405 | EXH PIPE | Y | 1.00 | \$499.22 | \$499.22 |
| 12/18/14 | 43-2866337 | exhaust gasket 5 in. | Y | 1.00 | \$4.88 | \$4.88 |
| 12/18/14 | 43-2866337 | exhaust gasket 5 in. | Y | 1.00 | \$4.88 | \$4.88 |
| 12/18/14 | 43-SF500 | 5 FLAT U BOLT CLAMP | Y | 1.00 | \$6.66 | \$6.66 |
| 12/19/14 | 43-90-0012 | exhaust clamp on turbo | | 1.00 | \$9.83 | \$9.83 |
| 02/24/15 | 45-3679931 | gasket camshaft cover | Y | 1.00 | \$8.98 | \$8.98 |
| 02/24/15 | 45-3679932 | gasket camshaft cover | Y | 1.00 | \$6.36 | \$6.36 |
| 02/24/15 | 45-4299124 | O Ring seal | Y | 1.00 | \$7.97 | \$7.97 |
| 02/24/15 | 45-4299125 | O ring seal | Y | 1.00 | \$10.16 | \$10.16 |
| 02/24/15 | 45-4962721 | seal rectangular st upper seal | Y | 1.00 | \$15.11 | \$15.11 |
| 02/25/15 | 53-ANTIFREEZE | ANTIFREEZE | | 12.00 | \$8.84 | \$106.08 |
| 02/25/15 | 53-ANTIFREEZE | ANTIFREEZE | | 5.75 | \$8.84 | \$50.83 |
| 02/25/15 | 53-ANTIFREEZE | ANTIFREEZE | | 0.25 | \$8.95 | \$2.24 |
| 02/25/15 | 53-ANTIFREEZE | ANTIFREEZE | | 4.00 | \$9.00 | \$36.00 |
| 02/25/15 | 94-LM406 | 3/8 SPLIT LOOM | | 2.00 | \$0.26 | \$0.52 |
| 02/25/15 | 94-LM408 | 1/2 SPLIT LOOM | | 6.00 | \$0.28 | \$1.68 |

Repair Order Detail

TranSpec Leasing, Inc.

| | |
|-----------------------------------|-------------------|
| Repair Order: OMA-00037236 | Unit: 1342 |
|-----------------------------------|-------------------|

| | | | | | | |
|----------|-------------|--------------------|---|------|---------|---------|
| 02/25/15 | 94-LM412-50 | 3/4 SPLIT LOOM | | 3.00 | \$0.37 | \$1.11 |
| 02/25/15 | 45-3104392 | valve cover gasket | Y | 1.00 | \$39.49 | \$39.49 |

| | | |
|-------------------------------|-------------------------------|---|
| Section: 10 | Complaint: LEAKING | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | power steering to air compressor leakin |
| Component: 015-005 | Unit War: None | |
| Power Steering Pump | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|-------|--------------|
|-------|--------------|

| | |
|----------|--|
| 12/11/14 | replaced pow er stering pump mount gasket [DOUREI] |
|----------|--|

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|--------|
| 12/11/14 | DOUREI | Pow er Steering Pump, LEAKING, DISASSEMBLE | 0.22 | \$25.00 | \$5.50 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|----------------|---------------------|-----------|------|------------|---------|
| 12/08/14 | NON STOCK PART | NON STOCK PART ITEM | | 1.00 | \$29.84 | \$29.84 |

| | | |
|--------------------------------|--------------------------------|--|
| Section: 11 | Complaint: IMPROPERLY A | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | Check cab air bags and shock for replace |
| Component: 002-057 | Unit War: None | |
| Occupant Safety Devices | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|-------|--------------|
|-------|--------------|

| | |
|----------|--|
| 12/09/14 | attempted to change the cab shocks and air bags but could not find a proper way to support the cab. [KYLTAY] |
|----------|--|

| | |
|----------|--|
| 12/09/14 | Replacement shocks are incorrect. [KYLTAY] |
|----------|--|

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-----------------------------------|-------|---------|---------|
| 12/09/14 | KYLTAY | Occupant Safety Devices | 0.88 | \$25.00 | \$22.00 |
| 12/09/14 | KYLTAY | Occupant Safety Devices | 0.48 | \$25.00 | \$12.00 |
| 12/09/14 | KYLTAY | Occupant Safety Devices | 0.03 | \$25.00 | \$0.75 |
| 12/15/14 | RICNEV | Installed cab shocks and air bags | 3.00 | \$25.00 | \$75.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|----------------|---------------------|-----------|------|------------|---------|
| 12/08/14 | NON STOCK PART | NON STOCK PART ITEM | | 1.00 | \$63.83 | \$63.83 |
| 12/08/14 | NON STOCK PART | NON STOCK PART ITEM | | 1.00 | \$29.80 | \$29.80 |
| 12/08/14 | NON STOCK PART | NON STOCK PART ITEM | | 1.00 | \$29.80 | \$29.80 |

Repair Order Detail

TranSpec Leasing, Inc.

| | | | |
|-----------------------------------|----------------|-------------------------|----------------------|
| Repair Order: OMA-00037236 | | Unit: 1342 | |
| 12/08/14 | NON STOCK PART | NON STOCK PART ITEM | 1.00 \$29.84 \$29.84 |
| Section: | 12 | Complaint: | LEAKING |
| Priority: | 5 | Rep Reason: | INSPECTION |
| Component: | 045-002 | Unit War: | None |
| Cylinder Block & Crankcase | | | |
| War. Type: | NO WARRANTY | | |
| Vendor: | AUTBRA | AUTO BRAKE & CLUTCH INC | |

Comments

| Date: | Comment Text | Vendor |
|----------|---|--------|
| 12/04/14 | pulled trans for Doug [MICRUF] | N |
| 12/05/14 | removed clutch and found that the truck needs a new clutch and the fly w heel needs turned [DOUREI] | N |
| 12/05/14 | removed fly w heel [DOUREI] | N |
| 12/05/14 | removed the EGR cooler piping off the back of the engine [DOUREI] | N |
| 12/05/14 | removed upper cross member [DOUREI] | N |
| 12/05/14 | loosened the rear motor mounts [DOUREI] | N |
| 12/10/14 | removed the rear engine mount bolts [DOUREI] | N |
| 12/10/14 | removed rear main seal [DOUREI] | N |
| 12/10/14 | removed bell housing [DOUREI] | N |
| 12/10/14 | steamed off fly wheel housing [DOUREI] | N |
| 12/10/14 | rethreaded all bell housing bolt holes and rethreaded the fly wheel holes [DOUREI] | N |
| 12/10/14 | rethreaded the starter holes [DOUREI] | N |
| 12/10/14 | installed new gasket for the FLYWHEEL HOUSING [DOUREI] | N |
| 12/10/14 | installed FLYWHEEL [DOUREI] | N |
| 12/10/14 | TORQUED BOLTS FOLLOWING CUMMINS PROCEDURE FIRST TIME 91 FT LBS AND THEN TO 148 LBS [DOUREI] | N |
| 12/10/14 | installed fly wheel [DOUREI] | N |
| 12/10/14 | installed starter [DOUREI] | N |
| 12/11/14 | installed oil pan and gasket and torqued to 41 ft lbs [DOUREI] | N |
| 12/12/14 | installed new clutch on to the trans mission [DOUREI] | N |
| 12/13/14 | installed clutch shift rod on to the linkage [DOUREI] | N |
| 12/13/14 | installed air lines to shifter junction block [DOUREI] | N |
| 12/13/14 | installed trans temp sensor lines [DOUREI] | N |
| 12/13/14 | installed speed sensor wires [DOUREI] | N |
| 12/13/14 | installed new shifter tower gasket and bolted down shifter tower [DOUREI] | N |

Repair Order Detail

TranSpec Leasing, Inc.

| | |
|----------------------------|------------|
| Repair Order: OMA-00037236 | Unit: 1342 |
|----------------------------|------------|

| | | |
|----------|--|---|
| 12/13/14 | installed transmission onto the flyw heel housing and installed clutch to the fly w heel [DOURE] | N |
| 12/13/14 | repaired broken grease lines to the clutch linkage [DOURE] | N |
| 12/15/14 | installed new u-joint straps on drive line and reinstalled drive line [DOURE] | N |
| 12/15/14 | torqued drive line to 125 ftlbs [DOURE] | N |

Labor

| Date: | Mechanic | Description | Vendor | Hours | Rate | Total |
|----------|----------|--------------------------------------|--------|-------|---------|----------|
| 12/04/14 | MICRUF | Cylinder Block & Crankcase | N | 3.53 | \$25.00 | \$88.25 |
| 12/04/14 | DOUREI | Cylinder Block & Crankcase | N | 2.58 | \$25.00 | \$64.50 |
| 12/04/14 | MICRUF | Cylinder Block & Crankcase | N | 1.73 | \$25.00 | \$43.25 |
| 12/04/14 | MICRUF | Cylinder Block & Crankcase | N | 2.07 | \$25.00 | \$51.75 |
| 12/05/14 | DOUREI | Cylinder Block & Crankcase | N | 3.50 | \$25.00 | \$87.50 |
| 12/06/14 | MICRUF | Cylinder Block & Crankcase | N | 0.02 | \$25.00 | \$0.50 |
| 12/09/14 | DOUREI | Cylinder Block & Crankcase | N | 0.53 | \$25.00 | \$13.25 |
| 12/09/14 | DOUREI | Cylinder Block & Crankcase | N | 1.30 | \$25.00 | \$32.50 |
| 12/10/14 | DOUREI | Cylinder Block & Crankcase | N | 4.20 | \$25.00 | \$105.00 |
| 12/10/14 | DOUREI | Cylinder Block & Crankcase | N | 3.92 | \$25.00 | \$98.00 |
| 12/10/14 | MICRUF | Cylinder Block & Crankcase | N | 2.83 | \$25.00 | \$70.75 |
| 12/10/14 | MICRUF | Cylinder Block & Crankcase | N | 0.30 | \$25.00 | \$7.50 |
| 12/11/14 | DOUREI | Cylinder Block & Crankcase | N | 1.02 | \$25.00 | \$25.50 |
| 12/12/14 | DOUREI | Cylinder Block & Crankcase | N | 3.52 | \$25.00 | \$88.00 |
| 12/13/14 | DOUREI | Cylinder Block & Crankcase | N | 3.37 | \$25.00 | \$84.25 |
| 12/13/14 | DOUREI | Cylinder Block & Crankcase, BENT, | N | 0.42 | \$25.00 | \$10.50 |
| 12/15/14 | DOUREI | Cylinder Block & Crankcase | N | 0.02 | \$25.00 | \$0.50 |
| 12/15/14 | DOUREI | Cylinder Block & Crankcase | N | 0.45 | \$25.00 | \$11.25 |
| 12/15/14 | DOUREI | Cylinder Block & Crankcase | N | 0.65 | \$25.00 | \$16.25 |
| 12/15/14 | DOUREI | Cylinder Block & Crankcase | N | 0.02 | \$25.00 | \$0.50 |
| 12/15/14 | DOUREI | Cylinder Block & Crankcase | N | 0.05 | \$25.00 | \$1.25 |
| 12/15/14 | DOUREI | Cylinder Block & Crankcase | N | 2.07 | \$25.00 | \$51.75 |
| 12/16/14 | MICRUF | Cylinder Block & Crankcase | N | 0.67 | \$25.00 | \$16.75 |
| 12/17/14 | DOUREI | Cylinder Block & Crankcase, LEAKING, | N | 0.08 | \$25.00 | \$2.00 |

Parts

| Date: | Part ID | Description | After Mkt | Vendor | Qty | Unit Price | Total |
|----------|---------------|-----------------------|-----------|--------|------|------------|---------|
| 12/05/14 | 26-4965569 | Rear Main Seal, ISX | | N | 1.00 | \$64.09 | \$64.09 |
| 12/05/14 | 45-4965688 | flyw heel gasket | Y | N | 1.00 | \$54.41 | \$54.41 |
| 12/11/14 | 23-105C137F | CLUTCH FORK FRO18210C | | N | 1.00 | \$17.59 | \$17.59 |
| 12/13/14 | 26-4305294 | SHIFT GASKET | | N | 1.00 | \$4.80 | \$4.80 |
| 12/15/14 | 22-6-5-70-18X | KIT STRAP & BOLT | | N | 2.00 | \$5.43 | \$10.86 |

Repair Order Detail

TranSpec Leasing, Inc.

| | |
|-----------------------------------|-------------------|
| Repair Order: OMA-00037236 | Unit: 1342 |
|-----------------------------------|-------------------|

| | | | | | | | |
|----------|------------|----------------------|---|---|------|--------|--------|
| 12/15/14 | 43-2866337 | exhaust gasket 5 in. | E | N | 2.00 | \$4.88 | \$9.76 |
| 12/15/14 | 43-2866636 | exhaust gasket | E | N | 1.00 | \$5.55 | \$5.55 |

Services

| Date: | Description | Vendor | Charge | Total |
|----------|----------------------------------|--------|----------|----------|
| 12/09/14 | clutch kit & resurface flyw heel | Y | \$647.83 | \$647.83 |
| 12/16/14 | cac & radiator | Y | \$0.00 | \$0.00 |

| | | |
|---|--------------------------------|-------------------------|
| Section: 13 | Complaint: IMPROPERLY A | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | re-secure trailer lines |
| Component: 014-008 | Unit War: None | |
| Attaching Devices - Hoses, Lines, Tubes & Wire | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|----------|---|
| 12/02/14 | secured trailer lines and assisted Kyle in removing rad. and stow ing rad in container [MICRUF] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 12/02/14 | MICRUF | Attaching Devices - Hoses, Lines, Tubes & , LOOSE, INSTALLED | 1.38 | \$25.00 | \$34.50 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-----------|---------------------|-----------|------|------------|---------|
| 12/02/14 | 13-11600 | AIR HOSE SPRING, 25 | | 1.00 | \$6.10 | \$6.10 |
| 12/02/14 | 13-17-160 | SPRING HANGER | | 3.00 | \$1.79 | \$5.37 |
| 12/02/14 | 13-580081 | CORD TENDER | | 2.00 | \$15.15 | \$30.30 |

| | | |
|-------------------------------|-------------------------------|------------------|
| Section: 14 | Complaint: LOOSE | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | chain hanger lid |
| Component: 053-001 | Unit War: None | |
| Tire Chains | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|----------|--|
| 12/08/14 | installed used chain hanger lid [DOUREI] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--------------------------------------|-------|---------|--------|
| 12/08/14 | DOUREI | Tire Chains | 0.03 | \$25.00 | \$0.75 |
| 12/08/14 | DOUREI | Tire Chains, NOT CONNECTE, INSPECTED | 0.30 | \$25.00 | \$7.50 |

Repair Order Detail

TranSpec Leasing, Inc.

| | | | |
|--|-------------|-------------------------------|------------------------|
| Repair Order: OMA-00037236 | | Unit: 1342 | |
| Section: | 15 | Complaint: INOPERATIVE | Comments: |
| Priority: | 5 | Rep Reason: INSPECTION | repair all inop lights |
| Component: | 034-004 | Unit War: None | |
| Clearance/marker/interior Lamps, Bulbs, Reflectors, Fuses & | | | |
| War. Type: | NO WARRANTY | | |

Comments

| Date: | Comment Text |
|----------|--|
| 12/15/14 | relocated the block heater plug receptacle [DOURE] |
| 12/15/14 | removed all non working chicken lights [DOURE] |
| 12/22/14 | wired headlights and [DOURE] |
| 12/22/14 | removed burnt out light control module and replaced with new one [DOURE] |
| 12/22/14 | reinstalled bumper and wired for front turn signals and parking lights [DOURE] |
| 12/29/14 | reinstalled seat [DOURE] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 12/15/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 1.88 | \$25.00 | \$47.00 |
| 12/18/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 0.13 | \$25.00 | \$3.25 |
| 12/18/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 0.50 | \$25.00 | \$12.50 |
| 12/19/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 2.50 | \$25.00 | \$62.50 |
| 12/22/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 3.27 | \$25.00 | \$81.75 |
| 12/22/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 1.73 | \$25.00 | \$43.25 |
| 12/22/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 0.40 | \$25.00 | \$10.00 |
| 12/23/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 0.35 | \$25.00 | \$8.75 |
| 12/23/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 0.35 | \$25.00 | \$8.75 |
| 12/23/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 1.02 | \$25.00 | \$25.50 |
| 12/29/14 | DOURE | Clearance/marker/interior Lamps, Bulbs, | 0.47 | \$25.00 | \$11.75 |
| 12/29/14 | DOURE | Clearance/marker/interior Lamps, , NOT CONNECTE, DISASSEMBLE | 0.15 | \$25.00 | \$3.75 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-----------------|---|-----------|------|------------|----------|
| 12/15/14 | 45-8606080 | COVER RECEPTAC | Y | 1.00 | \$43.63 | \$43.63 |
| 12/22/14 | 34-P21-1019-103 | TURN SIGNAL MODULE | | 1.00 | \$457.80 | \$457.80 |
| 12/22/14 | 53-100196 | 1/2-13 x 1 hex c/s ss | | 6.00 | \$0.57 | \$3.42 |
| 12/22/14 | 53-100688 | 1/2 f/w ss | | 6.00 | \$0.16 | \$0.96 |
| 12/22/14 | 53-60309 | 12-1.75 x 35 mm hex hd c/s 8.8 din 933-8.8 zinc | | 4.00 | \$0.26 | \$1.04 |
| 12/22/14 | 53-95058 | 1/2 x 1-1/4 nylon flat washer | | 6.00 | \$0.26 | \$1.56 |

Repair Order Detail

TranSpec Leasing, Inc.

| | | | | | | |
|-----------------------------------|------|-------------------|---|------|---------|---------|
| Repair Order: OMA-00037236 | | Unit: 1342 | | | | |
| 12/23/14 | 3812 | lamp chrome light | E | 2.00 | \$18.50 | \$37.00 |

Section: 16 Complaint: DENT Comments:
Priority: 5 Rep Reason: INSPECTION right hood has holes
Component: 002-004 Unit War: None
Hood
War. Type: NO WARRANTY

Comments

Date: Comment Text

12/09/14 holes in hood are not getting fixed ordered new hood isolaters for the hood mount [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-------------------------------|-------|---------|--------|
| 12/09/14 | DOURE | Hood | 0.07 | \$25.00 | \$1.75 |
| 12/11/14 | DOURE | Hood | 0.00 | \$25.00 | \$0.00 |
| 12/13/14 | DOURE | Hood, NOT CONNECTE, INSPECTED | 0.02 | \$25.00 | \$0.50 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|---------------------|-----------|------|------------|---------|
| 12/11/14 | 02-13-04154 | HOOD PIVOT BUSHINGS | Y | 4.00 | \$24.53 | \$98.12 |

Section: 17 Complaint: LOOSE Comments:
Priority: 5 Rep Reason: INSPECTION repair rear mudflap hangers
Component: 002-002 Unit War: None
Fenders
War. Type: NO WARRANTY

Comments

Date: Comment Text

12/13/14 found nothing w rong with rear mudflap hangers [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|----------------------------------|-------|---------|--------|
| 12/02/14 | MICRUF | Fenders | 0.23 | \$25.00 | \$5.75 |
| 12/13/14 | DOURE | Fenders, NOT CONNECTE, INSPECTED | 0.02 | \$25.00 | \$0.50 |

Section: 18 Complaint: EXCESSIVE PL Comments:
Priority: 5 Rep Reason: INSPECTION check all u-joints replace as needed
Component: 024-001 Unit War: None
Drive Shaft - Front Driving Axles
War. Type: NO WARRANTY

Comments

Date: Comment Text

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

12/11/14 checked all drive line u joints are good [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|--------|
| 12/11/14 | DOURE | Drive Shaft - Front Driving Axles, NO PROBLEM, | 0.00 | \$25.00 | \$0.00 |

| | | | | |
|---------------------------|-------------|--------------------|------------|----------------------|
| Section: | 19 | Complaint: | LOOSE | Comments: |
| Priority: | 5 | Rep Reason: | INSPECTION | replace wiper blades |
| Component: | 002-035 | Unit War: | None | |
| Windshield Wiper & Washer | | | | |
| War. Type: | NO WARRANTY | | | |

Comments

Date: Comment Text

12/02/14 ordered parts. placed old blades and parts request on Jasons desk [MICRUF]

12/06/14 replaced w iper blades [MICRUF]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|--------|
| 12/02/14 | MICRUF | Windshield Wiper & Washer | 0.13 | \$25.00 | \$3.25 |
| 12/04/14 | MICRUF | Windshield Wiper & Washer | 0.05 | \$25.00 | \$1.25 |
| 12/06/14 | MICRUF | Windshield Wiper & Washer, Job paused by | 0.12 | \$25.00 | \$3.00 |
| 12/06/14 | MICRUF | Windshield Wiper & Washer, WORN OUT, | 0.02 | \$25.00 | \$0.50 |

| | | | | |
|-------------------|-------------|--------------------|------------|-----------------------------|
| Section: | 20 | Complaint: | LOOSE | Comments: |
| Priority: | 5 | Rep Reason: | INSPECTION | Check mirror control switch |
| Component: | 002-010 | Unit War: | None | |
| Mirrors | | | | |
| War. Type: | NO WARRANTY | | | |

Comments

Date: Comment Text

12/15/14 needs new mirror sw itch [DOURE]

12/15/14 replaced mirror sw itch [DOURE]

12/18/14 removed dent from drivers side mirror [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---------------------------------|-------|---------|--------|
| 12/15/14 | DOURE | Mirrors | 0.07 | \$25.00 | \$1.75 |
| 12/15/14 | DOURE | Mirrors, WORN OUT, REPLACED NEW | 0.25 | \$25.00 | \$6.25 |
| 12/18/14 | DOURE | Mirrors | 0.03 | \$25.00 | \$0.75 |
| 12/18/14 | DOURE | Mirrors, BENT, DISASSEMBLE | 0.03 | \$25.00 | \$0.75 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

| | | |
|---------------------------|------------------------|--------------------------------------|
| Section: 21 | Complaint: CORRODED | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | check all radiator hoses for replace |
| Component: 042-004 | Unit War: None | |
| Water Pump | | |
| War. Type: | NO WARRANTY | |

Comments

Date: Comment Text

12/11/14 fixed the two leaking hoses [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-------------------------------|-------|---------|--------|
| 12/11/14 | DOUREI | Water Pump, LEAKING, REPAIRED | 0.00 | \$25.00 | \$0.00 |

| | | |
|-------------------------------|------------------------|-----------------------------|
| Section: 22 | Complaint: LOOSE | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | Check all belts for replace |
| Component: 065-003 | Unit War: None | |
| Cooler - Oil (heat Exchanger) | | |
| War. Type: | NO WARRANTY | |

Comments

Date: Comment Text

12/08/14 replaced belts [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 12/08/14 | DOUREI | Cooler - Oil (heat Exchanger), CRACKED, | 0.55 | \$25.00 | \$13.75 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|--------------|-----------------------|-----------|------|------------|---------|
| 12/08/14 | 93-K060637HD | BELT | | 1.00 | \$24.76 | \$24.76 |
| 12/08/14 | 93-K120872HD | SERPENTINE DRIVE BELT | | 1.00 | \$59.64 | \$59.64 |

| | | |
|---------------------------|------------------------|-----------------|
| Section: 23 | Complaint: SHIMMYS | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | check king pins |
| Component: 011-001 | Unit War: None | |
| Axle - Non-driven, Front | | |
| War. Type: | NO WARRANTY | |

Comments

Date: Comment Text

12/16/14 removed steer wheels [DOUREI]
 12/16/14 removed brake drums and shoes [DOUREI]
 12/16/14 removed wheel hub [DOUREI]
 12/16/14 removed the brake spider [DOUREI]

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

12/16/14 removed drag link [DOUREI]
 12/16/14 removed the tie rod [DOUREI]
 12/17/14 removed right side king pin and removed old bushings and installed new bushings from kaizer kit [DOUREI]
 12/17/14 reinstalled spindle with new kinpin with new bearing [DOUREI]
 12/17/14 installed brake spider [DOUREI]
 12/17/14 installed new seal into the wheel hub and installed wheel hub back on to the spindle [DOUREI]
 12/17/14 filled with new 75/90 [DOUREI]
 12/17/14 installed other side [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---------------------------------------|-------|---------|---------|
| 12/11/14 | DOUREI | Axle - Non-driven, Front | 0.02 | \$25.00 | \$0.50 |
| 12/16/14 | DOUREI | Axle - Non-driven, Front | 2.27 | \$25.00 | \$56.75 |
| 12/17/14 | DOUREI | Axle - Non-driven, Front, NO PROBLEM, | 1.00 | \$25.00 | \$25.00 |
| 12/17/14 | DOUREI | Axle - Non-driven, Front | 3.38 | \$25.00 | \$84.50 |
| 12/17/14 | DOUREI | Axle - Non-driven, Front, POOR FIT, | 0.97 | \$25.00 | \$24.25 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|--------------------------|-----------|------|------------|----------|
| 12/17/14 | 15-K147E | KING PIN | | 1.00 | \$417.85 | \$417.85 |
| 12/17/14 | 18-330-3024 | hub cap gasket 5 1/2 in. | | 2.00 | \$1.28 | \$2.56 |
| 12/17/14 | 18-35058 | SEAL | | 2.00 | \$37.82 | \$75.64 |
| 12/17/14 | 53-75/90 | SYN 75/90 | | 4.00 | \$2.83 | \$11.33 |

| | | |
|---------------------------------|-------------------------------|----------------------|
| Section: 24 | Complaint: WORN OUT | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | replace steer brakes |
| Component: 013-001 | Unit War: None | |
| Front Brakes & Drums | | |
| War. Type: NO WARRANTY | | |

Comments

| Date: | Comment Text |
|----------|---|
| 12/17/14 | replaced right side brake shoes and drum [DOUREI] |
| 12/17/14 | replaced left front steer brake shoes and drum [DOUREI] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 12/17/14 | DOUREI | Front Brakes & Drums | 0.75 | \$25.00 | \$18.75 |
| 12/17/14 | DOUREI | Front Brakes & Drums, CRACKED, REPLACED | 1.35 | \$25.00 | \$33.75 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|--------------|-----------------|-----------|------|------------|----------|
| 12/17/14 | 13-1443E KIT | BRAKE SHOES KIT | | 2.00 | \$50.46 | \$100.92 |
| 12/17/14 | 13-61528B | BRAKE DRUM | | 2.00 | \$95.52 | \$191.04 |

| | | | | |
|------------------------|-------------|-------------|------------|-------------|
| Section: | 25 | Complaint: | PM | Comments: |
| Priority: | 5 | Rep Reason: | INSPECTION | service DPF |
| Component: | 000-007 | Unit War: | None | |
| DPF/SCR SERVICE | | | | |
| War. Type: | NO WARRANTY | | | |

Comments

| Date: | Comment Text |
|----------|---|
| 12/16/14 | removed right exhaust stack heat shield and stack inlet [MICRUF] |
| 12/16/14 | removed stow age compartment covering ATD [MICRUF] |
| 12/16/14 | had to use torch to remove two mounting bolts of stow age box [MICRUF] |
| 12/16/14 | removed ATD [MICRUF] |
| 12/16/14 | cleaned DPF in machine and blew out DOC. pinned both. DPF passed easy/ DOC passed barely, had to slightly force pin |
| 12/16/14 | through 90 percent of the attempts but pen went through [MICRUF] |
| 12/16/14 | had to order extra ATD gasket and ATD clamp. gasket came in / clamp will be here 12/17 [MICRUF] |
| 12/16/14 | cleaned all mating surfaces but re-asm halted waiting on part [MICRUF] |
| 12/17/14 | asm. ATD and installed onto truck/ mounted stow age box [MICRUF] |
| 12/17/14 | cleaned and re-installed elbow to stack. installed heat shielding [MICRUF] |
| 12/17/14 | installed crossover pipe to left stack [MICRUF] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--------------------------------|-------|---------|----------|
| 12/16/14 | MICRUF | DPF/SCR SERVICE | 4.43 | \$25.00 | \$110.75 |
| 12/16/14 | MICRUF | DPF/SCR SERVICE | 0.07 | \$25.00 | \$1.75 |
| 12/16/14 | MICRUF | DPF/SCR SERVICE, PM, PERFORMED | 2.50 | \$25.00 | \$62.50 |
| 12/17/14 | MICRUF | DPF/SCR SERVICE, PM, PERFORMED | 2.25 | \$25.00 | \$56.25 |
| 12/17/14 | MICRUF | DPF/SCR SERVICE, PM, PERFORMED | 0.63 | \$25.00 | \$15.75 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236

Unit: 1342

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|------------|-----------------------|-----------|------|------------|---------|
| 12/16/14 | 43-10028-6 | exhaust steel clamp | Y | 1.00 | \$23.57 | \$23.57 |
| 12/16/14 | 43-3684355 | exhaust gasket out | Y | 1.00 | \$9.51 | \$9.51 |
| 12/16/14 | 43-3685888 | hex flange head screw | Y | 2.00 | \$11.86 | \$23.72 |
| 12/16/14 | 43-4963857 | injector gasket | Y | 1.00 | \$11.25 | \$11.25 |
| 12/16/14 | 43-5292265 | dos ser & 49 gasket | Y | 1.00 | \$2.74 | \$2.74 |
| 12/16/14 | 43-2871453 | adapter gasket | Y | 1.00 | \$18.07 | \$18.07 |
| 12/16/14 | 43-90-0013 | TUBRO EXHAUST CLAMP | Y | 1.00 | \$13.92 | \$13.92 |
| 12/17/14 | 43-EC50PLS | ss exhaust clamps | Y | 1.00 | \$6.04 | \$6.04 |
| 12/17/14 | 43-EC50PLS | ss exhaust clamps | Y | 1.00 | \$6.04 | \$6.04 |
| 12/17/14 | 43-2871863 | exhaust clamp | Y | 1.00 | \$49.15 | \$49.15 |

Section: 26 Complaint: DIRTY Comments:
Priority: 5 Rep Reason: PRE-DELIVERY
Component: 999-999 Unit War: None
Total Vehicle
War. Type: NO WARRANTY

Vendor: DAVAUT DAVE AUTO UPHOLSTERY

Labor

| Date: | Mechanic | Description | Vendor | Hours | Rate | Total |
|----------|----------|--------------------------------------|--------|-------|---------|----------|
| 12/17/14 | CLAWIL | Total Vehicle, NO PROBLEM, CLEANED | N | 0.65 | \$25.00 | \$16.25 |
| 12/23/14 | CLAWIL | Total Vehicle, NO PROBLEM, CLEANED | N | 0.02 | \$25.00 | \$0.50 |
| 12/23/14 | CLAWIL | Total Vehicle | N | 10.87 | \$25.00 | \$271.75 |
| 12/24/14 | CLAWIL | Total Vehicle, NO PROBLEM, CLEANED | N | 5.40 | \$25.00 | \$135.00 |
| 12/24/14 | CLAWIL | Total Vehicle, NO PROBLEM, CLEANED | N | 1.48 | \$25.00 | \$37.00 |
| 12/24/14 | CLAWIL | Total Vehicle, NO PROBLEM, CLEANED | N | 3.12 | \$25.00 | \$78.00 |
| 01/05/15 | CLAWIL | Total Vehicle, NO PROBLEM, CLEANED | N | 0.17 | \$25.00 | \$4.25 |
| 01/05/15 | CLAWIL | Total Vehicle, NO PROBLEM, CLEANED | N | 2.15 | \$25.00 | \$53.75 |
| 01/05/15 | CLAWIL | Total Vehicle, NO PROBLEM, PERFORMED | N | 0.38 | \$25.00 | \$9.50 |

Parts

| Date: | Part ID | Description | After Mkt | Vendor | Qty | Unit Price | Total |
|----------|-----------|--------------------------------|-----------|--------|------|------------|---------|
| 01/05/15 | 53-SL-996 | blue 12/3 25ft extension cords | N | | 1.00 | \$27.99 | \$27.99 |

Services

| Date: | Description | Vendor | Charge | Total |
|----------|---------------------------|--------|---------|---------|
| 12/31/14 | REFOAM LOWER SEAT CUSHION | Y | \$35.00 | \$35.00 |

Repair Order Detail

TranSpec Leasing, Inc.

| | | | |
|-----------------------------------|-------------------------------|--|--|
| Repair Order: OMA-00037236 | | Unit: 1342 | |
| Section: 27 | Complaint: CRACKED | Comments: replace glass on monday, sunvisor & chrome around the windows need to be taken off by monday | |
| Priority: 5 | Rep Reason: INSPECTION | | |
| Component: 002-024 | Unit War: None | | |
| Glass | | | |
| War. Type: NO WARRANTY | | | |
| Vendor: METGLA | | METRO GLASS INC. | |

Comments

| Date: | Comment Text | Vendor |
|----------|--|--------|
| 01/02/15 | removed visor and chrome strips around windshield [ROGSAL] | N |
| 01/05/15 | installed visor [ROGSAL] | N |

Labor

| Date: | Mechanic | Description | Vendor | Hours | Rate | Total |
|----------|----------|-----------------------------|--------|-------|---------|---------|
| 01/02/15 | ROGSAL | Glass | N | 0.07 | \$25.00 | \$1.75 |
| 01/02/15 | ROGSAL | Glass | N | 1.42 | \$25.00 | \$35.50 |
| 01/05/15 | ROGSAL | Glass | N | 3.82 | \$25.00 | \$95.50 |
| 01/07/15 | ROGSAL | Glass, ROUTINE, DISASSEMBLE | N | 0.03 | \$25.00 | \$0.75 |
| 01/14/15 | LONWIL | Glass, ROUTINE, INSTALLED | N | 0.68 | \$25.00 | \$17.00 |

Services

| Date: | Description | Vendor | Charge | Total |
|----------|-------------------------|--------|----------|----------|
| 01/05/15 | WINDSHIELD REPLACE 1342 | Y | \$440.00 | \$440.00 |

| | | |
|----------------------------------|-------------------------------|-------------------------------------|
| Section: 28 | Complaint: INOPERATIVE | Comments: abs light is on |
| Priority: 5 | Rep Reason: INSPECTION | |
| Component: 013-011 | Unit War: None | |
| Anti-lock Sensor Assembly | | |
| War. Type: NO WARRANTY | | |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 12/29/14 | DOUREI | Anti-lock Sensor Assembly | 0.98 | \$25.00 | \$24.50 |
| 01/02/15 | DOUREI | Anti-lock Sensor Assembly, NOT CONNECTE, | 0.77 | \$25.00 | \$19.25 |

| | | |
|-------------------------------|-------------------------------|--------------------------------|
| Section: 29 | Complaint: MISSING | Comments: new decals |
| Priority: 5 | Rep Reason: INSPECTION | |
| Component: 053-005 | Unit War: None | |
| Markings - Vehicle | | |
| War. Type: NO WARRANTY | | |

| | |
|-----------------------|-------------------------|
| Vendor: PROSIG | PRO SIGN & SCREEN PRINT |
|-----------------------|-------------------------|

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

| Labor | | | Vendor | Hours | Rate | Total |
|----------|----------|---|--------|-------|---------|---------|
| Date: | Mechanic | Description | | | | |
| 01/05/15 | LONWIL | Markings - Vehicle | N | 1.75 | \$25.00 | \$43.75 |
| 01/08/15 | LONWIL | Markings - Vehicle, NO PROBLEM, INSTALLED | N | 0.02 | \$25.00 | \$0.50 |

| Services | | Vendor | Charge | Total |
|----------|------------------------|--------|----------|----------|
| Date: | Description | | | |
| 01/05/15 | decals set up for 1342 | Y | \$365.00 | \$365.00 |

Section: 30 Complaint: INOPERATIVE Comments: Auto traction control wont shut off
Priority: 5 Rep Reason: DRIVERREPORT
Component: 013-011 Unit War: None
 Anti-lock Sensor Assembly
War. Type: NO WARRANTY

| Labor | | | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| Date: | Mechanic | Description | | | |
| 01/06/15 | DOUREI | Anti-lock Sensor Assembly | 0.40 | \$25.00 | \$10.00 |
| 01/06/15 | DOUREI | Anti-lock Sensor Assembly | 0.10 | \$25.00 | \$2.50 |
| 01/14/15 | ROGSAL | Anti-lock Sensor Assembly, MISADJUSTED, | 0.03 | \$25.00 | \$0.75 |

Section: 31 Complaint: INOPERATIVE Comments: Heat not working
Priority: 5 Rep Reason: DRIVERREPORT no heat in vents 2/ 17/ 15
Component: 001-002 Unit War: None
 Heating & Ventilating
War. Type: NO WARRANTY

Comments

| Date: | Comment Text |
|----------|--|
| 01/06/15 | finished removing the old actuator and waiting on new actuator [DOUREI] |
| 01/06/15 | installed new actuator and helped roger reinstall all of the dash panels [DOUREI] |
| 01/07/15 | got debris out of vents and got it working [ROGSAL] |
| 02/20/15 | checked wiring from control panel to relay. short somewhere in the system. tested wires to actuator and there is no |
| 02/20/15 | signal to green wire. [THOBLO] |
| 02/26/15 | the only thing wrong with the actuator is that it was moving while the drum was supposed to be moving and found that |
| 02/26/15 | there were only 1 screw that was holding the actuator in place installed 2 more screws and got the actuator to operate |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

02/26/15 properly [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 01/06/15 | DOURE | Heating & Ventilating | 0.35 | \$25.00 | \$8.75 |
| 01/06/15 | DOURE | Heating & Ventilating | 1.50 | \$25.00 | \$37.50 |
| 01/06/15 | ROGSAL | Heating & Ventilating | 2.80 | \$25.00 | \$70.00 |
| 01/06/15 | ROGSAL | Heating & Ventilating | 1.77 | \$25.00 | \$44.25 |
| 01/06/15 | ROGSAL | Heating & Ventilating | 0.78 | \$25.00 | \$19.50 |
| 01/07/15 | ROGSAL | Heating & Ventilating, CONTAMINATED, | 0.05 | \$25.00 | \$1.25 |
| 02/20/15 | THOBLO | Heating & Ventilating, SHORTED, INSPECTED | 2.58 | \$25.00 | \$64.50 |
| 02/20/15 | THOBLO | Heating & Ventilating | 0.68 | \$25.00 | \$17.00 |
| 02/20/15 | THOBLO | Heating & Ventilating, SHORTED, | 0.87 | \$25.00 | \$21.75 |
| 02/26/15 | DOURE | Heating & Ventilating, IMPROPER REP, INSPECTED | 0.08 | \$25.00 | \$2.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|-------------|-----------|------|------------|----------|
| 01/06/15 | 01-MA 14400 | ACTUATOR | | 1.00 | \$105.30 | \$105.30 |

Section: 32 Complaint: BINDING Comments:
Priority: 5 Rep Reason: DRIVERREPORT 5th wheel handle pulls very hard
Component: 059-001 Unit War: None
 Fifth Wheel - Lower Coupler Assembly
War. Type: NO WARRANTY

Comments

Date: Comment Text

01/06/15 lubed up all of the fifth wheel linkage and fifth wheel pulls better [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---------------------------------------|-------|---------|--------|
| 01/06/15 | DOURE | Fifth Wheel - Lower Coupler Assembly, | 0.17 | \$25.00 | \$4.25 |

Section: 33 Complaint: LOOSE Comments:
Priority: 5 Rep Reason: DRIVERREPORT mount P/N screen
Component: 063-004 Unit War: None
 Display/keyboard
War. Type: NO WARRANTY

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|--------|
| 01/07/15 | ROGSAL | Display/keyboard, NO PROBLEM, INSPECTED | 0.03 | \$25.00 | \$0.75 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|-------------------------|-----------|------|------------|--------|
| 01/06/15 | 53-730-5919 | ANTENNA CABLE EXTENSION | | 1.00 | \$3.73 | \$3.73 |

Section: 34 Complaint: INOPERATIVE Comments:
Priority: 5 Rep Reason: DRIVERREPORT Left work light not working
Component: 034-003 Unit War: None
Signal, Parking, & Backup Lamps
War. Type: NO WARRANTY

Comments

Date: Comment Text

01/06/15 replaced light bulb [ROGSAL]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 01/06/15 | ROGSAL | Signal, Parking, & Backup Lamps, WORN OUT, | 0.72 | \$25.00 | \$18.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|---------|--------------|-----------|------|------------|--------|
| 01/06/15 | 34-H3 | HALOGEN BULB | E | 1.00 | \$4.39 | \$4.39 |

Section: 35 Complaint: INOPERATIVE Comments:
Priority: 5 Rep Reason: DRIVERREPORT Check poor AM/ FM radio reception
Component: 052-003 Unit War: None
Radio Equipment
War. Type: NO WARRANTY

Comments

Date: Comment Text

01/06/15 installed new radio antenna and hooked up to radio [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 01/06/15 | DOUREI | Radio Equipment | 0.28 | \$25.00 | \$7.00 |
| 01/06/15 | ROGSAL | Radio Equipment | 0.48 | \$25.00 | \$12.00 |
| 01/06/15 | DOUREI | Radio Equipment, NO PROBLEM, REPLACED NEW | 1.00 | \$25.00 | \$25.00 |

Section: 36 Complaint: LEAKING Comments:
Priority: 5 Rep Reason: INSPECTION coolant leak
Component: 042-002 Unit War: None
Radiator
War. Type: NO WARRANTY

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Comments

| Date: | Comment Text |
|----------|--|
| 01/08/15 | found a leak at the heater hose out of the block. clamp was incorrectly placed on the hose repositioned hose clamp |
| 01/08/15 | [CURHAU] |
| 01/08/15 | pressure tested the coolant system found no other leaks at this time [CURHAU] |
| 01/08/15 | leak at the heater hose was stoped with repositioning [CURHAU] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|------------------------------|-------|---------|--------|
| 01/08/15 | CURHAU | Radiator, LEAKING, INSPECTED | 0.08 | \$25.00 | \$2.00 |

| | | | | | |
|---------------------------|-------------|--------------------|--------------|---------------------------|--|
| Section: | 37 | Complaint: | BROKEN | Comments: | |
| Priority: | 5 | Rep Reason: | DRIVERREPORT | washer fluid don't squirt | |
| Component: | 002-035 | Unit War: | None | | |
| Windshield Wiper & Washer | | | | | |
| War. Type: | NO WARRANTY | | | | |

Comments

| Date: | Comment Text |
|----------|--|
| 01/09/15 | replaced windshield washer pump [DOUREI] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--------------------------------------|-------|---------|---------|
| 01/09/15 | DOUREI | Windshield Wiper & Washer, WORN OUT, | 1.08 | \$25.00 | \$27.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|------------|-----------------|-----------|------|------------|---------|
| 01/09/15 | 02-600228S | W/S WASHER PUMP | Y | 1.00 | \$21.05 | \$21.05 |

| | | | | | |
|-----------------------|-------------|--------------------|--------------|------------------------------|--|
| Section: | 38 | Complaint: | INOPERATIVE | Comments: | |
| Priority: | 5 | Rep Reason: | DRIVERREPORT | heat in vents but no defrost | |
| Component: | 001-002 | Unit War: | None | | |
| Heating & Ventilating | | | | | |
| War. Type: | NO WARRANTY | | | | |

Comments

| Date: | Comment Text |
|----------|---|
| 02/27/15 | fixed vet actuator in the section 51 [DOUREI] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|-------|----------|-------------|-------|------|-------|
|-------|----------|-------------|-------|------|-------|

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236

Unit: 1342

| | | | | | |
|----------|--------|---|------|---------|---------|
| 01/12/15 | LONWIL | Heating & Ventilating | 2.40 | \$25.00 | \$60.00 |
| 01/12/15 | LONWIL | Heating & Ventilating, CONTAMINATED, | 0.85 | \$25.00 | \$21.25 |
| 02/27/15 | DOUREI | Heating & Ventilating | 0.05 | \$25.00 | \$1.25 |
| 03/04/15 | DOUREI | Heating & Ventilating, NO PROBLEM, REPAIRED | 0.08 | \$25.00 | \$2.00 |
| 03/04/15 | DOUREI | Heating & Ventilating | 1.58 | \$25.00 | \$39.50 |
| 03/06/15 | LONWIL | Heating & Ventilating, SEIZED, REPAIRED | 0.03 | \$25.00 | \$0.75 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|------------------|-----------------------|-----------|------|------------|---------|
| 02/27/15 | 01-P93CAA3100-01 | BLOWER MOTOR RESISTOR | | 1.00 | \$43.33 | \$43.33 |

Section: 39 **Complaint:** IMPROPERLY A **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT still air leaks around door very cold
Component: 002-017 **Unit War:** None NEEDS DOOR HINGE PARTS ON ORDER 2/25/2015
Cab Or Front Door Panels
War. Type: NO WARRANTY

Comments

Date: Comment Text

02/25/15 needs left side door hinge to fix problem [DOUREI]
 02/26/15 installed new door hinge [DOUREI]
 02/27/15 adjusted the door and stricker to make sure the door opened and closed properly [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 01/12/15 | LONWIL | Cab Or Front Door Panels | 1.35 | \$25.00 | \$33.75 |
| 01/13/15 | LONWIL | Cab Or Front Door Panels | 0.45 | \$25.00 | \$11.25 |
| 01/13/15 | LONWIL | Cab Or Front Door Panels | 0.05 | \$25.00 | \$1.25 |
| 01/22/15 | LONWIL | Cab Or Front Door Panels, CHIPPED, REPLACED | 0.07 | \$25.00 | \$1.75 |
| 02/25/15 | DOUREI | Cab Or Front Door Panels | 0.18 | \$25.00 | \$4.50 |
| 02/26/15 | DOUREI | Cab Or Front Door Panels | 1.52 | \$25.00 | \$38.00 |
| 02/26/15 | DOUREI | Cab Or Front Door Panels | 0.55 | \$25.00 | \$13.75 |
| 02/27/15 | DOUREI | Cab Or Front Door Panels, LOOSE, | 0.12 | \$25.00 | \$3.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|-------------------------|-----------|------|------------|---------|
| 01/14/15 | 02-R42-6091 | DRIVERS DOOR UPPER SEAL | Y | 1.00 | \$43.29 | \$43.29 |
| 02/26/15 | 53-01042 | w eather strip | | 2.00 | \$10.69 | \$21.38 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Section: 40 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT replace glad hands
Component: 013-007 **Unit War:** None
Brake Lines & Fittings - Hydraulic & Air
War. Type: NO WARRANTY

| Labor | | | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| Date: | Mechanic | Description | | | |
| 01/10/15 | LONWIL | Brake Lines & Fittings - Hydraulic &, WORN OUT, REPLACED NEW | 0.47 | \$25.00 | \$11.75 |

| Parts | | | After Mkt | Qty | Unit Price | Total |
|----------|------------|--------------------|-----------|------|------------|--------|
| Date: | Part ID | Description | | | | |
| 01/10/15 | 13-GH11451 | EMERGENCY GLADHAND | | 1.00 | \$2.10 | \$2.10 |
| 01/10/15 | 13-GH11452 | SERVICE GLADHAND | | 1.00 | \$1.82 | \$1.82 |

Section: 41 **Complaint:** LEAKING **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT power steering pump leak
Component: 015-005 **Unit War:** None
Power Steering Pump
War. Type: NO WARRANTY

Comments

| Date: | Comment Text |
|----------|---|
| 01/10/15 | replace o-rings in power steering pump [LONWIL] |

| Labor | | | Hours | Rate | Total |
|----------|----------|---------------------------------------|-------|---------|---------|
| Date: | Mechanic | Description | | | |
| 01/10/15 | LONWIL | Power Steering Pump | 1.02 | \$25.00 | \$25.50 |
| 01/10/15 | LONWIL | Power Steering Pump, LEAKING, FLUSHED | 0.40 | \$25.00 | \$10.00 |

Section: 42 **Complaint:** LEAKING **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT front left timing cover leak ?
Component: 045-001 **Unit War:** None
Front Covers
War. Type: NO WARRANTY

| Labor | | | Hours | Rate | Total |
|----------|----------|---------------------------------|-------|---------|--------|
| Date: | Mechanic | Description | | | |
| 01/12/15 | LONWIL | Front Covers, LEAKING, REPAIRED | 0.03 | \$25.00 | \$0.75 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Section: 43 **Complaint:** LOOSE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT two bolts in license plate
Component: 072-001 **Unit War:** None
Rear Wall & Bumper Assembly
War. Type: NO WARRANTY

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-------------------------------------|-------|---------|--------|
| 01/10/15 | LONWIL | Rear Wall & Bumper Assembly, LOOSE, | 0.20 | \$25.00 | \$5.00 |

Section: 44 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT fm radio sirius don't work
Component: 052-003 **Unit War:** None
Radio Equipment
War. Type: NO WARRANTY

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 01/12/15 | LONWIL | Radio Equipment | 0.25 | \$25.00 | \$6.25 |
| 01/13/15 | LONWIL | Radio Equipment | 0.42 | \$25.00 | \$10.50 |
| 01/13/15 | LONWIL | Radio Equipment | 1.02 | \$25.00 | \$25.50 |
| 01/13/15 | LONWIL | Radio Equipment | 1.80 | \$25.00 | \$45.00 |
| 01/14/15 | LONWIL | Radio Equipment | 1.03 | \$25.00 | \$25.75 |
| 02/09/15 | LONWIL | Radio Equipment, WORN OUT, REPLACED NEW | 0.07 | \$25.00 | \$1.75 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|----------------------------|-----------|------|------------|----------|
| 01/14/15 | 52-PP105227 | PANPACIFIC SIRIUS EQUIPPED | | 1.00 | \$283.57 | \$283.57 |
| 01/14/15 | 02-113M717 | STEERING WHEEL INSTALL HUB | Y | 1.00 | \$81.39 | \$81.39 |

Section: 45 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT steering wheel loose
Component: 015-001 **Unit War:** None
Steering Wheel
War. Type: NO WARRANTY

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---------------------------------|-------|---------|--------|
| 01/12/15 | LONWIL | Steering Wheel, LOOSE, ADJUSTED | 0.25 | \$25.00 | \$6.25 |

Section: 46 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT city horn don't work
Component: 054-001 **Unit War:** None
Horn & Mounting
War. Type: NO WARRANTY

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 01/09/15 | DOUREI | Horn & Mounting | 1.52 | \$25.00 | \$38.00 |
| 01/12/15 | LONWIL | Horn & Mounting | 0.25 | \$25.00 | \$6.25 |
| 01/12/15 | LONWIL | Horn & Mounting | 1.82 | \$25.00 | \$45.50 |
| 01/13/15 | LONWIL | Horn & Mounting | 1.37 | \$25.00 | \$34.25 |
| 01/13/15 | LONWIL | Horn & Mounting, OPEN CIRCUIT, REPLACED | 0.93 | \$25.00 | \$23.25 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|----------------|-----------|------|------------|---------|
| 01/14/15 | 02-730-1055 | HORN, ELECTRIC | Y | 1.00 | \$13.69 | \$13.69 |

Section: 47 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** INSPECTION speed sensor 2 is code in t ruck
Component: 003-002 **Unit War:** None
Speedometer
War. Type: NO WARRANTY

Comments

| Date: | Comment Text |
|----------|---|
| 01/09/15 | found that the code that the truck w as throw ing w as the signal sensors 2 voltage [CURHAU] |
| 01/09/15 | possible caused included one of the sensors controlled by the that signal wire [CURHAU] |
| 01/09/15 | which included the exhaust gas pressure sensor, cam position sensor, fuel rail pressure sensor, intake sensor. [CURHAU] |
| 01/09/15 | the only code that also popped up w as the exhaust gas pressure sensor. [CURHAU] |
| 01/09/15 | changed out the exhaust gas pressure sensor [CURHAU] |
| 01/09/15 | found no issues with the speedometer at this time [CURHAU] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--------------------------------------|-------|---------|---------|
| 01/09/15 | CURHAU | Speedometer, NOT CONNECTE, INSPECTED | 1.33 | \$25.00 | \$33.25 |
| 01/09/15 | DOUREI | Speedometer | 0.73 | \$25.00 | \$18.25 |
| 01/12/15 | DOUREI | Speedometer, NOT CONNECTE, REPAIRED | 0.05 | \$25.00 | \$1.25 |

Section: 48 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** INSPECTION exhaust gas pressure light is on
Component: 045-021 **Unit War:** None warning lights 2/ 17/ 15
Electronic Engine Controls
War. Type: NO WARRANTY

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Comments

Date: Comment Text

01/09/15 all my notes for this section are on section 48 sorry for the inconvenience [CURHAU]

01/20/15 i clocked onto the incorrect section durring assisting w ith steering [CURHAU]

02/27/15 ran forced regen to fix check engine light [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 01/09/15 | CURHAU | Electronic Engine Controls | 0.35 | \$25.00 | \$8.75 |
| 01/20/15 | CURHAU | Electronic Engine Controls | 1.93 | \$25.00 | \$48.25 |
| 02/27/15 | DOUREI | Electronic Engine Controls | 2.23 | \$25.00 | \$55.75 |
| 02/27/15 | DOUREI | Electronic Engine Controls, NO PROBLEM, | 0.12 | \$25.00 | \$3.00 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|------------|-----------------------|-----------|------|------------|---------|
| 01/09/15 | 45-4928594 | sensor exh gas press. | | 1.00 | \$87.42 | \$87.42 |

Section: 49 **Complaint:** LEAKING **Comments:**
Priority: 5 **Rep Reason:** INSPECTION repair cold water leak
Component: 042-005 **Unit War:** None
 Water Manifold
War. Type: NO WARRANTY

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-----------------------------------|-------|---------|---------|
| 01/12/15 | LONWIL | Water Manifold, LEAKING, REPAIRED | 0.92 | \$25.00 | \$23.00 |

Section: 50 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT Check alignment, Clock steering wheel corectly
Component: 015-004 **Unit War:** None
 Steering Linkage
War. Type: NO WARRANTY

Comments

Date: Comment Text

01/20/15 removed drag link w ith paul [MATGIL]

01/20/15 installed drag link/checked alignment 0.0 /checked king pins leaf sping bushing/tire pressure [PAUPAR]

01/20/15 pit man arm off by one tooth/arm is back in line and adj [PAUPAR]

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 01/20/15 | MATGIL | Steering Linkage, LOOSE, DISASSEMBLE | 0.75 | \$25.00 | \$18.75 |
| 01/20/15 | PAUPAR | Steering Linkage | 0.90 | \$25.00 | \$22.50 |
| 01/20/15 | PAUPAR | Steering Linkage, MISADJUSTED, REPLACED | 3.55 | \$25.00 | \$88.75 |
| 01/20/15 | JACHEN | Steering Linkage | 0.53 | \$25.00 | \$13.25 |
| 01/22/15 | PAUPAR | Steering Linkage, MISADJUSTED, ADJUSTED | 0.05 | \$25.00 | \$1.25 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-----------------|-------------------|-----------|------|------------|----------|
| 01/20/15 | 15-L24VU8445A11 | steering draglink | | 1.00 | \$305.39 | \$305.39 |

Section: 51 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT Vent selector sometimes not working
Component: 001-002 **Unit War:** None no heat in vents 2/ 17/ 15
Heating & Ventilating
War. Type: NO WARRANTY

Comments

Date: **Comment Text**
 02/26/15 completed the problem during the other secitons [DOUREI]
 03/24/15 removed all vent piping and installed w ith tar tape to keep the air inside the piping
 since the piping has been in the
 03/24/15 truck since new and is collapsing on itself [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 02/23/15 | JACTHE | Heating & Ventilating | 1.13 | \$25.00 | \$28.25 |
| 02/26/15 | DOUREI | Heating & Ventilating, IMPROPER REP, REPAIRED | 0.12 | \$25.00 | \$3.00 |
| 03/24/15 | DOUREI | Heating & Ventilating | 1.02 | \$25.00 | \$25.50 |
| 03/24/15 | DOUREI | Heating & Ventilating, LEAKING, INSPECTED | 0.45 | \$25.00 | \$11.25 |

Section: 52 **Complaint:** LOOSE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT swap seat cussions
Component: 002-027 **Unit War:** None seat 2/ 17/ 15
Seat Frames & Springs
War. Type: NO WARRANTY

Vendor: DAVAUT DAVE AUTO UPHOLSTERY

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Comments

| Date: | Comment Text | Vendor |
|----------|--|--------|
| 01/20/15 | sw apped paas seat to driver seat driver seat is being redone [PAUPAR] | N |
| 02/21/15 | w e are waitng for the driver seat to come back from being redone [JAMGAY] | N |
| 02/26/15 | connected the low er cushin that w as not connected to the passanger seat [DOUREI] | N |

Labor

| Date: | Mechanic | Description | Vendor | Hours | Rate | Total |
|----------|----------|--|--------|-------|---------|--------|
| 01/20/15 | PAUPAR | Seat Frames & Springs, WORN OUT, | N | 0.28 | \$25.00 | \$7.00 |
| 02/21/15 | JAMGAY | Seat Frames & Springs, WORN OUT, INSPECTED | N | 0.15 | \$25.00 | \$3.75 |
| 02/26/15 | DOUREI | Seat Frames & Springs, NOT CONNECTE, | N | 0.32 | \$25.00 | \$8.00 |

Services

| Date: | Description | Vendor | Charge | Total |
|----------|-------------|--------|---------|---------|
| 02/10/15 | REFOAM SEAT | Y | \$55.00 | \$55.00 |

Section: 53 Complaint: INOPERATIVE Comments:
Priority: 5 Rep Reason: DRIVERREPORT FRONT BRAKE MAKES NOISE
Component: 013-001 Unit War: None
Front Brakes & Drums
War. Type: NO WARRANTY

Comments

| Date: | Comment Text |
|----------|--|
| 01/22/15 | checked and readjusted all brakes since driver complained that front brakes are squeaking and all brakes and drums are |
| 01/22/15 | new [DOUREI] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-------------------------------------|-------|---------|--------|
| 01/22/15 | DOUREI | Front Brakes & Drums, NOT CONNECTE, | 0.18 | \$25.00 | \$4.50 |

Section: 54 Complaint: DIRTY Comments:
Priority: 5 Rep Reason: PRE-DELIVERY
Component: 999-999 Unit War: None
Total Vehicle
War. Type: NO WARRANTY

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|-------|----------|-------------|-------|------|-------|
|-------|----------|-------------|-------|------|-------|

Repair Order Detail

TranSpec Leasing, Inc.

| | |
|-----------------------------------|-------------------|
| Repair Order: OMA-00037236 | Unit: 1342 |
|-----------------------------------|-------------------|

| | | | | | |
|----------|--------|------------------------------------|------|---------|---------|
| 02/11/15 | CLAWIL | Total Vehicle, NO PROBLEM, CLEANED | 1.07 | \$25.00 | \$26.75 |
|----------|--------|------------------------------------|------|---------|---------|

Section: 55 Complaint: BROKEN Comments:
Priority: 5 Rep Reason: DRIVERREPORT driver door handle sticks
Component: 002-018 Unit War: None
Cab Or Front Door Mechanism
War. Type: NO WARRANTY

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 02/21/15 | JAMGAY | Cab Or Front Door Mechanism, WORN OUT, | 2.47 | \$25.00 | \$61.75 |

Section: 56 Complaint: INOPERATIVE Comments:
Priority: 5 Rep Reason: DRIVERREPORT spot lights don't work
Component: 034-004 Unit War: None 7 way cord loose needs replaced , glad hands need replaced
Clearance/marker/interior Lamps, Bulbs, Reflectors, Fuses &
War. Type: NO WARRANTY order spot lights per Ritch

Comments

| Date: | Comment Text |
|----------|--|
| 02/20/15 | replaced the 7way [JAMGAY] |
| 02/20/15 | replaced the gland hands worn out [JAMGAY] |
| 02/25/15 | resecured the 7 way cord [DOUREI] |
| 03/04/15 | replaced spot lights and rewired passenger side spotlight [DOUREI] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 02/20/15 | JAMGAY | Clearance/marker/interior Lamps, Bulb, CORRODED, DISASSEMBLE | 0.63 | \$25.00 | \$15.75 |
| 02/20/15 | JAMGAY | Clearance/marker/interior Lamps, Bulbs,, CORRODED, INSPECTED | 0.03 | \$25.00 | \$0.75 |
| 02/20/15 | JAMGAY | Clearance/marker/interior Lamps, Bulb, CORRODED, DISASSEMBLE | 0.25 | \$25.00 | \$6.25 |
| 02/25/15 | DOUREI | Clearance/marker/interior Lamps, Bulbs, Ref, LOOSE, REPAIRED | 0.95 | \$25.00 | \$23.75 |
| 03/04/15 | DOUREI | Clearance/marker/interior Lamps, Bulbs, | 0.87 | \$25.00 | \$21.75 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236

Unit: 1342

| | | | | | |
|----------|--------|---|------|---------|---------|
| 03/04/15 | DOUREI | Clearance/marker/interior Lamps, Bulbs,, CORRODED, INSPECTED | 1.97 | \$25.00 | \$49.25 |
|----------|--------|---|------|---------|---------|

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|-------------------------------|-----------|------|------------|----------|
| 02/20/15 | 13-GH11451 | EMERGENCY GLADHAND | | 1.00 | \$2.10 | \$2.10 |
| 02/20/15 | 13-GH11452 | SERVICE GLADHAND | | 1.00 | \$1.82 | \$1.82 |
| 02/20/15 | 34-15-730 | MALE 7 WAY PLUG W/SPRING | E | 1.00 | \$5.31 | \$5.31 |
| 03/04/15 | 02-730-1055 | HORN, ELECTRIC | Y | 1.00 | \$13.69 | \$13.69 |
| 03/04/15 | 34-P54-6026 | RIGHT SIDE SPOT LAMP ASSEMBLY | E | 1.00 | \$316.73 | \$316.73 |
| 03/04/15 | 34-P54-6027 | LEFT SIDE SPOT LAMP ASSEMBLY | E | 1.00 | \$316.73 | \$316.73 |

Section: 57 Complaint: INOPERATIVE Comments:
Priority: 5 Rep Reason: DRIVERREPORT front cigar lighter don't work
Component: 052-001 Unit War: None
Cigar Lighter
War. Type: NO WARRANTY

Comments

Date: Comment Text

02/27/15 replaced fuse for the cigarette lighter and got it to work properly [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---------------------------------------|-------|---------|--------|
| 02/27/15 | DOUREI | Cigar Lighter, NOT CONNECTE, REPAIRED | 0.15 | \$25.00 | \$3.75 |

Section: 58 Complaint: INOPERATIVE Comments:
Priority: 5 Rep Reason: DRIVERREPORT fan speed 3 don't work
Component: 001-001 Unit War: None
Air Conditioning Assembly
War. Type: NO WARRANTY

Comments

Date: Comment Text

02/26/15 found that the blow er resistor w as bad for the third fan speed [DOUREI]

02/26/15 also fixed the dash vent problem and installed all three screw s that need to be in the actuator now the dash vents work

02/26/15 in dash, floor, and defrost and every w here in betw een [DOUREI]

02/27/15 reinstalled all dash panels including akk kick panels and the door sill plate [DOUREI]

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 02/25/15 | DOUREI | Air Conditioning Assembly | 0.53 | \$25.00 | \$13.25 |
| 02/26/15 | DOUREI | Air Conditioning Assembly | 2.48 | \$25.00 | \$62.00 |
| 02/26/15 | DOUREI | Air Conditioning Assembly | 3.40 | \$25.00 | \$85.00 |
| 02/27/15 | DOUREI | Air Conditioning Assembly, IMPROPER REP, | 1.27 | \$25.00 | \$31.75 |

Section: 59 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT fuel gauge bounces
Component: 003-001 **Unit War:** None
Gauges & Warning Devices
War. Type: NO WARRANTY

Comments

| Date: | Comment Text |
|----------|---|
| 02/26/15 | found loose connection at the gauge in the cab secured the wires |
| 03/04/15 | also found that the fuel sending unit was bad the potentiometer was not reading properly [DOUREI] |
| 03/24/15 | rich helped me look at the fuel gauge sending unit and we tested it at all kinds of positions such as full, 3/4 and 7/8 |
| 03/24/15 | 1/2 3/8, 5/8, and then at 1/4 and empty never got it to bounce [DOUREI] |
| 03/24/15 | reinstalled the fuel gauge and drove around lot and hit every bump to see if i could get it to bounce to empty like the |
| 03/24/15 | driver says it does never got it to do that [DOUREI] |

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|---|-------|---------|---------|
| 02/27/15 | DOUREI | Gauges & Warning Devices | 0.57 | \$25.00 | \$14.25 |
| 03/02/15 | DOUREI | Gauges & Warning Devices | 0.92 | \$25.00 | \$23.00 |
| 03/04/15 | DOUREI | Gauges & Warning Devices, WORN OUT, | 0.18 | \$25.00 | \$4.50 |
| 03/24/15 | DOUREI | Gauges & Warning Devices | 1.07 | \$25.00 | \$26.75 |
| 03/24/15 | DOUREI | Gauges & Warning Devices, NOT CONNECTE, | 1.45 | \$25.00 | \$36.25 |

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|------------------|-------------------------------|-----------|------|------------|----------|
| 03/04/15 | 44-5549-13715-26 | FUEL SENDER 26 INCH PETE TANK | Y | 1.00 | \$182.65 | \$182.65 |
| 03/04/15 | 44-P92-7180-0650 | FUEL SENDER HARNESS | Y | 1.00 | \$14.87 | \$14.87 |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

| | | |
|---------------------------|--------------------------|--------------|
| Section: 60 | Complaint: LEAKING | Comments: |
| Priority: 5 | Rep Reason: DRIVERREPORT | coolant leak |
| Component: 042-002 | Unit War: None | |
| Radiator | | |
| War. Type: | NO WARRANTY | |

Comments

Date: Comment Text

02/25/15 found three fittings that had a little bit of a coolant leak and got the clamps tightened up [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|------------------------------|-------|---------|--------|
| 02/25/15 | DOUREI | Radiator, LEAKING, INSPECTED | 0.38 | \$25.00 | \$9.50 |

| | | |
|---|--------------------------|------------------------------------|
| Section: 61 | Complaint: INOPERATIVE | Comments: |
| Priority: 5 | Rep Reason: DRIVERREPORT | rear light bar loose & wires loose |
| Component: 034-002 | Unit War: None | |
| Lamps - Tail, Stop, Turn & License, Rear | | |
| War. Type: | NO WARRANTY | |

Comments

Date: Comment Text

02/20/15 the bar that goes across the back of fram is loose and needs to be tight back up [JAMGAY]

02/20/15 i tight the lights up [JAMGAY]

02/20/15 unistalled both mund flap brackets and reinstalled a different way so frame w ould fasten. w orked on left side tale

02/20/15 liths and made sure all w orked. secured w ires lume [THOBLO]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 02/20/15 | JAMGAY | Lamps - Tail, Stop, Turn & License, Rear, | 1.03 | \$25.00 | \$25.75 |
| 02/20/15 | THOBLO | Lamps - Tail, Stop, Turn & License,, IMPROPER REP, REPAIRED | 3.45 | \$25.00 | \$86.25 |

| | | |
|---------------------------|--------------------------|-------------------|
| Section: 62 | Complaint: BROKEN | Comments: |
| Priority: 5 | Rep Reason: DRIVERREPORT | dash lights flash |
| Component: 002-008 | Unit War: None | |
| Instrument Panel | | |
| War. Type: | NO WARRANTY | |

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Comments

Date: Comment Text

03/04/15 fixed w hen the dash w as apart for the vent prroblem [DOURE]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-----------------------------------|-------|---------|--------|
| 02/27/15 | DOURE | Instrument Panel | 0.28 | \$25.00 | \$7.00 |
| 03/04/15 | DOURE | Instrument Panel, LOOSE, REPAIRED | 0.08 | \$25.00 | \$2.00 |

| | | | | | |
|------------------------------------|-------------|--------------------|--------------|-----------------------|--|
| Section: | 63 | Complaint: | LOOSE | Comments: | |
| Priority: | 5 | Rep Reason: | DRIVERREPORT | chrome around windows | |
| Component: | 002-018 | Unit War: | None | | |
| Cab Or Front Door Mechanism | | | | | |
| War. Type: | NO WARRANTY | | | | |

Comments

Date: Comment Text

02/26/15 removed the chrome around w indow s and put in the bunk

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|-------------|----------------|-----------|------|------------|----------|
| 02/25/15 | 02-R48-6017 | L/H DOOR HINGE | Y | 1.00 | \$211.40 | \$211.40 |

| | | | | | |
|-----------------------|-------------|--------------------|--------------|--------------------------|--|
| Section: | 64 | Complaint: | LEAKING | Comments: | |
| Priority: | 5 | Rep Reason: | DRIVERREPORT | air leak from compressor | |
| Component: | 013-009 | Unit War: | None | | |
| Air Compressor | | | | | |
| War. Type: | NO WARRANTY | | | | |

Comments

Date: Comment Text

02/25/15 doug tightened the hot air line on the air compressor

| | | | | | |
|------------------------|-------------|--------------------|--------------|-----------------------------|--|
| Section: | 65 | Complaint: | LOW POWER | Comments: | |
| Priority: | 5 | Rep Reason: | DRIVERREPORT | power loss last couple days | |
| Component: | 045-020 | Unit War: | None | | |
| Engine Assembly | | | | | |
| War. Type: | NO WARRANTY | | | | |

Comments

Date: Comment Text

02/26/15 truck needs forced regen

03/05/15 preformed forced regen and replaced fuel shut off valve w ith one from engine in the container [DOURE]

Repair Order Detail

TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|--|-------|---------|---------|
| 03/04/15 | DOUREI | Engine Assembly | 1.18 | \$25.00 | \$29.50 |
| 03/05/15 | DOUREI | Engine Assembly, NO PROBLEM, INSPECTED | 1.60 | \$25.00 | \$40.00 |

Section: 66 **Complaint:** BROKEN **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT top flaps need replaced
Component: 014-011 **Unit War:** None
 Quarter Fenders
War. Type: NO WARRANTY

Comments

Date: **Comment Text**
 02/25/15 replaced 1/4 fender top flaps [DOUREI]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|----------------------------------|-------|---------|---------|
| 02/20/15 | THOBLO | Quarter Fenders, NO PROBLEM | 0.10 | \$25.00 | \$2.50 |
| 02/25/15 | DOUREI | Quarter Fenders, BENT, INSPECTED | 0.40 | \$25.00 | \$10.00 |

Section: 67 **Complaint:** ROUTINE **Comments:**
Priority: 5 **Rep Reason:** PRE-DELIVERY Pick up truck from cummins
Component: 999-999 **Unit War:** None
 Total Vehicle
War. Type: NO WARRANTY

Comments

Date: **Comment Text**
 03/24/15 get truck from cummins [ROGSAL]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-----------------------------------|-------|---------|---------|
| 03/24/15 | ROGSAL | Total Vehicle, ROUTINE, INSPECTED | 1.53 | \$25.00 | \$38.25 |

Section: 68 **Complaint:** INOPERATIVE **Comments:**
Priority: 5 **Rep Reason:** DRIVERREPORT Repair loose spot lamps
Component: 034-001 **Unit War:** None
 Headlamps
War. Type: NO WARRANTY

Comments

Date: **Comment Text**
 03/24/15 double checked both spot lights and installed lock tight on the bolts that hold the handles inplace [DOUREI]


Repair Order Detail
TranSpec Leasing, Inc.

Repair Order: OMA-00037236 **Unit:** 1342

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-------------------------------|-------|---------|---------|
| 03/24/15 | DOUREI | Headlamps, LOOSE, DISASSEMBLE | 0.40 | \$25.00 | \$10.00 |

| | |
|---|------------------|
| Totals Repair Order OMA-00037236 | |
| Total Parts Issued: | 233.25 |
| Total Labor Hours: | 279.25 |
| Total Part Charges: \$ | 14,351.58 |
| Total Labor Charges: | 6,981.25 |
| Total Tax Charges: | 0.00 |
| Total Fee Charges: | 0.00 |
| Total Service Charges: \$ | 1,542.83 |
| Repair Total: | 22,875.66 |

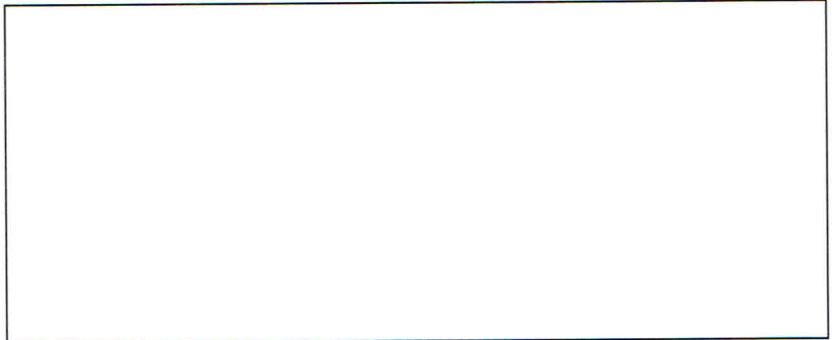

Repair Order Detail

Transpec Leasing, Inc.

Repair Order: KCM-00023417

Shop: KCM

Unit: 1342
2009 PETERBILT 386

Domicile: OMA

Cost Cntr: 1101 OMA

License:

VIN: 1XPHD49X79D770456

Status: CLOSED

Customer: TRSPLF
TRANSPAC LEASE FLEET

Make: PTRBL

Model: 386

Year: 2009

In Service: 11/6/2009

Repair Class: NONSCHEDULED

Repair Site: FACILITY

Opened: 6/26/2014

Closed: 8/22/2014

Completed: 7/22/2014

Odometer: 966,614

102

| | | |
|------------------------|------------------------|---------------------------|
| Section: 1 | Complaint: INOPERATIVE | Comments: |
| Priority: 5 | Rep Reason: INSPECTION | Check Rod & Main Bearings |
| Component: 045-003 | Unit War: None | |
| Crankshaft | | |
| War. Type: NO WARRANTY | | |

Comments

Date: Comment Text

06/26/14 took oil pan off [ADRTTH]

Labor

| Date: | Mechanic | Description | Hours | Rate | Total |
|----------|----------|-------------|-------|---------|---------|
| 06/26/14 | ADRTTH | Crankshaft | 0.38 | \$25.00 | \$9.50 |
| 06/26/14 | ROBJON | Crankshaft | 2.13 | \$25.00 | \$53.25 |
| 06/26/14 | ADRTTH | Crankshaft | 0.18 | \$25.00 | \$4.50 |
| 07/02/14 | ROBJON | Crankshaft | 2.02 | \$25.00 | \$50.50 |
| 07/02/14 | ROBJON | Crankshaft | 1.55 | \$25.00 | \$38.75 |
| 07/03/14 | ROBJON | Crankshaft | 0.88 | \$25.00 | \$22.00 |
| 07/03/14 | ROBJON | Crankshaft | 1.92 | \$25.00 | \$48.00 |
| 07/07/14 | ROBJON | Crankshaft | 2.02 | \$25.00 | \$50.50 |
| 07/07/14 | CODEAS | Crankshaft | 0.48 | \$25.00 | \$12.00 |
| 07/08/14 | CODEAS | Crankshaft | 1.27 | \$25.00 | \$31.75 |
| 07/08/14 | ROBJON | Crankshaft | 0.73 | \$25.00 | \$18.25 |
| 07/09/14 | CODEAS | Crankshaft | 3.55 | \$25.00 | \$88.75 |
| 07/09/14 | ROBJON | Crankshaft | 3.32 | \$25.00 | \$83.00 |
| 07/09/14 | ROBJON | Crankshaft | 0.02 | \$25.00 | \$0.50 |

*Rod & main
Bearings replaced
70,000 miles ago*

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|------------|-------------------|-----------|------|------------|----------|
| 07/02/14 | 3800298 | main brgs | | 1.00 | \$163.03 | \$163.03 |
| 07/02/14 | 4089405 | rod brgs | | 6.00 | \$46.19 | \$277.14 |
| 07/02/14 | 45-3678756 | P/U O Ring | Y | 1.00 | \$5.43 | \$5.43 |
| 07/02/14 | 45-4026684 | pan gasket | Y | 1.00 | \$141.01 | \$141.01 |
| 07/03/14 | 45-3800751 | shim kit oil pump | Y | 1.00 | \$12.18 | \$12.18 |

Repair Order Detail TranSpec Leasing, Inc.

| | | | | | | | |
|-----------------------------------|------------|-----------------------|---|------|--------|--------|--|
| Repair Order: KCM-00023417 | | Unit: 1342 | | | | | |
| 07/09/14 | 45-3903475 | Rectangular Ring Seal | Y | 1.00 | \$3.08 | \$3.08 | |
| 07/09/14 | 45-3936876 | OIL CAP SEAL | | 1.00 | \$2.99 | \$2.99 | |

| | | | |
|-------------------|-------------|--------------|-----------|
| Section: 2 | Complaint: | PM | Comments: |
| Priority: 5 | Rep Reason: | PRE-DELIVERY | |
| Component: 999 | Unit War: | None | |
| Total Vehicle | | | |
| War. Type: | NO WARRANTY | | |

202

Parts

| Date: | Part ID | Description | After Mkt | Qty | Unit Price | Total |
|----------|---------|----------------|-----------|------|------------|---------|
| 07/10/14 | 34-9003 | HEADLIGHT BULB | E | 2.00 | \$13.75 | \$27.50 |

| | | | |
|---|-----------------|--|--|
| Totals Repair Order KCM-00023417 | | | |
| Total Parts Issued: | 14.00 | | |
| Total Labor Hours: | 20.45 | | |
| Total Part Charges: | \$ 632.36 | | |
| Total Labor Charges: | 511.25 | | |
| Total Tax Charges: | 0.00 | | |
| Total Fee Charges: | 0.00 | | |
| Total Service Charges: | \$ 0.00 | | |
| Repair Total: | 1,143.61 | | |