

INVOICE W 18348
 Date 02/15/17
 Date Open 01/30/17

Page: 1 of 3

Unit #	Plate #	Year	Make	Model	Mileage/Hrs	VIN	Engine
NEW		1997	INTERNATION	4700	288505/0.0	1HTSCAAM3VH445108	
Qty	Description					Price	Amount
	Complaint : CHECK AND ADVISE - TRUCK IS EMITTING WHITE SMOKE.						
	Correction : REMOVED AND REPLACED FUEL FILTER WITH NEW AND INSPECTED LIFT PUMP. WE FOUND AN ACCUMULATION OF SAW DUST IN FUEL AND FOUND THAT IT HAD CONTAMINATED THE FUEL TRANSFER PUMP ASSEMBLY. REMOVED AND REPLACED FUEL TRANSFER PUMP WITH NEW AND TEST DROVE, IN WHICH THE TRUCK RAN NORMALLY. CUSTOMER CAME TO PICK UP AND DROVE FOR A SHORT PERIOD OF TIME BUT TRUCK DIED AND WAS UNABLE TO RESTART. CUSTOMER HAD TOWED BACK TO HOYT'S TRUCK CENTER FOR REPAIRS. FURTHER INSPECTION OF THE FUEL TANKS REVEALED BROKEN PICK UP TUBES INSIDE THE TANKS. REMOVED FUEL TANK ASSEMBLIES AND CLEANED SAW DUST AND CHUNKS OF WOOD OUT OF FUEL TANKS. REPLACED PICK UP TUBES AND FUEL GAUGE WERE REQUIRED (DUE TO CONTAMINATION FROM SAWDUST/WOOD CHUNKS) WHILE TANKS WERE REMOVED AND REINSTALLED TANKS BACK INTO TRUCK, USING NEW TANK STRAPS UPON REASSEMBLY DUE TO RUST DAMAGE ON STRAPS THAT WERE REMOVED. TEST DROVE AND NO FURTHER ISSUES AROSE.						
1.000	SUBLET ITEM 2 BROWNS TOW BILL BROWNS INVOICE #51760						
1.000	SUBLET ITEM 1 BROWN'S TOW BILL						
-1.00	WARWARRANTYLABOR REFUND ON TOW BILL						
1.000	PYRSTARTING FLUID STARTING FLUID						

Parts.....
 Labor.....
 Sublet.....
 Shop Supplies
 Freight.....

Sub Total 3946.90
 Sales Tax.... 301.94

TOTAL Continued

INVOICE W 18348
 Date 02/15/17
 Date Open 01/30/17

Page: 2 of 3

Written By SERVICE1	Terms CHG	Time 09:23:41	Customer Po #	Promised	Phone	Ship Via	
Unit # NEW	Plate #	Year 1997	Make INTERNATION	Model 4700	Mileage/Hrs 288505/0.0	VIN 1HTSCAAM3VH445108	Engine
Qty	Description					Price	Amount
1.000	FLEFF5269 FUEL FILTER						
1.000	IHC1817677C91 FILTER						
1.000	IHC1825473C93 TRANSFER PUMP KIT						
2.000	IHC471453C2 FUEL TANK MOUNTING STRAP						
9.000	IHC596589C1 FUEL TANK STRAP LINING - PER FOOT						
1.000	IHC476846C2 FUEL GAUGE						
2.000	IHC1647277C1 FUEL PICK UP TUBE						
1.000	IHC464751C3 GASKET FUEL						
1.000	FRTINCOMING FREIGHT INCOMING PICKUP TUBE AND FUEL SENDING UNIT						
1.000	KRY51613 BLACK SATIN PAINT*						
						SubTotal	3137.69
Complaint : BRAKES ARE MOOSHY AND A BRAKE LINE IS LEAKING. REPLACE BRAKE LINE AND SEE IF THAT FIXES IT. Correction : UPON INSPECTION, WE FOUND FOUR BRAKE LINES THAT CONTAINED COPIOUS AMOUNTS OF RUST AND WERE SHOWING SIGNS OF LEAKING. REMOVED AND REPLACED TWO OF THOSE LINES WITH NEW. THE OTHER TWO LINES WERE NO LONGER OFFERED BY INTERNATIONAL AND REQUIRED CUSTOM MAKING. CUSTOM MADE THOSE TWO LINES AND INSTALLED. BLED SYSTEM AND TESTED BRAKE OPERATION, ALL OKAY NOW.							

Parts.....
 Labor.....
 Sublet.....
 Shop Supplies
 Freight.....

Sub Total 3946.90
 Sales Tax.... 301.94

TOTAL Continued

INVOICE W 18348
 Date 02/15/17
 Date Open 01/30/17

Page: 3 of 3

Written By SERVICE1		Terms CHG		Time 09:23:42		Customer Po #		Promised		Phone		Ship Via			
Unit # NEW		Plate #		Year 1997		Make INTERNATION		Model 4700		Mileage/Hrs 288505/0.0		VIN 1HTSCAAM3VH445108		Engine	
Qty		Description										Price		Amount	
1.000		MSC813-5461 BRAKE LINE													
2.000		MSC813-5460 BRAKE LINE													
1.000		IHC1619277C91 HOSE ASSY													
1.000		MSC813-1221 BRAKE LINE													
2.000		GOOH10108 1/2 PUSH LOCK HOSE													
2.000		FMPBRAKEFLUIDQT BRAKE FLUID 1 QT													
1.000		IHC1619276C91 HOSE ASSY													
												SubTotal		734.21	

Parts.....
 Labor.....
 Sublet.....
 Shop Supplies
 Freight.....

Sub Total 3946.90
 Sales Tax.... 301.94

TOTAL 4248.84

INVOICE S 17370

Date 03/31/17

Date Open 03/24/17

Page: 1 of 1

Written By HOYTS013		Terms CHG		Time 15:07:57		Customer Po #		Promised		Phone		Ship Via			
Unit #		Plate #		Year		Make		Model		Mileage/Hrs 0/0.0		VIN		Engine	
Qty	Loc	Description										Price	Amount		
2.000		IHC554184C92 FUEL CAP										110.44	220.88		
											SubTotal	220.88			

Parts.....

Sub Total 220.88
Sales Tax.... 16.90

TOTAL DUE 237.78

INVOICE **W 19381**
Date 03/30/17
Date Open 03/29/17

Page: 1 of 2

Written By SERVICE1	Terms CHG	Time 11:31:35	Customer Po #	Promised	Phone	Ship Via
Unit # NEW	Plate #	Year 1997	Make INTERNATION	Model 4700	Mileage/Hrs 292264/0.0	VIN 1HTSCAAM3VH445108
Engine						

Qty	Description		Price	Amount
	Complaint : PM A - CHECK ALL FLUID LEVELS AND ADJUST CLUTCH.			
	Correction : CHECKED ALL FLUIDS, GREASED, INSPECTED BRAKES AND CHECKED LIGHTS. ADJUSTED CLUTCH TO PROPER SPECIFICATION.			
	NOTES: *DURING CLUTCH ADJUSTMENT, WE FOUND THAT THE GREASE ZERK FOR THROWOUT BEARING IS BROKEN OFF. ATTEMPTED TO INSTALL A PUSH IN GREASE ZERK BUT THE HOLE WILL NOT EVEN ACCEPT A PUSH IN FITTING. *FOUND DIFFERENTIAL OIL BURNT SMELLING AND THE TRANSMISSION LOW ON OIL. DRAINED AND REPLENISHED BOTH WITH FRESH TO PROPER FILL LEVELS.			
16.00	CHV40WTRANSBULK	DELO ESI 40W TRANSMISSION OIL		
32.00	CHV85W140BULK	GREASE 85W-140		
			SubTotal	473.04
	Complaint : CHECK AND ADVISE - CUSTOMER HEARS A BELT "WHINING" WHILE ENGINE IS RUNNING.			
	Correction : INSPECTED FOR ABNORMAL BELT NOISE AND HEARD NOTHING OUT OF THE ORDINARY. ADVISED CUSTOMER.			
	Complaint : CHECK AND ADVISE - RIGHT REAR BRAKE LIGHT INOPERABLE. CUSTOMER FEARS IT'S ALSO EFFECTING THROTTLE PERFORMANCE.			

Parts..... 211.04
Labor..... 393.00

Env/Shop Sup 31.44

Sub Total 635.48
Sales Tax.... 48.61

TOTAL **Continued**

W 19381

03/30/17

03/29/17

Page: 2 of 2

Written By SERVICE1	Terms CHG	Time 11:31:36	Customer Po #	Promised	Phone	Ship Via	
Unit # NEW	Plate #	Year 1997	Make INTERNATION	Model 4700	Mileage/Hrs 292264/0.0	VIN 1HTSCAAM3VH445108	Engine
Qty	Description					Price	Amount
	Correction : INSPECTION REVEALED A BROKEN WIRE AT THE REAR OF TRUCK. REPAIRED WIRING AND TESTED OPERATION, WORKS NORMALLY NOW.						
						SubTotal	131.00

Parts.....
Labor.....

Env/Shop Sup

Sub Total	635.48
Sales Tax....	48.61

TOTAL	684.09
--------------	---------------

INVOICE

W 19824

Date

05/10/17

Date Open

04/24/17

Page: 1 of 2

Written By Chris		Terms CHG		Time 10:56:36		Customer Po #		Promised		Phone		Ship Via			
Unit # NEW		Plate #		Year 1997		Make INTERNATION		Model 4700		Mileage/Hrs 293010/0.0		VIN 1HTSCAAM3VH445108		Engine	
Qty		Loc		Description								Price		Amount	
				Complaint : REPLACE BROKEN LEAF SPRINGS.											
				Correction : CHECKED OVER SPRINGS AND ONLY FOUND ONE TO BE BROKEN. REMOVED WHEELS AND HAD TO CUT OFF THE U-BOLTS. REMOVED AND REPLACED THE BROKEN LEAF SRPING AND PINS. INSTALLED BACK ONTO THE TRUCK AND BOLTED UP NEW U-BOLTS. GREASED AND TEST DROVE TRUCK. ALL OK.											
2.000				TRST8-78X44 U BOLT,NUTS,WASHERS											
1.000		DISP3		MMM08880 BRAKLEEN											
2.000				DRI1671766C1 SPRING PIN											
1.000		IMPDR		NFC13139 FLAP WHEEL 1"											
1.000				DRI206258R3 PIN											
1.000				DRI55-55-031 LEAF SPRING											
1.000		IMPDR		NFC73020 GREASE FIT BRASS 1/8 STR											
1.000		VISION		FRTINCOMING FREIGHT INCOMING LEAF SPRING											
2.000		IMPDR		NFC96052 1/8X2 COTTER PIN											
												SubTotal		1765.41	
				Complaint : DIAGNOSTIC FEE											
												SubTotal		131.00	
				Complaint : CEL COMES ON RANDOMLY AND DERATES THE ENGINE.											
				Correction : CONNECTED TO LAPTOP AND FOUND CODES FOR INJECTION CONTROL PRESSURE TOO LOW. FOUND THE SENSOR HAS FAILED.											

Parts.....

Labor.....

Env/Shop Sup

Freight.....

Sub Total

3264.96

Sales Tax....

249.77

TOTAL DUE Continued o

INVOICE W 20133
Date 05/17/17
Date Open 05/11/17

Page: 1 of 2

Written By SERVICE1		Terms CHG		Time 09:24:00		Customer Po #		Promised		Phone		Ship Via	
Unit # NEW		Plate #		Year 1997		Make INTERNATION		Model 4700		Mileage/Hrs 293891/0.0		VIN 1HTSCAAM3VH445108	
Engine													

Qty	Loc	Description	Price	Amount
		<p>Complaint : CHECK AND REPAIR - FUEL CROSSOVER IS LEAKING.</p> <p>Correction : FOUND FUEL LEAKING AT THE CROSSOVER FITTING. REMOVED THE FITTING AND REPLACED WITH A NEW ONE. CLEANED UP AND CHECKED FOR LEAKS. NONE FOUND. ALL OK.</p>		
			SubTotal	131.00
1.000		<p>Complaint : CHECK AND ADVISE- ENGINE RANDOMLY DIES. CHECK FOR FUEL POSSIBLE FUEL SENSOR ISSUE (PER HOYT)</p> <p>Correction : CONNECTED TO LAPTOP AND CHECKED FOR CODES. FOUND FAULT CODES FOR FUEL PRESSURE REGULATOR AND THROTTLE POSITION SENSORS. REMOVED AND REPLACED BOTH SENSORS. CLEARED CODES AND TEST DROVE TRUCK. NEVER SHUTDOWN. LET TRUCK SIT AND IDLE ALL DAY AND IT NEVER SHUTDOWN. ALL OK.</p>		
1.000		<p>IHC2607117C91 THROTTLE SENSOR</p> <p>IHC1841217C91 IPR VALVE</p>		
			SubTotal	1334.00
		<p>Complaint : CHECK AND ADVISE - FRONT STEER TIRES ARE WEARING UNEVEN.</p> <p>Correction : REPLACED KING PINS AND BUSHINGS. STRAIGHTENED OUT TIE ROD TUBE AND ALIGNED THE FRONT AXLE. ALL OK.</p>		

Parts.....
Labor.....

Env/Shop Sup

Sub Total 2539.72
Sales Tax.... 194.29

TOTAL DUE Continued o