

CASE 580SMII 04 SN: N4C304171 HR .0 W:00  
 Sold By: JS PO #: Date 5/12/17 SERVICE INVOICE WT36520  
 Ship By: Tax #: 48-0670688 9:48:37 PRT: 4

Tax	D	Qty	Description	Price	Amount
-----	---	-----	-------------	-------	--------

# 01 FUEL LEAK

## CASE LABOR

\*\* TOTAL CASE LABOR

## SHOP SUPPLIES

09150 REBUILD INJECTION PUMP  
 09150 SHOP SUPPLIES

\*\* TOTAL SHOP SUPPLIES

## DIAGNOSTIC FEE

09150 DIAGNOSTIC FEES

## EPA CHARGE

09150 ENVIRONMENTAL CHARGES

## PARTS-SHOP

09150 1 CAS 87734356 HOSE, INTA  
 09150 1 CAS 504083433 GASKET K 3 B  
 09150 1 CAS 84565884 FILTER, FU F 5 B 1

\*\* TOTAL PARTS-SHOP

LOOKED AT FUEL LEAK AND DETERMINED THE INJECTION PUMP NEEDS REPLACED. QUOTED PARTS. STARTED REMOVING INJECTION PUMP. FINISHED REMOVING INJECTION PUMP. CLEANED OFF OLD MOUNTING GASKET AND WENT TO PUT NEW ONE ON AND FOUND IT WAS WRONG AND THE HOLES WERE OFF, ORDERED CORRECT GASKET AND ORDERED TURBO TO AIR CLEANER TUBE, THE OLD ONE WAS CRACKED AT THE TURBO END. INSTALLED INJECTION PUMP WITH NEW GASKET, HOOKED UP ALL FUEL LINES AND CHANGED FUEL FILTER, AND BLEED FUEL SYSTEM. INSTALLED REAR HOOD AND INSTALLED NEW AIR INTAKE HOSE FOR THE TURBO. STARTED AND RAN MACHINE AND CHECKED FOR LEAKS, NONE FOUND, PICKED UP WORK AREA. LOW IDLE 925 RPMS, HIGH IDLE 2400 RPMS.

SEGMENT SUBTOTAL 2459.50

\*\* SUBTOTAL 2459.50

\*\* SALES TAX 225.04

PAY THIS  
 AMOUNT



\$2684.54

CASE 580SMII 04 SN: N4C304171 HR 0 W:00  
 Sold By: JS PO #: Date 5/12/17 SERVICE INVOICE WT36520  
 Ship By: Tax #: 48-0670688 9:48:37 PRT: 4

### Work Order Summary

01 FUEL LEAK	2459.50
** SALES TAX	225.04
** TOTAL	2684.54

Tax	D	Qty	Description	Price	Amount
GROUP : 01					

PAY THIS  
 AMOUNT





CASE 580SMII 04 SN: N4C304171 HR 11438.0 W:00  
 Sold By: GP PO #: Date 6/30/17 SERVICE INVOICE WT36693  
 Ship By: Tax #: 48-0670688 10:17:44 PRT: 2

### Work Order Summary

01 REPAIR LEAK AT EXTENDAHOE	1027.45
** SALES TAX	94.01
** TOTAL	1121.46

Tax	D	Qty	Description	Price	Amount
GROUP : 01					

#### 01 REPAIR LEAK AT EXTENDAHOE

##### CASE LABOR

\*\* TOTAL CASE LABOR

SHOP SUPPLIES  
 09150 SHOP SUPPLIES  
 EPA CHARGE  
 09150 ENVIRONMENTAL CHARGES  
 PARTS-SHOP

09150	1	CAS 1543267C1	KIT-SEAL	K 4 A 3A
09150	1	CAS 184616A1	HOSE/A	PB49
09150	1	CAS 184617A1	HOSE/A	PB73
09150	1	CAS 73341724	HYTRAN UA	T 1 B 1A

\*\* TOTAL PARTS-SHOP

REMOVED OUTER SHELL AND FOUND CYLINDER WAS LEAKING OUT OF THE GLAND,  
 REMOVED CYLINDER AND FOUND HOSES WERE CHAFFED. ORDERED SEAL KIT AND HOSES,  
 RESEALED CYLINDER AND INSTALLED NEW HOSES, REINSTALLED CYLINDER AND  
 CHECKED FOR LEAKS, NONE FOUND, REINSTALLED OUTER SHELL. TOPPED OFF  
 HYDRAULIC OIL AND RINSED OFF BACKHOE, PUT IN PICK UP LINE.

\* SEGMENT SUBTOTAL 1027.45

\*\* SUBTOTAL 1027.45

\*\* SALES TAX 94.01

PAY THIS  
AMOUNT



\$1121.46