

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
2147/White	11	MERCEDES-BENZ TRUCK	WD3PE7CC3B5609162		152938/152956	T1427	
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
26JUL13 DD		14DEC2014	16:00 31AUG17		0.00	CASH	01SEP17
R.O. OPENED		READY	OPTIONS: SOLD-STK:SP1570 DLR:45105				

10:54 29AUG17 17:40 01SEP17

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A Sprinter Check Engine Light

S07 Sprinter Check Engine Light

82202 CPSP

1 906-490-06-00-80 REMAN EXHAUST SYSTEM

1 906-490-06-00-70 CORE EXHAUST SYSTEM

1 219-492-00-80 FLANGE GASKET

3 000-990-67-03 SCREW

1 000-490-13-41 CLAMP

1 642-905-01-00 PRESSURE SENSOR

2 906-997-23-52 EXHAUST GAS HOSE

2 906-997-22-52 EXHAUST GAS HOSE

2 004-997-25-90 LOOM TIE

2 006-997-18-90 LOOM TIE

1 642-140-00-00 NOISE DAMPER

1 014-997-64-45 O-RING

1 000-094-00-51 COMPENSATING RING

1 906-492-69-41 BRACKET

1 82202C

152956 DPF filter ash content too high. Hooked up SDS and battery charger and performed short test. Found that ash content of DPF was at 7.7 grams which is above the threshold. Noted that DPF bracket was cracked. Replaced DPF with bracket and hardware and replaced DPF differential pressure sensor and hoses. Cleared faults, taught in new components and test drove van to confirm repair.

B OPEN RECALL 2016090005 PASSANGER AIR BAG

CAUSE: FRONT PASSENGER AIRBAG CAMPAIGN 2016090005...D/C 91 920 63 7

029251 REPLACE PASSENGER AIRBAG CAMPAIGN

82202 WPSP

1 906-860-14-00-9051 PASSENGER AIRBAG

4 019-990-58-01 BOLT W FLANGE

1 002-997-24-90-64 CABLE TIE

1 82202W JACOB WARRANTY

152938 Airbag recall Replaced passenger side airbag per recall



(N/C)

(N/C)

(N/C)

(N/C)

(N/C)

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TSU	
2147/White	11	MERCEDES-BENZ TRUCK	WD3PE7CC3B5609162		152938/152956	T1427	
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
26JUL13 DD		14DEC2014	16:00 31AUG17		0.00	CASH	01SEP17
R.O. OPENED		READY	OPTIONS: SOLD-STK:SP1570 DLR:45105				

10:54 29AUG17	17:40 01SEP17		LIST	NET	TOTAL
LINE	OPCODE	TECH TYPE HOURS			
instructions.					

C RECALL DRIVERS AIR BAG 2017030012

CAUSE: DRIVERS AIRBAG CAMPAIGN 2017030012...D/C 91 930 65 7

029540 REPLACE DRIVERS AIRBAG

82202 WPSP

(N/C)

1 906-860-19-00 DRIVER AIRBAG

(N/C)

1 82202W JACOB WARRANTY

(N/C)

152938 Drivers airbag. Replaced drivers airbag for recall.

D** FOUND WHEN WORKING ON CAR THERE IS A LEAKING TURBO RESONATOR

S18 ENGINE MECHANICAL

82202 CPSP

152938 Turbo resonator leaking Replaced turbo resonator and cleaned up area of leakage.

CUSTOMER PAY ENVI/HAZ/WAS/DIS FOR REPAIR ORDER

DESCRIPTION	TOTALS
LABOR AMOUNT	1275.00
PARTS AMOUNT	1920.73
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	25.00
TOTAL CHARGES	3220.73
LESS AMOUNT	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	3220.73

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
2147/White	11	MERCEDES-BENZ TRUCK	WD3PE7CC3B5609162		157294/157305	T1752	
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
26JUL13 DD		14DEC2014	17:30 31OCT17	184	0.00	EXTW	31OCT17
R.O. OPENED		READY	OPTIONS: SOLD-STK:SP1570 DLR:45105				

17:17 18OCT17 16:48 31OCT17

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A Check Engine Light on.

S07 Check Engine Light on.

82202 CPSP

1 642-900-77-01 CONTROL UNIT

2 014-997-64-45 O-RING

1 044-545-79-28 COUPLING

157298 Faulty glow plug output stage. Hooked up SDS and battery charger and performed short test. Found that there was a fault for the glowplug output stage undervoltage. Tested battery battery is ok. Performed guided testing for this fault. Battery voltage is present at both power lines to the module, connector 1 pin 1 and connector 2 pin 5. Tested resistance to the CDI module pin that controls the module, 0.1 ohms resistance. Recommend replacing the glowplug module. Replaced module, cleared faults and test drove to confirm repair.

B PERFORM COMPLIMENTARY VEHICLE INSPECTION PER CHECKLIST

NCI PERFORM COMPLIMENTARY VEHICLE INSPECTION PER CHECKLIST

82202IMSVC

(N/C)

157298 PERFORMED MULTI-POINT INSPECTION

C** WINDSHIELD WASHER NOZZEL IS BROKEN REPLACE

00 MAINTENANCE MENU

82202 CPMB

D** Check Engine Light on.

S07 REPLACED #2 AND 6 GLOW PLUGS.

82202 CPSP

1 000-094-00-51 COMPENSATING RING

1 000-860-45-47 NOZZLE

2 001-159-66-01 HEATER PLUG



157305 Faulty glow plugs #2 and #6 Hooked up SDS and battery charger. Performed short test, found that #2 an #6 glowplugs were faulty. Performed resistance test of all glowplugs, found #2 was at 770

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
2147/White	11	MERCEDES-BENZ TRUCK		WD3PE7CC3B5609162		157294/157305		T1752
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
26JUL13 DD		14DEC2014	17:30 31OCT17		0.00	EXTW	31OCT17	
R.O. OPENED		READY	OPTIONS: SOLD-STK:SP1570 DLR:45105					

17:17 18OCT17	16:48 31OCT17						
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
ohms and #6 was OL. Replaced #2 and #6 glowplugs.							

E** VEHICLE HAD WRONG GLOW PLUG

S00 REPLACED #4 GLOW PLUG

82202IMSVC

(N/C)

1 001-159-66-01 HEATER PLUG

(N/C)

CUSTOMER PAY ENVI/HAZ/WAS/DIS FOR REPAIR ORDER

DESCRIPTION	TOTALS
LABOR AMOUNT	699.00
PARTS AMOUNT	500.62
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES /	25.00
TOTAL CHARGES	1224.62
LESS AMOUNT	580.02
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	644.60

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
WHITE	11	MISCELLANEOUS OTHER	WD3PE7CC3B5609162	184	54410/54410	T9162	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN12 DD			12:00 30OCT14	?	0.00	CASH	13OCT14
R.O. OPENED		READY	OPTIONS: DLR:VHMD ENG:64289841195064				

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A TROUBLESHOOT CHECK ENGINE LIGHT - CHECK AND ADVISE

101-0000T TROUBLESHOOT FOR ENGINE PROBLEMS

10324 CPTS

1 906-470-05-53 HEATING UNIT

C-Q

1 BTG/544948 DEF 2.5 GAL BOTTLE

1 GE/194NA LAMP MINI

PARTS: 1071.98 LABOR: 598.50 OTHER: 0.00 TOTAL LINE A:

54410 10324// HOOKED UP SDS AND HAS CURRENT CODE IN SCR FOR HEATING
ELEMENT MALFUNCTION DPF TANK. CHECKED RESISTANCE AND NEEDS TO BE 1-2
OHMS AND IS AT 6.1 OHMS. NEEDS ELEMENT REPLACED. DRAINED DEF FROM TANK.
REMOVED TANK AND DISCONNECTED ELECTRICAL AND PLUMBING. REMOVED PUMP

N HEATER. INSTALLED NEW UNIT AND REINSTALLED PUMP. HOOKED UP
ELECTRICAL AND PLUMBING. INSTALLED TANK AND FILLED WITH DEF. HAD TO GET
ONE JUG FROM PARTS. ACTUATED PUMP AND CHECKED BUILD PRESSURE AND FLOW.
ACTIVATED TANK HEATER AND LINE HEATER. CHECKED VALUES OF TANK FILL
LEVEL AND REFILLED TO 16.5. CHECKED FOR CODES AND ALL ARE STORED.
CLEARED CODES AND PERFORMED ROAD TEST. BROUGHT BACK TO SHOP AND SAW
THAT RIGHT FRONT RUNNING LAMP WAS OUT. GOT NEW BULB FROM PARS AND
INSTALLED.

B FREIGHT

99 GENERAL OP

1 CPTS

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B

SHOP SUPPLIES

PAID CC
RECD 1742.30
BY 

DESCRIPTION	TOTALS
LABOR AMOUNT	598.50
PARTS AMOUNT	1071.98
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	71.82
TOTAL CHARGES	1742.30
LESS INSURANCE	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	1742.30

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
147/White	11	MERCEDES-BENZ TRUCK	WD3PE7CC3B5609162	184	127017/127034	T866P	
N SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
6JUL13 DD		14DEC2014	17:00 17NOV16			CASH	15NOV16
R.O. OPENED		READY		OPTIONS: SOLD-STK:SP1570 DLR:45105			

5:57 10NOV16 07:54 15NOV16

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

CUSTOMER STATES: BELT CAME OFF
S00 TENSION-ER BROKEN

85556 CPSP

1 642-200-26-70 BELT TENSIONER

1 000912-008210 SCREW

1 001-993-37-96 V-BELT

1 910105-008012 SREW

127034 BELT TENSIONER REPLACED BELT TENSIONER, BELT AND HARDWARE.

CHECKED BELT TRACKING, OK.

DESCRIPTION	TOTALS
LABOR AMOUNT	300.00
PARTS AMOUNT	171.16
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	471.16
LESS AMOUNT	0.00
SALES TAX	-16.00
PLEASE PAY THIS AMOUNT	487.16

DATE:

NOVEMBER 04, 2017

ACCT. NO:

P.O. NO:

CAMAMB

VIN WD3PE7CC3B5609162

SALESPERSON	TYPE	YEAR	MAKE	MODEL	LICENSE	MILEAGE	TIME PROMISED			
T.H.		2011	MERCEDES	SPRINTER 250 184 MO		157,387	11/03/2017			
QTY.	STOCK NO.	DESCRIPTION			TC	SLS	LABOR	FET	PRICE	TOTAL
1	N1030391811B	BRAKE PAD SENSOR								
1	PMD1317H	BRAKED PADS								
1		BRAKE LABOR								
1		SUPPLY CHARGES								

PARTS/FET TOTAL	85.14
SALES TAX	0.00
LABOR TOTAL	79.00
PLEASE PAY THIS AMOUNT	164.14
ON ACCT 164.14	
FOR OFFICE USE ONLY	
1315040	
AUDIT CONTROL NO.	

DATE: JUNE 29, 2016

ACCT. NO:

P.O. NO: CAMAMB

VIN WD3PE7CC3B5609162

SALESPERSON	TYPE	YEAR	MAKE	MODEL	LICENSE	MILEAGE	TIME PROMISED			
M.W.		2011	MERCEDES	SPRINTER 250	184 MO	110,392	06/29/2016			
QTY.	STOCK NO.	DESCRIPTION			TC	SLS	LABOR	FET	PRICE	TOTAL
1	PMD1316H	FRONT BRAKE PADS								
2	BWS084-1656	BRAKE WEAR SENSOR								
1	BL	BRAKE LABOR								
1		SUPPLY CHARGES								

PARTS/FET TOTAL	98.32
SALES TAX	0.00
LABOR TOTAL	79.00
PLEASE PAY THIS AMOUNT	177.32
ON ACCT 177.32	

FOR OFFICE USE ONLY

1317446

AUDIT CONTROL NO.