

Ship To: SAME AS BELOW

Invoice To:

Branch		
Date 07/27/17	Time 16:04:47 (O)	Page 01
Account No.	Phone No.	Invoice No.
Ship Via	Purchase Order	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C9041289	NO DESC	2269	531614844		
	T190 AIR				

REPAIR# 1 C 1138 NA 07/03/17 07/05/17

BOBCHECK & DIAGNOSIS

COMPLAINT:

-CHECK OVER

-THROWS DRIVEBELT

ADDITIONAL DESCRIPTION:

CAP: 154

START CODE: OPEN

ATTACHMENT: SBKT 042X

WARRANTY: EXPIRED FW 3/29/08

NO FIELD MODS

REPAIR# 2 C 1138 NA 07/11/17 07/11/17

REPLACE DRIVE BELT AND TENSIONER

COMPLAINT:

TENSIONER WILL NOT HOLD TENSION

CAUSE:

TENSIONER IS BAD

CORRECTION:

REMOVED OLD TENSIONER FROM MACHINE.

INSTALLED NEW TENSIONER AND DRIVE BELT AND ADJUSTED
CORRECTLY.

CHECKED FOR OPERATION/CHECK GOOD

ADDITIONAL DESCRIPTION:

TENSIONER WILL NOT HOLD TENSION

6735884 IDLER, BE 1

6736775 BELT, DRI 1

CONTINUED ON PAGE 02

X

Received By

Branch		
Date	Time	Page
07/27/17	16:04:47 (O)	02
Account No.	Phone No.	Invoice No.
Ship Via	Purchase Order	

Invoice To:

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C9041289	NO DESC	2269	531614844		
	T190 AIR				
				LABOR	
11100000			REPAIR TOTAL==>		

REPLACE ALTERNATOR BELT AND A/C BELT
COMPLAINT:
REPLACE ALTERNATOR BELT AND A/C BELT
CAUSE:
ALTERNATOR AND AC BELT NEED REPLACED
CORRECTION:
REPLACED ALTERNATOR BELT AND A/C BELT.
CHECKED FOR OPERATION/CHECK GOOD

59D4	NUT 5	1
6557291	SWIVEL	1
6726988	BELT	1
7100104	BELT, ALT	1

REPAIR

REMOVED THE OLD PANEL.

X

Received By _____

Branch		
Date	Time	Page
07/27/17	16:04:47 (O)	03
Account No.	Phone No.	Invoice No.
Ship Via		

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C9041289	NO DESC	2269	531614844		
	T190 AIR				
	INSTALLED NEW LEFT SIDE PANEL.				
	TESTED PANEL FOR OPERATION/TEST GOOD				
	<u>ADDITIONAL DESCRIPTION:</u>				
	REPLACE LEFT SIDE PANEL				
6689754REM	PANEL, INSTRUME		1		
11100000			REPAIR		

11100000 REPAIR

COMPLAINT:

X

Received By _____

Ship To: SAME AS BELOW

Branch		
Date	Time	Page
07/27/17	16:04:47 (O)	04
Account No.	Phone No.	Invoice No.
Ship Via	Purchase Order	

Invoice To:

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS
C9041289 NO DESC 2269 531614844

T190 AIR

REPLACE ENGINE MOUNTS AND HYDROSTATIC MOUNT BOLT

CAUSE:

ENGINE MOUNTS AND HYDROSTATIC MOUNT BOLT NEED REPLACED

CORRECTION:

WHEN REMOVING OLD ENGINE MOUNTS WE WERE ABLE TO FUTHER
INSPECT THE HYDROSTATIC MOUNT BOLT AND FOUND THAT IT WAS
BROKEN OFF IN THE EAR OF THE HYDROSTAT. TALKED TO TEAM
LEADER AND AGREED ON REMOVING THE ENGINE AND HYDROSTAT TO
BE ABLE TO DRILL AND EXTRACT THE BROKEN BOLT. ALSO ON
FUTHER INSPECTION FOUND THAT THE HYDROSTAT WAS LOOSE AT THE
BELL HOUSING AND NEEDED TO HAVE THE PULLEY REMOVED AND
BOLTS INSTALLED TO REPAIR THE ISSUE. AFTER ALL REPAIRS AND
REINSTALLATION OF ENGINE MOUNTS REPAIRS ARE GOOD.

ADDITIONAL DESCRIPTION:

REPLACE ENGINE MOUNTS AND HYDROSTATIC MOUNT BOLT

FRTO	FREIGHT	1
25E21	WASHER 5	1
43C852	BOLT	4 S
6652918	NUT	2
6661785	MOUNT, EN	4
6661787	WASHER	4 S
6675221	BOLT	1 N
6705106	WASHER 5	4
6727753	GASKET	1
7110276	SPACER, T	4 S
7113010	SPACER	1 N
7114739	SPACER	1 N
83D8	NUT 5	2 O

X

Received By

Ship To: SAME AS BELOW

Branch		
Date	Time	Page
07/27/17	16:04:47 (O)	05
Account No.	Phone No.	Invoice No.
Ship Via	Purchase Order	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C9041289	NO DESC	2269	531614844		
	T190 AIR				
11100000			REPAIR TOTAL==>		1200.71

REPAIR# 7 C 1138 NA 07/11/17 07/11/17

REBUILD STEERING AND PINTEL SHAFT SEALS

CORRECTION:

INSTALLED PINTEL SHAFT SEALS.

REBUILT STEERING AND ADJUSTED.

CHECKED FOR OPERATION AND LEAKS/CHECK GOOD

ADDITIONAL DESCRIPTION:

MACHINE CREEPS IN A CIRCLE.

FRTO	FREIGHT	1
17C680	BOLT	1
25E24	WASHER	1 N
6563914	WASHER	1
6660814	RING, QUA	2
6678226	SEAL, OIL	2
	THIS PART IS NONRETURNABLE.	
6685060	BUSHING,	4
6687913	SEAL	2
6701535	SPRING, C	1 S
6702716	BLOCK, WE	2
6706098	GUIDE, PR	2
6711643	CAM, WEAR	4
6715163	BUSHING,	3
6715164	SLEEVE, S	1
6737388	WASHER	8 S
6903117	FLUID, OI	1

11100000 REPAIR

CONTINUED ON PAGE 06

X

Received By

Ship To: SAME AS BELOW

Date	Time	Page
07/27/17	16:04:47 (O)	06
Ship Via	Purchase Order	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C9041289	NO DESC	2269	531614844		
	T190 AIR				

REPAIR# 8 C 1138 NA 07/11/17 07/11/17

FLUSH COOLANT SYSTEM

CORRECTION:

FLUSHED OLD COOLANT AND FILLED WITH NEW.

ADDITIONAL DESCRIPTION:

COOLANT IS VERY LOW AND OUT OF PROTECTIVE RANGE

6983128 ANTI-FREE 3

11100000 REPAIR

REPAIR# 9 C 1138 NA 07/11/17 07/11/17

REPAIR A/C SYSTEM

CORRECTION:

DID A COMPLETE VACUUM AND RECOVERY ON A/C SYSTEM AND CHARGE.

TESTED/TEST GOOD

ADDITIONAL DESCRIPTION:

WONT KNOW WHAT IS WRONG WITH A/C SYSTEM UNTIL THE BELT IS
INSTALLED. COULD JUST NEED A BELT OR MIGHT NEED OTHER WORK.

BLOWER IS WORKING. CAB FILTERS ARE VERY DIRTY. 2 HOURS TO
TROUBLE SHOOT.

6677983 FILTER, A 1

6678207 FILTER, A 1

11100000 REPAIR

REPAIR# 10 C 1138 NA 07/03/17 07/05/17

REPLACE POWER BOB-TACH VALVE

CONTINUED ON PAGE 07

X

Received By

Ship To: SAME AS BELOW

Invoice To:

Branch		
Date 07/27/17	Time 16:04:47 (O)	Page 07
Account No.	Phone No.	Invoice No.
Ship Via		Purchase Order

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C9041289	NO DESC	2269	531614844		
	T190 AIR				

CORRECTION:

THIS PART WAS REPLACED AFTER MY LEAD TECH CHRIS TALKED WITH
MIKE TERRY ON THE OPERATION OF THE BOBTACH AND SAFTEY
CONCERNS. MIKE APPROVED INSTALLATION OF VALVE.
INSTALLED AND CHECK FOR OPERATION/CHECK GOOD

AS2119	TIE-LOK TIE	2
A3900	CLOTH SLEEVE .9	10
	CLOTH SLEEVE .90 ID	
H28006	3/8" HOSE	14
06Z-506	FITTING	1
06Z-606	FITTING	1
06Z-666	HOSE END	1
06Z-686	HOSE END	1
55K214	O-RING	1
7161786	VALVE, PO	1

11100000 REPAIR

***** WORK ORDER TOTALS *****

PARTS

LABOR

SUB TOTAL==>

Valley Park 8.113%

ON ACCOUNT

277

\$7498.03

X

Received By