Invoice To Account No:	Deliver To:		SERVICE INVOICE			
CROP PRODUCTION SERVICES-PATOKA	CROP PRODUCTION SERVICES (PATOKA)		Invoice Number: Invoice Date:	1257432 6/20/2016		
			Page:	1 of 5		
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:		
2010 JOHN DEERE 4930	3966	1N04930XPA0013342	866762	27C 12		

+4940 Service work Retail

COMPLAINT:

Customer complaining of a vibration coming through the cab floor when driving down the road

The customer was quoted and accepted the following quote to perform these repairs:

Labor - \$1 Parts - \$4

Trucking -

Total - \$53,447.06

CORRECTION:

COPY

CONTINUED ON NEXT PAGE->

Invoice To Account No:	Deliver To:		SERVICE INVOICE		
CROP PRODUCTION SERVICES-PATOKA	CROP PRODUCTION	ON SERVICES (PATOKA)	Invoice Number: Invoice Date;	1257432 6/20/2016	
			Page:	2 of 5	
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:	
2010 JOHN DEERE 4930	3966	1N04930XPA0013342	866762		

+4940 Service work Retail

- •Technician was sent to the customers at their request to address the vibration complaint.
- It was found that the vibration was coming from internally in the hydrostatic transmission.
- •The sprayer was hauled to the Ashmore shop where the issue could be addressed.
- After driving the machine, the technician pulled it into the shop and removed the hydro filters.
- •It was found that there was an excessive amount of foreign material in the filters. (Shavings)
- •The hydraulic oil was drained and the hydraulic oil reservoir removed for further inspection.
- •After further inspection of the reservoir it was found to contain an excessive amount of foreign matter. This would primarily be metal shavings and filings.
- •An estimate of repair was composed to do a complete hydrostatic replacement according to John Deere's recommendations and submitted to the customer for approval.
- After the approval was received from the customer, repairs were started.
- •The hydrostatic pumps were R&R with remanufactured pumps.
- •The hydraulic drive motors were removed and replaced with remanufactured motors.
- •The auxiliary hydraulic pump was removed and replaced with a remanufactured hydraulic pump.
- •The oil cooler was removed and replaced with new because of the inability to flush it clean.
- •All removed hydraulic lines were completely flushed with special foam bullets and brake clean several times to ensure they were clean inside.
- •The hydraulic tank was removed, completely cleaned and re-installed.
- ·All lines, clamps and etc. were re-installed and all fasteners were torqued to specs.
- •The hydraulic system was filled completely with 212 new quarts of Turf Gard 10W30 oil.
- •The drive hubs were drained and filled with new 80W140 Synthetic gear lube.
- •The machine was jacked up and put on stands so the wheel motors could be ran and all of the air purged out of the drive hoses per John Deere's repair procedure.
- ·Finally the sprayer was road tested extensively to ensure there were no leaks and that the noise complaint was gone.
- ·All functions were found normal and the noise was gone. No leaks were visible.
- ·The machine was returned to the customer.

Part Number 11M7083	Description COTTER PIN	Quantity 1.00
14M7277	NUT	2.00
19H2898	CAP SCREW	2.00
19M7866	SCREW	4.00
19M9354	CAP SCREW	1.00

COPY

CONTINUED ON NEXT PAGE>

Invoice To Account No:	Deliver '	To•		SEF	RVICE INVOICE
CROP PRODUCTION SERVIO			ON SERVICES (PATOKA)	Invoice Number: Invoice Date:	1257432 6/20/2016
Make/Model:	· ·	Meter:	Serial Number:	Eq ID:	Fleel No:
2010 JOHN DEERE 4930		3966	1N04930XPA0013342	866762	
+4940 Service work Retail 24H1307	WASHER		11.00 6.00		
24H1864	WASHER		4.00		
24M7349	WASHER		7.00		
37M7514	O-RING		4.00		
51M7044	HYDRAULIC FILTE		2.00		
AH128449	HOSE CLAMP		3.00		
AN205159	HYDRAULIC FILTE		2.00		
AN207368	STRAINER		2.00		
AN207571 AN207572	FILTER		1.00		
AN207572 AN209966	CONTROL VALV		1.00		
H77698	TIE BAND		30.00		
L168271	HANDLE		1.00		
N207955	LOCK NUT		2.00		
N304330	O-RING		4.00		
N305662	WASHER		1.00		
PG200722	Hydraulic Pump Reman		1.00		
PG200884	Hydraulic Pump Reman		1.00		
PG200885	Hydraulic Motor Reman		2.00		
PG204032	Hydraulic Motor Reman		2.00		
R10093	O-RING		2.00		
R115742	SEAL		1.00		
R259461	LATCH		1.00		



CONTINUED ON NEXT PAGE>

SERVICE INVOICE Deliver To: Invoice To Account No: 1257432 CROP PRODUCTION SERVICES (PATOKA) Invoice Number: CROP PRODUCTION SERVICES-PATOKA 6/20/2016 Invoice Date: Fleet No: Eq ID: Serial Number: Meler: Make/Model: 1N04930XPA0013342 866762 3966 2010 JOHN DEERE 4930 +4940 Service work Retall 1.00 O-RING R26375 1.00 OIL COOLER RE242252 2.00 **O-RING** T42302 24.00 O-RING T77613 21.00 O-RING T78313 200.00 Quart Turf-Gard 10w30 SN/GF5 TY22075Q 3.00 17D Turf-Gard 10W30 2.5 gal (GF-5/SN) TY22076 16.00 12D 80W140 Synthelic gear lube ql. TY28372 Quantity 1.00 Description SEMI TRUCKING 2.00 FREIGHT FREIGHT

Invoice To Account No:	o Account No: Deliver To:			SERVICE INVO				
CROP PRODUCTION SERVICES	-PATOKA	CROP P	RODUCTION	SERVICES (F	PATOKA)	Invoice Nu		1257432 6/20/2016
Make/Model:			Meter:	Serial Numb	er:	Eq ID:	Fle	eet No:
2010 JOHN DEERE 4930	1984		3966	1N04930XP/	A0013342	866762		
+4940 Service work Retail SERVCALL	SERVICE C		OL&M:	\$0.00	Misc	; \$707.90	Sub-Total:	\$53,622.56
Labor: \$10,176.00			882.85 DISCO	UNT				
			79				Labor: Parts:	\$10,176.00 \$42,738.66
Customer PO No: Tax Exempt No: GET CA							OL&M: Misc: Sales Tax:	\$0.00 \$707.90 \$0.00
Advisor: WARK							Grand Total:	\$53,622.56

* * * DOCUMENT COPY * * *