

Year 2001 Make MACK Model VISION CX Color WHITE Trim STD
 Unit Number License Plate # YBC2053 Mileage 514,093 Serial#/VIN# 1M1AE06Y31W009275

Sup	Seq	Labor Type	Labor Op	Description	Part Type	Part Number	Dollar Amount	Labor Units
	1	Frame	Repair	HANG GUAGES TO CHECK FRAME	Exist			
	2	Frame	Repair	FRAME TWIST	Exist			
	3	Frame	Rem/Rep	REAR X-MEMBER TRUNION	New		\$1,050.48T	
	4	Frame	Rem/Rep	2ND REAR X-MEMBER	New		\$340.87T	
	5	Frame	Rem/Rep	TORQUE ARMS R-L @ 241.63 EA	New		\$483.26T	
	6	Mech	Rem/Rep	4 SHOCKS @ 64.41 EA	New		\$257.64T	
	7			Betterment: Parts Only			25.00%	
	8	Mech	Rem/Rep	3 AIR BAGS @ 225.00 EA	New		\$675.00T	

Sup	Seq	Labor Type	Labor Op	Description	Part Type	Part Number	Dollar Amount	Labor Units
	9			Betterment Parts Only				
	10			4TH AIR BAG IS OMMITTED AS THE CAUSE OF THIS LOSS THEREFORE NOT COVERED (\$225.00)				
	11	Mech	Rem/Rep	AIR RIDE LEVELING VALVE	New			
	12	Mech	Rem/Rep	FAN SHROUD	New			
	13	Mech	Rem/Rep	FAN BLADE	New			
	14	Mech	Rem/Rep	HOOD STRAPS X2 @ 49.00 EA	New			
	15	Mech	Rem/Rep	RIGHT HOOD LATCH	New			
	16	Mech	Rem/Rep	LEFT HOOD LATCH	New			
	17	Mech	Rem/Rep	REAR PINTEL HOOK MOUNT	New			
	18	Frame	Rem/Rep	FRAME SPRING HANGER BRKTS R-L @ 106.57 EA	New			
	19	Mech	Rem/Rep	SCRIBE & SET REAR AXLE TRAC	New			
	20	Frame	Repair	FULL AXLE ALIGNMENT	Exist			
	21	Frame	Repair	CHECK STEERING, FRONT AXLE CONFIGURATION	Exist			
	22	Mech	Rem/Ins	DUMP BODY	Exist			
	23	Mech	Rem/Rep	4 STAGE LIFT CYLINDER OPEN	Remanuf actured			
	24			CORE IS DAMAGED CORE CHARGE IS OPEN SUBJECT TO INVOICE				
	25	Mech	Rem/Rep	LOWER CYLINDER PIN	New			
	26	Mech	Rem/Rep	UPPER CYLINDER PIN	New			
	27	Frame	Repair	CYLINDER HOUSE	Exist			
	28	Frame	Repair	LT UPPER SIDE RAIL BOX	Exist			
	29	Frame	Rem/Rep	LT REAR BOX POST	New			
	30	Frame	Repair	BOX TWIST & SQUARE	Exist			
	31	Frame	Repair	ALIGN REAR GATE	Exist			
	32	Ref	Ref	BOX SIDE LT	Exist			
	33	Body	Rem/Rep	TOWING	New			
	34			PRICE AS QUOTED FROM PULVER TOWING FOR EACH PIECE NO MARK-UP				

2001 MACK VISION CX

03

04 COUNTY RD 15 SW

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A				REPAIR WHY THROW BEARING BAD ON CLUTCH			
	99			REPLACED CLUTCH AND TRANNY ALSO PTO			
		345	CAA				
		575	CAA				
		369	CAA				

1 SP/108935-61MO CLTCH 2IN 10 SPLNE EP 15.5IN
2DISC REMAN
CORE CHARGE C
CHI PDC ONE DAY STOCK ORDER
1 FUL/4305294 GASKET
IN STOCK
1 SP/127760 BRAKE-CLUTCH BRAKE DISC ASSEMBLY
IN STOCK
1 MTPFRO15210CP FULLER HD FRO15210CP TR
CORE CHARGE C
1 BOLT-ASM-XL FRAME BOLTS
1 6306SRV BRG
1 20MKM801 STUD KIT 8-BOLT
1 FUL/K2918 SEAL - REAR BEARING COVER. MAIN
SHAFT
2 BD-07481 3M SURF COND DISC, ROLOC
1 FUL/4308226 GASKET-HOUSING.CLUTCH
-1 MTPFRO15210CP CORE RETURN
4 BD-500020 LOGO FLT WSHRS 3/4 SAE 2
1 13M35151 GASKET
1 BOLT-ASM-M MEDIUM BOLT ASSY
5 PHM/8-43147 TIE STRAP-14.5IN.BLACK.NYLON.50
.100/EAG
2 TDA/KT17SB STRAP & BOLT KIT FOR EASY SERVICE
YOKE
4 BD-36728 BOWMALLEY LOCK WASHER 7/
4 BD-44483 MET 10.9 HX HD CAP SCR M
4 BD-42465 MET UNHARDENED FLAT WASH

CUSTOMER COPY

#: 16649

ESTER ASPHALT INC

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
	01	MACK CH-613	1M1AE06Y31W009275		559143/559143	T9275
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
06JUL11 DE			23:00 30DEC16	03	0.00	AR
R.O. OPENED	READY	OPTIONS:				
01DEC16	22DEC16					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

1	SMC/KV2L11-36S	ELBOW-90 3/8	NYL				
1	489XFAHX-V3XK	PTO ASM 8 BOLT 2	GEAR				
1	FRT	FREIGHT					
1	SMC/KV2L07-34S	ELBOW - 90 1/4	NYL				
2	BD-D39079	GR.8HXCAPSCREW7/16-14X1					
4	BD-500016	LOGO FLT WSHRS 7/16	SAE				
2	BD-BOW36783	BOWMA-GRIP ALL METAL	LOCK				
-1	SP/108935-61MO	CORE RETURN					
35	OIL-14	SPIRAX GSX50					

SUBL TURN FLYWHEEL PO#70343

CSUB

REMOVED DRAIN PLUG FROM TRANS. THERE WAS ONLY MAYBE 2 CUPS OF OIL THAT CAME OUT. PTO BEARINGS ARE ALSO BAD FROM BEING RUN OUT OF OIL. REMOVED DRIVE SHAFT. REMOVED PTO PUMP. REMOVED PTO. LOOKING UP THROUGH PTO INSPECTION HOLE. THERE IS SEVERE TOOTH DAMAGE. REMOVED COOLER LINES. REMOVED FLOOR FROM CAB. REMOVED THE SHIFT TOWER. SUPPORTED THE REAR OF ENGINE. SUPPORTED TRANS. REMOVED MOTOR MOUNT BOLTS. REMOVED BELL HOUSING BOLTS. REMOVED TRANS FROM TRUCK. REMOVED CLUTCH AND FLYWHEEL. HAD FLYWHEEL SENT OUT FOR RESURFACING. SWAPPED OVER THE BELL HOUSING, SPEED SENSOR HOUSING, AND REVERSE SWITCH. INSTALLED FLYWHEEL AND CLUTCH. INSTALLED THE TRANS. INSTALLED THE FLYWHEEL AND MOTOR MOUNT BOLTS. REMOVED SUPPORTS FROM ENGINE AND TRANS. TIGHTENED THE MOTOR MOUNT BOLTS AT THIS TIME. HOOKED UP HARNESS FOR SPEED SENSOR AND REVERSE SWITCH. INSTALLED SHIFT TOWER AND FLOOR IN CAB. REMOVED PTO COVER AND INSTALLED STUDS FOR NEW PTO. WAITING ON PTO. INSTALL PTO AND ADJUST GEAR LASH. INSTALL HYDRAULIC PUMP. INSTALL FUEL CROSS OVER TUBE. INSTALL DRIVE SHAFT. FILL TRANSMISSION WITH 50 WT. ADJUST CLUTCH. TAKE ON TEST DRIVE. EVERYTHING IS SHIFTING PROPERLY. CHECK PTO OPERATION. THAT IS ALSO WORKING PROPERLY. HELP KIETH STICK THE TRANS, 369- HELPED KEITH TIGHTEN MOTOR MOUNTS. 345 THERE IS EXHAUST LEAK ON CYL #2 AND #3

CUSTOMER PAY SHOP MATERIALS FOR REPAIR ORDER

TOTALS

#: 16649

WESTER ASPHALT INC

001	01	MACK CH-613	1M1AE06Y31W009275				
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
06JUL11			23:00 30DEC16	03	0.00	AR	22DEC16
R.O. OPENED		READY	OPTIONS:				
01DEC16		22DEC16					
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL

PLEASE REMIT PAYMENT TO:

P.O. BOX 182
ALBERT LEA, MN 56007-0182
PLEASE TELL US HOW WE'RE DOING AT
WWW.SYVERSONTRUCK.COM

DESCRIPTION	TOTALS
LABOR AMOUNT	1805.00
PARTS AMOUNT	5163.50
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	75.00
MISC. CHARGES	171.48
TOTAL CHARGES	7214.98
LESS ADJUSTMENTS	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	7214.98

CUSTOMER COPY