
	+2118
Invoice	
Sale Type	3
Date	07/02/2018 7:35 AM
Ship Via	DELIVER
PO Number	

	C . t Account	Ordered By	Special Instructions
Counter #	Customer Account	Ordered by	
	1761618		

				M	Ilmi d	Tax	List	Net	Extended
Qty	Line	Item Number	Description	Warr	Unit	lax	LIST		
1	ВВ	MKD1066	SEMI-MET PAD	LT.	ST	T1			
		2006 Ford F-4:	50 Super Duty						
1	BBR	680374RGS	BRAKE ROTOR	2Y	EA	11			
		2006 Ford F-4.	50 Super Duty						

4.450

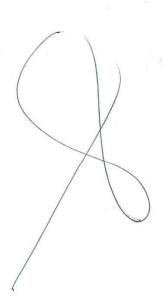

2 Items

Chip Used: N Verified By Not Verified

Sub-Total Sales Tax

X Customer Signature

Total 124.04

Date / Hour: 5/25/2018 11:57:45AM

Repair Order: Customer: Branch:

Total Invoice: \$ 4,796.00

Customer P/O:

Orig R/O: 0

Completion Date:

5/25/2018

Key Tag Number:

Unit Number:

Model Year: 2005

Make/Model: Ford F450

Type: Light Duty

VIN: 1FDXW47P96EA27809

Meter: 144848 Miles

Task: 1

DIAG-T/TEST & INSPECT - Truck/Trailer

Department: Service

Complaint: TEST AND INSPECT TRUCK- HAS NEW FUEL LINES- WILL RUN FOR A FEW MINUTES AND SLOWLY LOSE POWER AND DIE

TEST AND INSPECT SYSTEM-IDENTIFY CONCERN

NOTE: CONCERN MAY HAVE MORE THAN ONE(1) CAUSE

Correction: 5/4/2018 1:58:51 PM 847 scanned truck and found codes

p0263 - cylinder 1 contribution / balance fault

p0269 - cylinder 3 contridution / balance fault p0284 - cylinder 8 contribution / ba;ance fault

p0300 - random misfire detected

p0303 - cylinder 3 misfire detected p0460 - fuel level sensor circuit fault

p0463 - fuel level sensor high input p0500 - water in fuel condition

p2291 - injector control pressure too low - engine cranking

p2614 - cmp signal output circuit/open

p2617 - ckp signal output circuit/open.

cleared all codes and started truck, drove truck around shop lot, truck has no power.

removed both fuel filters, the filter on driver frame fail had debree in it, removed fuel drain plug from fuel pump, filter housing on frame, there is rust

and silver flakes in filter housing.

looks like fuel tank linning material.

recomend removing fuel tank and fuel pump/filter housing and cleaning, replacing both filters

Extended Price

Supp. Part Description / Ref Number

Quantity U/M

Parts:

Task 1 Subtotals

Labor Task 1 Subtotals

\$110.88

22 Task: 2

MISC TRUCK REPAIR

Department: Service

Complaint: REPLACE FUEL FILTERS

Correction: REPLACED FUEL FILTERS- CLOGGED WITH DEBRIS-

Extended

Supp. Part

Description / Ref Number

U/M

Quantity

Price Price

BALDWPF7812 KIT

EA

1.0

SET OF 2 MICROLITE FUEL ELEM

Task 2 Subtotals

Parts: Labor:

Task 2 Subtotals

\$112.95

Date / Hour: 5/25/2018 11:57:45AM

Repair Order: Customer: Branch:

Total Invoice: \$ 4,796.00

Custom	er P/0	D:		Orig	R/O: 0 C	Completion Date: 5/2	5/2018
Task:	3	22	MISC TRUCK REPAIR		Depa	rtment: Service	Ü
10.5	tion:	BLOW OUT A 5/7/2018 10:33 blew out all fu- truck ran good	EL PUMP AND FILTER HOUSING - CLEAN AND REINSTALL LINE BETWEEN HOUSINGS OF FUEL SYSTEM 3:12 AM 847 removed fuel pump/filter housing, disasembled el lines from tank to fuel filter on engine. If for 5 miniutes and lost power and died, fuel pump is working ag time to check fuel system	housing and found alot		debrie in housing.	
		nood more are		U/M	Quantity	Price	Extended
010000000000000000000000000000000000000	Part	JPPL	Description / Ref Number SHOP SUPPLIES	- UNVI	1.0	, ,,,,,,	1 110
	01100	JIIL	This could be a second of the	sk 3 Subtotals	Parts:		
					Labor:		
		×			Miscellaneous:		
					Task 3 Subtotals		\$133.45
ask:	4	22	MISC TRUCK REPAIR		Dona	artment: Service	
	uon.	engine still we still no codes watched data should never	on scanner while cranking engine, the injector pressure regul reach 85.	ator is maxing out at 85	pecent and should	d only be around 25-3	30 pecent
	zuon.	engine still we still no codes watched data should never can not perfo recomend rep	ould not start, on scanner while cranking engine, the injector pressure regul reach 85. rm cylinder contribution test because engine will not run long a blacing the ipr sensor and recheck system, if ipr does not fix prodes when truck was first scanned. d injectors	ator is maxing out at 85 enough oblem recomend replac	pecent and should	d only be around 25-3	30 pecent ontribution
	Part	engine still we still no codes watched data should never can not perfor recomend rep and misfire counted ipr an quoted ipr an quoted ipr an	ould not start, on scanner while cranking engine, the injector pressure regul reach 85. reach 85. rm cylinder contribution test because engine will not run long a blacing the ipr sensor and recheck system, if ipr does not fix prodes when truck was first scanned. d injectors d injectors. Description / Ref Number	ator is maxing out at 85	pecent and should cing injectors becau	d only be around 25-3	30 pecent, ontribution
	Part	engine still we still no codes watched data should never can not perfor recomend rep and misfire counted ipr an quoted ipr an quoted ipr an	ould not start, I on scanner while cranking engine, the injector pressure regul reach 85. I'm cylinder contribution test because engine will not run long oblacing the ipr sensor and recheck system, if ipr does not fix prodes when truck was first scanned. I d injectors id injectors. Description / Ref Number SHOP SUPPLIES	ator is maxing out at 85 enough oblem recomend replac	pecent and should	d only be around 25-3 use of the cylinder co	30 pecent ontribution
	Part	engine still we still no codes watched data should never can not perfor recomend rep and misfire counted ipr an quoted ipr an quoted ipr an	ould not start, I on scanner while cranking engine, the injector pressure regul reach 85. I'm cylinder contribution test because engine will not run long oblacing the ipr sensor and recheck system, if ipr does not fix prodes when truck was first scanned. I d injectors id injectors. Description / Ref Number SHOP SUPPLIES	ator is maxing out at 85 enough oblem recomend replac U/M	pecent and should bring injectors because Quantity 1.0	d only be around 25-3 use of the cylinder co	30 pecent ontribution
	Part	engine still we still no codes watched data should never can not perfor recomend rep and misfire counted ipr an quoted ipr an quoted ipr an	ould not start, I on scanner while cranking engine, the injector pressure regul reach 85. I'm cylinder contribution test because engine will not run long oblacing the ipr sensor and recheck system, if ipr does not fix prodes when truck was first scanned. I d injectors id injectors. Description / Ref Number SHOP SUPPLIES	ator is maxing out at 85 enough oblem recomend replac U/M	pecent and should bring injectors because Quantity 1.0 Parts:	d only be around 25-3 use of the cylinder co	30 pecent ontribution
	Part	engine still we still no codes watched data should never can not perfor recomend rep and misfire counted ipr an quoted ipr an quoted ipr an	ould not start, I on scanner while cranking engine, the injector pressure regul reach 85. I'm cylinder contribution test because engine will not run long oblacing the ipr sensor and recheck system, if ipr does not fix prodes when truck was first scanned. I d injectors id injectors. Description / Ref Number SHOP SUPPLIES	ator is maxing out at 85 enough oblem recomend replac U/M	Quantity 1.0 Parts: Labor:	d only be around 25-3 use of the cylinder co	30 pecent ontribution
Supp.	Part SHS	engine still we still no codes watched data should never can not perfor recomend rep and misfire counted ipr an quoted ipr an quoted ipr an	ould not start, n on scanner while cranking engine, the injector pressure regul reach 85. rm cylinder contribution test because engine will not run long a clacing the ipr sensor and recheck system, if ipr does not fix prodes when truck was first scanned. d injectors d injectors. Description / Ref Number SHOP SUPPLIES To	ator is maxing out at 85 enough oblem recomend replac U/M	Quantity 1.0 Parts: Labor: Miscellaneous: Task 4 Subtotals	d only be around 25-3 use of the cylinder co	entribution Extende Pri
Supp.	Part SHS	engine still we still no codes watched data should never can not perforecomend repand misfire counted ipr an quoted ipr an quoted ipr an quoted ipr an an accordance of the still was a still we still with the still was a st	ould not start, n on scanner while cranking engine, the injector pressure regul reach 85. rm cylinder contribution test because engine will not run long a clacing the ipr sensor and recheck system, if ipr does not fix prodes when truck was first scanned. d injectors d injectors. Description / Ref Number SHOP SUPPLIES Ti	ator is maxing out at 85 enough oblem recomend replac U/M	Quantity 1.0 Parts: Labor: Miscellaneous: Task 4 Subtotals	Price	e Extende
ũupp. Task:	Part SHS	engine still we still no codes watched data should never can not perforecomend repand misfire of quoted ipr an Quo	ould not start, n on scanner while cranking engine, the injector pressure regul reach 85. rm cylinder contribution test because engine will not run long a clacing the ipr sensor and recheck system, if ipr does not fix prodes when truck was first scanned. d injectors d injectors. Description / Ref Number SHOP SUPPLIES Ti	ator is maxing out at 85 enough oblem recomend replac U/M	Quantity 1.0 Parts: Labor: Miscellaneous: Task 4 Subtotals	d only be around 25-3 use of the cylinder co	so pecent, entribution Extende Prid \$133.45 e Extende
Supp. Task:	Part SHS	engine still we still no codes watched data should never can not perforecomend repand misfire of quoted ipr an Quo	pould not start. I on scanner while cranking engine, the injector pressure regul reach 85. Irm cylinder contribution test because engine will not run long to placing the ipr sensor and recheck system, if ipr does not fix proodes when truck was first scanned. Id injectors id injectors. Description / Ref Number SHOP SUPPLIES Description / Ref Number SHOP SUPPLIES	ator is maxing out at 85 enough. roblem recomend replace U/M ask 4 Subtotals	Quantity 1.0 Parts: Labor: Miscellaneous: Task 4 Subtotals Dep Quantity 1.0	Price	antribution Extende Prio \$133.45
Supp.	Part SHS	engine still we still no codes watched data should never can not perforecomend repand misfire or quoted ipr an quoted ipr an UPPL	pould not start. I on scanner while cranking engine, the injector pressure regul reach 85. Irm cylinder contribution test because engine will not run long to placing the ipr sensor and recheck system, if ipr does not fix proodes when truck was first scanned. Id injectors id injectors. Description / Ref Number SHOP SUPPLIES Description / Ref Number SHOP SUPPLIES	ator is maxing out at 85 enough. roblem recomend replace U/M ask 4 Subtotals	Quantity 1.0 Parts: Labor: Miscellaneous: Task 4 Subtotals Dep Quantity 1.0 Parts	Price Price Price	e Extende
Supp.	Part SHS	engine still we still no codes watched data should never can not perforecomend repand misfire or quoted ipr an quoted ipr an UPPL	pould not start. I on scanner while cranking engine, the injector pressure regul reach 85. Irm cylinder contribution test because engine will not run long to placing the ipr sensor and recheck system, if ipr does not fix proodes when truck was first scanned. Id injectors id injectors. Description / Ref Number SHOP SUPPLIES Description / Ref Number SHOP SUPPLIES	ator is maxing out at 85 enough. roblem recomend replace U/M ask 4 Subtotals	Quantity 1.0 Parts: Labor: Miscellaneous: Task 4 Subtotals Dep Quantity 1.0	Price Price Price	Extender Pr \$133.45

Date / Hour: 5/25/2018 11:57:45AM

Repair Order: Customer: Branch:

Total Invoice: \$ 4,796.00

Customer P/O:

Orig R/O: 0

Completion Date: 5/25/2018

22 Task: 6

MISC TRUCK REPAIR

Department: Service

Complaint: REPLACE IPR VALVE

Correction: 5/22/2018 3:21:21 PM 847 replaced injector pressure regulator, truck will still not start

old ipr had debree in screen, same debree that was in the fuel pump/filter housing.

ipr is reading properly on scanner now, it is not reading max 85 percent now, when cranking engine is reads between 33% and 55% duty, it is no

longer compensating. no codes at this time. recomend replacing injectors,

Supp. Part MISCVIBWD 24137 Description / Ref Number

Quantity LIM EA

Extended Price Price

INJECTOR PRESSURE REG

Task 6 Subtotals

Parts:

Labor:

Task 6 Subtotals

\$509.15

Task: 7 22 MISC TRUCK REPAIR

Department: Service

Complaint: REPLACE ALL INJECTORS- CUPS- VALVE COVER GASKET

Correction: 5/25/2018 8:08:03 AM 847 replaced all 8 injectors and valve cover gaskets.

number 2,7 and 8 injectors had bad sealling orings, all other injector orings were flattended down not sealing properly.

passenger side valve cover was missing 2 bolts, replaced missing bolts.

test drove after repair and truck is running properly

after truck sits for awile is takes a few seconds to build oil pressure, so it cranks for a few seconds before starting, may have low oil pressure. Extended

Supp. Part	Description / Ref Number	U/M	Quantity	Price	Price
Supp. Part SHSUPPL	SHOP SUPPLIES		1.0		
MISCVN212337	INJECTOR SEAL KIT	EA	8.0		
MISCVIVS50691R	VALVE COVER GASKET SET	EA	1.0		
MISCVNV300311X MISCVNW302766A	VALVE COVER BOLT	EA	2.0		
MISCVN212337	INJECTOR SEAL KIT	EA	-8.0		
	INJECTOR CORE	EA	8.0		
MISCVN67528-C	REMAN INJECTOR	EA	8.0		
MISCVNEX636692	INJECTOR CORE	EA	-8.0		
MISCVN67528-C	4.4 (4.4 (4.4 (4.4 (4.4 (4.4 (4.4 (4.4	Subtotals	Parts:		
			Labor:		
			Missellonopus		

Miscellaneous:

Task 7 Subtotals

\$3,409.77

OIL CHG-CAFCHANGE OIL&FILTER, LUBRICATE CHASSIS

Department: Service

Complaint: CHANGE OIL AND FILTER. LUBRICATE CHASSIS. Correction: 5/25/2018 8:05:29 AM 847 changed engine oil and filter. oil is at proper level

Supp. Part LI/M

Extended

Description / Ref Number


Quantity

Price Price

Date / Hour: 5/25/2018 11:57:45AM

Repair Order: Customer: Branch:

Total Invoice: \$4,796.00

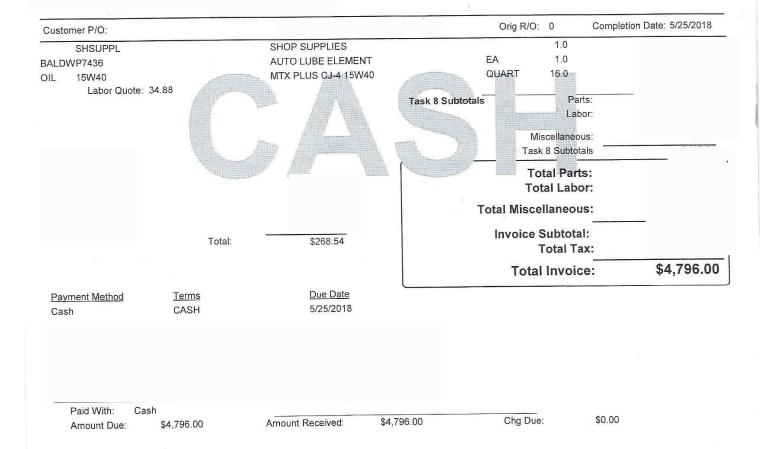

Customer Signature: Customer Print:____

10/15	
A. Consideration	Invoice
Credit Sale	Sale Type
10/15/2017 1:20 PM	Date
	Ship Via
	PO Number

Countor #	Customer Account	Ordered By	Special Instructions
Counter #	customer necount		
7	×	•	

041	Line	Item Number	Description	Warr	Unit	Tax	List	Net	Extended
Qty	DTO	K52164-1SK	CLUTCH SET	LT	EA	T1			

2 Items

ASK VOUR Sales kep about hear house

Sub-Total
Sales Tax
Total

otal 646.80

WE APPRECIATE YOUR BUSINESS!

			NUMBER DATE 11 PO# SALES PERSON	/12/2017
BILL TO		SHIP TO		1, 1-== (1)
J		R		
TERMS VMC REFE	RENCE E100180269	SHIP VIA WILL	CALL BL#	EXTD
QTY B/O ITEM	М	DESCRIPTION	UNIT	PRICE
1 100F	/F81Z7B633EE 6EA27809	PEDAL – CLUTCH		
		104°C	on street for	
			NG CHARGE ON ALL RETURNED PARTS, URERS PACKAGING, FULLY ASSEMBLED	
			SUB TOTAL TAX BALANCE DUE	118.12