SERVICE INVOICE

STK#/FLEET#

HRS SN/EIN

WARRANTY DATE

HRS

Stump Cutter BB2800SP

Please visit us at

08/11/17 08/14/17

SEGMENT# 1 C ASHLK NA

Engine repair estimate

Chris 314-341-2852

Took apart the remote and replaced the two switches for the boom pivot and the up and down replaced the two switches and then put the remote back together and checked all

functions

ANT101	1 Gl. antifreez	2	
FT	FREIGHT	6	
GOE H200	2' CLAMP		N
GOE H212	2.5' CLAMP		N
GOE H234	2 3/4' CLAMP		N
GRGB212	CAP SCREW	4	N
GR900TH-R	900 SERIES TOOT	10	N
SLI24M	GRP 24 BATTERY	1	
SUBLETL	Remote Switches	1	
WAL 51025	FLEX CONNECTOR	1	N
118228001	HOSE-LOWER RADI	1	
151940001	FILTER - SAFETY	1	
151941001	FILTER - PRIMAR	1	
15340001	ELEMENT-FUEL FI	1	
161622001G	NEW ALT	1	
17390	BELT	1	N
3413002	CAT LONG BLOCK	1	N
57012	5.70-12 innertu	4	N
65945001	BEARING ASSY	2	
900-1902-42	SWING CYL BUSH	4	N
		CC	TTMC

CONTINUED ON PAGE 02

Received By

SERVICE INVOICE			
STK#/FLEET# Stump Cutter BB2800SP	HRS SN/EIN X 281110	WARRANTY DATE HRS	
900-1910-94 900-6910-85 900-9907-87	1-3/4 taper loc rain cap pocket	1 N 1 N 2 N	
11112010		SEGMENT TOTAL==>	14678.09

***** WORK ORDER TOTALS *****

PARTS

LABOR

SUBLET

SHOP SUPPLIES

SUB TOTAL ==>

CREDIT CARD SALE

15970.62

 Received Bv	

SERVICE INVOICE

STK#/FLEET#

HRS SN/EIN 880 281110

WARRANTY DATE

HRS

Stump Cutter BB2800SP

Please visit us at

SEGMENT# 1 C ASHLK 0000V

06/28/18 07/05/18

diag see list

CORRECTION:

Looked over. Checked hydraulic pressures and checked charge pressure--very low. Drained some oil out of the tank and found a lot of metal in the tank. Removed all the motors and the pumps and sent them out to be rebuilt. After receiving the pumps and the motors, reinstalled them then cleaned out all the main lines. Cleaned the hydraulic tank out. Filled with oil and primed the pumps before starting. Ran the machine to check for leaks and then tested the machine. Also drained the engine oil and changed the filters.

ADDITIONAL DESCRIPTION:

hyd leak

unit is creeping

forward reverse switch is kicking out

cutter head motor speed slowing down

service

SUBLETL

check crank seal

	~	
15W40BULK	ROTELLA 15w40 Q	8
	OIL SOLD BY THE QT.	
151940001	FILTER - SAFETY	1
151941001	FILTER - PRIMAR	1
	FILTER - PRIMARY	
15340001	ELEMENT-FUEL FI	1

OH Invoice

CONTINUED ON PAGE 02

Received By	

SERVICE INVOICE					
STK#/FLEET#		HRS SN/EIN	WARRANTY DATE	HRS	
	Stump Cutter	880 281110			
	BB2800SP				
	ELEMENT-FUEL	FILTER			
154908001		OIL FILTER - CU	1		
	OIL FILTER -	CUMMINS 3.3L			
2683001		ELEMENT	1		
6 FNTX-S		#6 JIC CAP	5		
6 PNTX-S		#6 JIC PLUG	5		
68BULK		HYD 68 OIL	100		
	oil is sold :	by the quart			
31.37.37.			S		
11112010			SEGMENT TOTAL==>		12134.40

***** WORK ORDER TOTALS ******
PARTS
LABOR
SUBLET
SHOP SUPPLIES
SUB TOTAL==>
Missouri State 8.9880
CREDIT CARD SALE
12382.29