CUSTOMER #:

CITY OF HUTCHINSON KANSAS

\*INVOICE\*

## PAGE 1

BUS:		CELL:			SERVICE ADVIS( VIN LICENSE   MILEAGE IN / OUT   TAG					
COLOR	YEAR				VIN		MILEAGE IN / OUT		TAG	
							45,950	45,850	T 2 4 9	
BLACK		HEVROLET TA			CDECXGR274348	DATE	PAYMENT	43888 INV. I	T348	
DEL. DATE	PROD. DA	TE WARR. EXP.	PROMIS	FD	PO NO.	RATE	L'A LIVIEIN I	1144.1	27116	
18FEB16 IS			17 20 00	יי דוז אות		0.00	CASH	27NOV	1.7	
18FEB16 DI		DEADY	17:30 09 OPTIONS	NOVI/	LD-STK:6N085 E					
R.O. OPEN	ED	READY	OFTIONS	. 501	L CONOUS L					
11. FO OONC	1777 1	4:52 27NOV1	7							
11:59 09NO		TYPE HOURS				LIST	r NET	TOT	ΓAL	
TIME OFCOI	OP CLIC	KING NOISE	FROM ENG	INE ARI	EA WHEN RUNNIN					
CAUSE: F	N CLIC	CITIO DOLLA	I KOLL DIVO							
40646	90 CAN	SHAFT REPLA	ACEMENT							
10010	331									
1		323 (S) CAMSH	AFT							
		346 (S)LIFT								
		725 (S)LIFTE								
		L85 (S)GUIDE								
2	126691	L84 (S)GUIDE								
2	123462	290 COOLANT								
9	192594	187 OIL								
		000 (S) FILT								
19	9 11546	5959 (S)BOL	Γ							
		976 (S)BOLT								
		500 BOLT								
		787 (S)GASK								
1	12622	325 (S)GASK	ET							
1	12634	514 (S)SEAL			and the state of the state of					
		346 SEALANT		me that it	1 "Go, Waren'S Waren Waren					
2	12657	430 (S)GASK	ET							
		093 (S)GASK								
		947 (S) MANI								
		255 W-(S)PU								
1	12622	325 (S)GASK	ET							
8	12622				1 370	0				
1	12665	356 (S) PUMP		et suit	Mou.	F				
		123 F-(S)VA		4.学认代						
		086 (S)SEAL			All and a second					
		993 (S)SEAL								
1	12658	179 (S)BELT	1. 1	1 - 1	9/1-1000	moma T	TAND A			
PARTS:	0.0	0 LABOR:	0.00	OTHER		TOTAL				
FOUND CY	LINDER	#2 INTAKE	LIFTER RC	LLEK E	EARING HAD LA	KGE AMO	NOT AC			
		T. SOME OF	THE OTHER	TITLIE	RS ALSO HAD P	DAMAGE (	DITTING A	ND		
MUCH AS		EN MOLTIPLE			LLER SURFACE		CRIPTION CRIPTION	TOT	ALS	
We Gladly		pressed warranties by a	manufacturer or su	upplier other t	han the dealers are theirs, no	LABOR AT		.01		
Accept:	dealers	, unless otherwise provide	ed in writing and furn	nished to buye	r by dealer."	PARTS AN				
VISA		TERMS: STRICT	LY CASH UNLESS P	RIOR ARRANG	SEMENTS MADE		The state of the s			
	mataria	I hereby authorize the repair work hereinafter set f			forth to be done along with the necessary loss or damage to vehicle or articles left in	in CUBIET A	and the fact of the same			
MasterCard	vahiala	in case of fire thatt or	any other cause bey	and your control or for any delays caused by	) Y		#			
	1/0// 20	unavailability of parts or delays in parts shipments you and/or your employees permission to operate the			e vehicle herein described on streets, highways		HARGES			
DISCOVER	or else	where for the purpose o	f testing and/or insp to secure the amour	nection. An express mechanic's lien is hereby		LESS INS				
	Accoun	nts due and payable the 1	Oth of the month fo			SALES TA				
(Company)						PLEASE				
AMERICAN EXPRESS		X	CUSTOMER'S SI	CNATURE		THIS AN				
			COSTOMER'S SI	GNATURE						

CITY OF HUTCHINSON KANSAS

\*INVOICE\*

## PAGE 2

BUS:			CELL:		SER	VICE ADVISOR				
COLOR	YEAR MAKE/MODEL			100000000000000000000000000000000000000	VIN LICEN			MILEAGE IN / OUT TAG		
BLACK	16	CHE	VROLET TA	AHOE	1GNL	CDECXGR27434	8	43888	/43888	T348
DEL. DATE	PROD.	DATE	WARR. EXP.	PROMIS	ED	PO NO.	RATE	PAYMENT	INV	. DATE
18FEB16 IS 18FEB16 DI				17:30 0			0.00		27NO	717
R.O. OPEN	IED	•	READY	OPTIONS	s: SO	LD-STK: 6N085	ENG:5.3	_Liter_SI	DI	
11:59 09NO	37/17	114.	52 27NOV	17						
LINE OPCOL			YPE HOURS				LIS	r ne	T TO	OTAL

FLAKING OFF). CAMSHAFT ALSO HAD FLAKING COMMING OF MULTIPLE LOBES. HAD ISSUES TRYING TO DECIDE WHERE THE NOISE WAS COMMING FROM. CALLED GM TECHNICAL ASSISTANCE TO SEE IF THEY COULD HELP PINPOINT OR HAVE A "LIKE " CASE. THEY INSTRUCTED ME TO CHECK THE FLYWHEEL FOR A CRACK. I REMOVED BOLTS FROM FLYWHEEL AND NOISE WAS STILL PRESENT. REMOVED ALL THE BELTS, NOISE STILL THERE, VERY SLIGHT INCONSISTANT TAPPING NOISE. REMOVED VALVE COVER OF RIGHT HAND SIDE, ALL LOOKED OK. NOISE WAS MOST APARENT ON HEATER CORE OUTLETS ON WATER PUMP HOUSING. I DECIDED TO TEAR ENGINE DOWN. FOUND #2 LIFTER THE WORST OUT OF ALL OF THEM, ROLLER SLOP. REPLACED THE CAMSHAFT, LIFTERS, LIFTER GUIDES, AND ALL GASKETS. ALSO REPLACED OIL PUMP, SI ADVISED TO REPLACE IT IF REMOVED. TACH ALSO SAID TO COMMAND THE HIGH PRESSURE FUEL PUMP TO HIGH AND SEE IF NOISE WAS WORSE, THE PUMP MADE VERY BAD NOISE WHEN COMMANDED HIGH, SO REPLACED IT. TECH CASE # 8-3551819791

English Committee of the Committee of th

Me Appende Your Enducat

		4.44.44.44.4	TOTALO
We Cledly	DISCLAIMER OF WARRANTIES	DESCRIPTION	TOTALS
We Gladly Accept:	"All expressed warranties by a manufacturer or supplier other than the dealers are theirs, not dealers, unless otherwise provided in writing and furnished to buyer by dealer."	LABOR AMOUNT	
		PARTS AMOUNT	
VISA	TERMS: STRICTLY CASH UNLESS PRIOR ARRANGEMENTS MADE  I hereby authorize the repair work hereinafter set forth to be done along with the necessary	GAS, OIL, LUBE	
Master Office Discover	I motorial and scree that you are not responsible for loss or damage to Vehicle or articles left in	SUBLET AMOUNT	
	vehicle in case of fire, that or any other cause beyond your control or for any delays caused by vehicle in case of fire, that or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.	MISC. CHARGES	
		TOTAL CHARGES	<u> </u>
		LESS INSURANCE	
	Accounts due and payable the 10th of the month following statement.	SALES TAX	<u>.                                    </u>
AMERICAN EXPRESS	CUSTOMER'S SIGNATURE	PLEASE PAY THIS AMOUNT	
	COSTOMEN S SIGNATORIE		