INVOICE DATE

10/22/2019 02:54PM

INVOICE NO. PAGE
1-292950154 1

CUSTOMER NO. BRANCH

SOLD SLACK FARMS

SHIP SLACK FARMS

CUSTOMER P.O. R/S ORDER NO.

PRICE/PER EXTENSION

TERMS: (00) NET 10TH

COMPLETION DATE: 10/18/2019
UNIT: 696212 YEAR: 2010 MAKE/MODEL: KENWORTH T660
SERIAL: 1XKADB3X87J093218 MILEAGE: 696212
OPR#01 15 000 00 ELECTRICAL SYSTEM REPAIRS

HEADLIGHTS DON'T COME ON WITH SWITCH, BUT THEY FLICKER OFF AND ON SOMETIMES WHEN IDLE.

HEADLIGHTS WERE FLICKERING AT AN IDLE. NOT ANYMORE. NO HEADLIGHTS AND NO TURN SIGNALS. PLUGGED INTO ESA. ICU SHOWS MANDATORY UPDATE. HAS Q21-1029-1-004, REQUIRES P30-1003-100. FAILED TO FLASH SEVERAL TIMES. WENT TO ECAT AND GOT DIAGRAMS FOR HEADLIGHTS. P94-1588 AND ICU DIAGRAM P94-1456. NEED TO DIG INTO THE TURN STOCK MODULE. T/S MOD CONTROLS FOR HEADLIGHTS AND TURN SIGNALS. STARTED REMOVING TURN SIGNAL MOD TO PUT IN A TEST. LIGHTS AND TURN SIGNALS STARTED FLICKERING. GOT MOD OUT. FOUND MOD FULL OF WATER AND TERMINALS CORRODED. WENT AHEAD AND PLUGGED IN THE TEST MOD. LOW BEAMS, HIGH BEAMS, MARKERS AND 4 WAYS WORK. TURN SIGNALS DO NOT WORK. DON'T HAVE THE CORRECT TEST MOD. ADVISED FOREMAN. QUOTED CORRECT TURN SIGNAL MOD AND PINS TO FIX THE HARNESS. REMOVED THE CENTER SWITCH PANEL FOR ACCESS. GOT PARTS IN. REPINNED WHAT NEEDED TO BE REPINNED DUE TO CORROSION. HUNG TURN SIGNAL MOD. ALL LIGHTS BURNING EXCEPT FOR L/R TURN SIGNAL. INSTALLED T/S MOD. KEYED ON ALL THE 2 1/2" GAUGES ARE INOP AND FLASHING THE TELLTAIL LIGHTS. TRIED TO REFLASH AGAIN. STILL FAILED. MADE QUOTE FOR CECU UPGRADE. GOT CECU PULLED AND FOUND CORROSION ON THE LOWER BANK OF SENSOR CONNECTOR. CLEANED PIN ON HEARNESS AND ICU. USED DIELECTRIC GREASE IN ICU AND CONNECTION BODIES. PLUGGED BACK IN. ALL LIGHT AND GAUGES WORKING AT THIS TIME. L/R TAIL LIGHT BULB REPLACED. STILL NEED TO FIND WHERE THE WATER INTRUSION IS COMING FROM. CUSTOMER TOOK TRUCK BEFORE IT COULD GO TO BODY SHOP.

1 PC P21-1012-402

MODULE-CONTROL TURN

25 PC 1-968873-1

TERMINAL-WIRE FREIGHT IN AIR

1 PC 97944-1

NYK ANTI-CORROSION COM

1 PC LB010402

LAMP-STT ROUND 4" RED

SHIPVIA	FREIGHT	SUBTOTAL	TAXSTATUS/STATE	SALESTAX	PLEASEPAY
					CONTINUED

INVOICE DATE 10/22/2019 02:54PM INVOICE NO. PAGE 1-292950154 2 CUSTOMER NO. BRANCH

TO

SOLD SLACK FARMS

SHIP SLACK FARMS

CUSTOMER P.O. R/S ORDER NO. PRICE/PER EXTENSION

> MISC SUBTOTAL PARTS SUBTOTAL LABOR SUBTOTAL SHOP SUPPLIES

HAZARDOUS MATERIAL

** OPR SUBTOTAL

OPR#03 01 000 00 INSPECTION OR SERVICE OPERATIONS FIND WATER INTRUTION

PULLED IN WASH BAY. HOSED CAB DOWN - ALL AROUND VISOR AND WINDSHIELD. GOT TO RIGHT SIDE OF WINDSHIELD. WATER COMING IN BETWEEN GLASS AND RUBBER SEAL, DIDN'T FIND ANY OTHER WATER LEAKS. CUSTOMER TOOK TRUCK BEFORE UNIT COULD GO TO BODY SHOP. 168

> PARTS SUBTOTAL LABOR SUBTOTAL SHOP SUPPLIES ** OPR SUBTOTAL

*TOTAL PARTS: *TOTAL LABOR: *TOTAL OTHER:

*TOTAL SHOP SUPPLIES: *TOTAL EPA:

***** * " WE ARE EAGER TO BE YOUR SERVICE AND PARTS HEADQUARTERS " * THANK YOU FOR YOUR BUSINESS !

SHIPVIA	FREIGHT	SUBTOTAL	TAXSTATUS/STATE	SALESTAX	PLEASEPAY
					2680.29