

Invoice To Account No: 63204

Deliver To:

**SERVICE INVOICE**Invoice Number: **229371**

Invoice Date: 10/18/2019

Location: 1

Work Order Number: 40729

Payment Type: Account

Page: 1 of 10

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 8760

3349

RW8760S003126

0S003126

**/SERVICE CALL Retail**

COMPLAINT:

SCV REPAIR

**CORRECTION:**

Drove out. Installed two new SCV cables and adjusted. Installed console cover. Removed and replaced coupler on SCV #1. Removed and replaced o-rings on SCV #2 and #3. Removed and replaced hydraulic hose on equipment attached to tractor.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7058	Cotter Pin	1.00				
AR69444	HY-GARD TM	2.00				
R100230	Gasket	1.00				
R69891	Seal	4.00				
RE18834	Breakaway Coupler	2.00				
X8010-4	Hydr Quick Coupler Plug	2.00				
SMA5092	TEFLON TAPE	1.00				
Miscellaneous	Description	Quantity				
3921	MILEAGE SERV VEHICLE	25.00				

Sub-Total: \$904.10

Labor:

**/BLOWER MOTOR Retail**

COMPLAINT:

BLOWER MOTOR SWITCH

**CORRECTION:**

Ordered blower motor switch. Drove out. Removed and replaced blower switch. Tested operation.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R85060	Knob	1.00				✓

CONTINUED ON NEXT PAGE-&gt;

REF NO: 63204

# SERVICE INVOICE

Invoice Number: **229371**  
 Invoice Date: 10/18/2019  
 Location: 1  
 Work Order Number: 40729  
 Payment Type: Account  
 Page: 2 of 10

Make/Model:

JOHN DEERE 8760

Meter:

3349

Serial Number:

RW8760S003126

Eq ID:

0S003126

Fleet No:

/BLOWER MOTOR Retail  
 RE32762

Switch

Labor:

Sub-Total: \$191.16

/CHECK LIGHTS Retail  
 COMPLAINT:  
 CHECK LIGHTS

## CORRECTION:

Diagnosed lights inop. The flasher module was built in to the tachometer. Took dash apart and followed the wiring from the hazard switch to the tach. Checked if the tach was putting power out. Checked all fuses and relays. Finally found a short in the electrical load center. Replaced the load center and turn signals worked. Tried to replace just the bulbs in right side lamps, but they broke when removing them. Replace with new lamps. The light on the rear end of the tractor was not working. Traced the wires back to where the tractor articulates. Found the wiring tore apart. Spliced in new wire. Checked all lights afterwards and they all worked.

Part Number	Description	Quantity
57M10889	Elec. Connector Terminal	10.00
57M7146	Fuse	2.00
AR60250	Lamp	2.00
R86830	Handle	1.00
RE50984	Electrical Load Center	1.00
TY16071	Wire	24.00
TY27131	Tube	1.00
TY27422	Wire	36.00

Sub-Total: \$1,880.43

/GEN Retail  
 COMPLAINT:  
 CHECK CIGARETTE LIGHTER

## CORRECTION:

Invoice To Account No: 63204

Deliver To:

**SERVICE INVOICE**

Invoice Number:	229371
Invoice Date:	10/18/2019
Location:	1
Work Order Number:	40729
Payment Type:	Account
Page:	3 of 10

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 8760	3349	RW8760S003126	0S003126	

**/GEN Retail**

Cigarette lighter was not working. A new socket was no available. Made sure lighter had power. Cleaned up all the rust and sides on the original lighter and it worked fine.

**Labor:****/A/C CHECK Retail**

COMPLAINT:  
CHECK A/C

**CORRECTION:**

Tested a/c, it was blowing cold.

**Labor: !****/DIAGNOSE Retail****COMPLAINT:****DIAGNOSE FAN SPEED NOT CHANGING SPEED****CORRECTION:**

Checked operation and found blower motor resistor was completely rusted and so were the terminals. Removed the old resistor, it was so rotted that the bolts broke. Drilled the bolts out and installed new resistor. Looked up schematic on how to wire it in. Put new ends on the wires, plugged it in and tested. Blower motor worked at all speeds.

Part Number	Description	Quantity
37H137	Screw	2.00
AT456900	Resistor	1.00
TY27153	Tube	1.00

**Labor**

CONTINUED ON NEXT PAGE-&gt;

Invoice To Account No: 63204

Deliver To:

**SERVICE INVOICE**Invoice Number: **229371**

Invoice Date: 10/18/2019

Location: 1

Work Order Number: 40729

Payment Type: Account

Page: 4 of 10

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 8760	3349	RW8760S003126	0S003126	

**/FUEL GAUGE Retail****COMPLAINT:**

FUEL GAUGE, R/R OR REPAIR

**CORRECTION:**

Tractor needed new fuel sender. Started to remove the sender bolt but it was seized. Drilled the bolts out carefully to avoid making a hole in the tank. Pulled the old fuel sender off. Installed the new sender with new bolts.

Part Number	Description	Quantity	
RE221717	Fuel Sender	1.00	1

**/SERVICE Retail****COMPLAINT:**

SERVICE

**CORRECTION:**

Service unit. Change engine oil with filter. Change hydraulic and air & cab filters.

Part Number	Description	Quantity
AR86745	Filter Element	1.00
AR95758	Filter Element	1.00
AR95759	Filter Element	1.00
RE21058	Oil Filter	1.00
RE21748	Oil Filter	1.00
RE24619	Air Filter	1.00
RE38965	Oil Filter	2.00
TY26679	PLUS-50 TM Engine Oil	2.00

CONTINUED ON NEXT PAGE-&gt;

Invoice To Account No: 63204

Deliver To:

**SERVICE INVOICE**Invoice Number: **229371**

Invoice Date: 10/18/2019

Location: 1

Work Order Number: 40729

Payment Type: Account

Page: 5 of 10

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 8760

3349

RW8760S003126

0S003126

**/ARMREST REPAIR Retail**

COMPLAINT:

REPAIR ARMREST

## CORRECTION:

Armrest would not stay in position. Removed the armrest, took apart and replaced all parts except for one arm. Put back together and installed on the seat. Made sure it worked properly.

Part Number	Description	Quantity
12H304	Lock Washer	2.00
14H732	Nut	2.00
40M7084	Snap Ring	1.00
A4741R	Spring	2.00
K40003	Lock Nut	4.00
R27441	Washer	4.00
R59020	Link	1.00
R59022	Screw	2.00
R59023	Pin Fastener	1.00
R59028	Bushing	1.00
R59029	Knob	1.00
R59183	Pin Fastener	2.00
R59320	Shaft Key	1.00
R61862	Plate	2.00

Sub-Total: \$255.79

**/SCV Retail**

COMPLAINT:

SCV REPAIR

## CORRECTION:

CONTINUED ON NEXT PAGE-&gt;

Invoice To Account No: 63204

Deliver To:

**SERVICE INVOICE**

**Invoice Number:** 229371  
**Invoice Date:** 10/18/2019  
**Location:** 1  
**Work Order Number:** 40729  
**Payment Type:** Account  
**Page:** 6 of 10

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 8760	3349	RW8760S003126	0S003126	

**/SCV Retail**

Checked operation to determine which SCVs were leaking. Found numbers 2 and 1 SCVs were leaking. Removed the caps, popped new ones in #2. Removed the cam on the back and resealed it. Cleaned up the drain and got the new cover for it installed. Removed broken cap on SCV 1. Removed the old coupler and installed new one with new seals. Installed new covers and cleaned drains.

Part Number	Description	Quantity
21H1100	Screw	1.00
24H1302	Washer	1.00
BLUEWASHER	GRADE 8 WASHER	1.00
R100230	Gasket	3.00
R100333	Gasket	2.00
R126556	Seal	5.00
R69891	Seal	8.00
R74244	Plug	2.00
R75569	Cover	2.00
R76455	Washer	1.00
R81054	Retainer	1.00
R81055	Screw	1.00
RE18834	Breakaway Coupler	4.00
XCL-21	Hose Clamp	1.00
<b>Miscellaneous</b>	<b>Description</b>	<b>Quantity</b>
3750	FREIGHT	1.00
3751	SPECIAL HDLG	1.00

Comments: R86830

Comments: R86830

Lab:

Sub-Total: \$1,377.98

**/RUN OVERHEAD Retail**

COMPLAINT:

RUN OVERHEAD

CONTINUED ON NEXT PAGE-&gt;

Invoice To Account No: 63204

Deliver To:

## SERVICE INVOICE

Invoice Number:	229371
Invoice Date:	10/18/2019
Location:	1
Work Order Number:	40729
Payment Type:	Account
Page:	7 of 10

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 8760	3349	RW8760S003126	0S003126	

### /RUN OVERHEAD Retail

#### CORRECTION:

Removed needed parts and valve cover gasket. Set engine overhead. Cleaned cover and reinstalled parts.

Part Number	Description	Quantity
R49492	Gasket	1.00
R74365	Gasket	1.00
TY26101	Cleaning Solvent	2.00
Miscellaneous	Description	Quantity
3750	FREIGHT	1.00

Comments: R74365

Labor: \$250.00

Sub-Total: \$521.56

### /SHIELDS, REPAIR Retail

COMPLAINT:  
SHIELD HOLDERS

#### CORRECTION:

Replaced the one shield holder that was broken, the rest were still good.

Part Number	Description	Quantity
12H322	Lock Washer	4.00
21M7194	Screw	4.00
R74628	Latch	1.00
R78096	Handle	1.00

Labor: \$25.00

Parts: \$17.83

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$42.83

### /RUNS ROUGH Retail

COMPLAINT:  
RUNS ROUGH

Invoice To Account No: 63204

Deliver To:

**SERVICE INVOICE**Invoice Number: **229371**

Invoice Date: 10/18/2019

Location: 1

Work Order Number: 40729

Payment Type: Account

Page: 8 of 10

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 8760	3349	RW8760S003126	0S003126	

/RUNS ROUGH Retail

## CORRECTION:

Tested out injector by loosening the injector line and found that they were all ok. Just needs an overhead.

Sub-Total: \$85.00

/GEN-1 Retail

## COMPLAINT:

BLOWER MOTOR, R/R OR REPAIR

## CORRECTION:

Removed pressurizer, some of the bolts were broken and had to be extracted. One stud on the circulator was also broken. Removed the nut then removed the blower motor. Had to remove the side shield to get the blower out. Spliced in connector that adapts to the blower, got the new blower installed and working.

Part Number	Description	Quantity
19M6614	Cap Screw	12.00
M47293	Elec. Connector Terminal	2.00
PM37465	Sealant	1.00
PMMF62941	Cap Screw	4.00
R113520	Gasket	1.00
R77476	Electrical Connector Assy	1.00
R97333	Gasket	2.00
R97336	Hose	1.00
RE46880	Blower	1.00
RE53219	Motor	1.00
TY27137	Tube	1.00
TY5021	Tape	1.00

CONTINUED ON NEXT PAGE-&gt;



Invoice To Account No: 63204

Deliver To:

## SERVICE INVOICE

Invoice Number: **229371**

Invoice Date: 10/18/2019

Location: 1

Work Order Number: 40729

Payment Type: Account

Page: 9 of 10

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 8760

3349

RW8760S003126

0S003126

### /GEN-1 Retail

48-89-4604

7/64 SHOCKWAVE TITANIUM BIT

1.00

Miscellaneous

3750

Description

FREIGHT

Quantity

L

1.00

Comments: R86783

3750

FREIGHT

1.00

Comments: R113520,R93175,R97333,RE53219,R93176

3750

FREIGHT

1.00

Comments: RE46880,R97333

3751

SPECIAL HDLG

1.00

Comments: RE46880,R97333

Sub-Total: \$720.49

### /EXHAUST REPAIRS Retail

COMPLAINT:

EXHAUST REPAIRS

CORRECTION:

Changed out exhaust pipe right after the turbo

Part Number

RE36837

Description

Exhaust Pipe

Quantity

1.00

RE37656

Clamp

1.00

Labor:

Sub-Total: \$1,052.58

### /CHECK Retail

COMPLAINT:

CHECK RPMS

CORRECTION:

Checked rpms on the motor because it wouldn't idle all the way up and down. Found some grommet were bad.

Invoice To Account No: 63204

Deliver To:

## SERVICE INVOICE

Invoice Number:	229371
Invoice Date:	10/18/2019
Location:	1
Work Order Number:	* 40729
Payment Type:	Account
Page:	10 of 10

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 8760	3349	RW8760S003126	0S003126	

/CHECK Retail

Labo

Sub-Total: \$21.67

/PICK UP-DELIVER Retail

COMPLAINT:

PICK UP / DELIVER

CORRECTION:

Miscellaneous	Description	Quantity
5990	FREE HAULING	1.00
Z4771	SERVICE ACCESSORIES	1.00
Z4772	ENVIRONMENTAL CHARGES	1.00

Comments: Free pick up and deliver per Derek

Labo

Sub-Total: \$100.00

ATTENTION: Part(s) values for this invoice have changed, Original Invoice Parts Sale Value = \$5095.24  
INVOICE CONTAINS \$58.39 DISCOUNT

Customer PO No:

Tax Exempt No:

Grand Total: \$9,768.45