

Repair Invoice

DI2038

INVOICE

Invoice #

SO #

Date 07/26/2019

Writer

Page 1 of 2

Ship
to:

Payment terms

Ship via

Primary phone

Model	1995 / FORD / L9000
-------	---------------------

Cust Unit #

/ SVA80279

Miles/Hours 317032 / 0

560 **Operation #** 1

TO GEAR

ap^{tor}

1. found metal in the transmission. pulled the shift cover off the pto and was metal in there.

removed the support off the back of the transmission. removed the drive shaft. removed the pump off the pto. went to take the bell housing bolts out and 6 of them broke off. removed the transmissino.. took back to spec shop. removed the clutch. removed the fly wheel. took back to spec shop. the rear main was leaking. remoevd it cleaned up the surfaces installed a new seal. installed the fly wheel. installed new clutch. removed the 6 broken bolts. installed the new transmission. put the rear support back on. put the stick in. put the pto cover back on. put the pump on. made a bracket for the pump because there wasn't one on it. filled the transmission with oil. hooked up the clutch linkage. checked free travel. started drove truck checked everything over everything works properly.

Part number	Description	Ord	Del	B/O	List Price	Unit price	Ext. price
033_TG-GSK-A1	SEAL KIT	1	1	0			
Labor							
Imported labor from WO-0082430							
072_MU-155698-XB10	15.5X2 CARBOTIC 10SPRG	1	1	0			
Core exchange							
077_SCB200	2" HINGED CLUTCH BRAKE	1	1	0			
329_142-5868	3406 REAR CRANK SEAL	1	1	0			
110_S2130	SHIFTER ASSMBLY (HIGH)	1	1	0			
196_MS99-63399	FULLER SHIFTER ISOLATOR BUSHING KIT	1	1	0			
029_306VV	PILOT BRG W/VITON SEAL	1	1	0			
029_306VV	PILOT BRG W/VITON SEAL	1	1	0			
Labor							

INVOICE

Invoice #

SO #

Date 07/26/2019

Writer

Page

Imported labor from WO-0082668

116_RTX14710BX	REMAN FULLER TRANS 10SPD	1	1	0
	WO Unit # WO-0074465			

Core exchange

101_20A-500	5" PREFORMED BAND CLAMP	3	3	0
010_6.5-70-18X	1710,1760,1810 STRAP KIT	1	1	0
346_10000004901	SYNTHETIC 50W BY POUND	28	28	0
019_PB10	PUMP SUPPORT BRACKET KIT	1	1	0

Labor

Repair Order no. RO - RO-0069660 Operation # 2

Condition REAR MOTOR MOUNTS

Correction saw the rear motor mounts were bad. jacked up the engine. removed the passenger side motor mount. cut the bushing off. cleaned up shaft. pressed new bushing on installed motor mount. same thing on driver side.

Part number	Description	Ord	Del	B/O	List Price	Unit price	Ext. price
196_PL1048	MOTOR MOUNT 3"OD X 1 9/16"ID	2	2	0			

Labor

Shop supplies

Total merchandise

Total cores

Total labor

Tax amount

Invoice total

\$8,307.78

Received by

See warranties on reverse side