Invoice: Preview

COD Date: 06/09/2016

Description

Year	Make/Model			Vehicle Identific	
CHA 670A			HP36288		
Stock No	PO	License	Tag	Customer	Telephone
22979					
	Quantity	List	1	let	Total

Type:		СОМ	RO Open Date:	04/05/16	Meter In:	2010	
⁶ 001		PM360					
	L	F PERFORME L LABOR LABOR	D PM360 INSPECTION		Subtotal charges this	section	
002		BLOW OUT D CLEAN DIR	RADIATOR TOUT OF RADIATOR		•		
	L	F WASHED O L LABOR LABOR	UT RADIATOR		O. Landal abarress Abir		
003		ENGINE OIL D CHANGE EI	. & FILTER NGINE OIL AND FILTERS		Subtotal charges this	section	
	L	OIL L LABOR LABOR P 504594D1 F P 79034598Q P 243-1559 BI	15W 40 OIL ELT	PLACED OIL FI	LTER. REFILLED WITH		
•		P *DISCOUNT	10%		Subtotal charges this	section	
004			LUBE SERVICE NTIRE MACHINE AND LUB	E ALL CHAINS			
	L	F GREASED A L LABOR LABOR P 79014728 G P *DISCOUNT		ND OILED ALL (CHAINS		
005		CHANGE E	NGINE COOLANT NGINE COOLANT PER 500	HOUR RECOM	Subtotal charges this MENDATION	s section	
	L	F DRAINED C L LABOR LABOR P 79022729 C P *DISCOUNT		WITH NEW CO	OLANT.		
hand hidd some	one of towerhate					Copyright (c) 2014 HGS System	10

OpCode

Cond

Invoice: Preview

COD Date: 06/09/2016

	Year		Make/Model		,	ehicle Identifica	ation
		CHA 670A			HP36288		
	Stock N	lo	PO	License	Tag	Customer	Telephone
	2297	9					
ond OpCode T	Description		Quantity	List	l N	et	Total

Subtotal charges this section 006 CHANGE FUEL FILTERS D CHANGE FUEL FILTERS AND BLEED SYSTEM PER 500 HOUR RECOMMENDATION F REMOVED FUEL FILTERS AND INSTALLED NEW. AND BLEED SYSTEM. L L LABOR LABOR P AG121852 FUEL FILTE P 539363D1 FUEL FILTE P *DISCOUNT 10% Subtotal charges this section CHANGE CAB FILTERS 007 D CHANGE ALL CAB FILTERS AND BLOW OUT COMPARTMENTS F REMOVED OLD FILTER AND CLEANED OUT FILTER HOUSING. INSTALLED **NEW FILTER** L L LABOR LABOR P 71393893 FILTER ELE P *DISCOUNT 10% Subtotal charges this section **ENGINE AIR FILTERS** 800 D CHANGE ENGINE AIR FILTERS AND BLOW DIRT OUT OF CANNISTERS F REMOVED OLD FILTERS, CLEANED HOUSING AND INSTALL NEW FILTERS. F L LABOR LABOR P 71368961 FILTER ELE P 71368962 FILTER ELE P *DISCOUNT 10% Subtotal charges this section FINAL DRIVE SERVICE 009 D CHANGE OIL IN FINAL DRIVES PER 500 HOUR RECOMMENDATION F DRAINED OIL OUT OF BOTH FINAL DRIVES. CLEANED DRAIN PLUGS AND FILLED WITH OIL. L LABOR LABOR P 79014723P 80-90 BULK P *DISCOUNT 10% Subtotal charges this section

Copyright (c) 2014 HBS Systems

010

TRANSMISSION SERVICE

Cond	OpCode	T Description Quantity List Net Total
		D DRAIN, FLUSH AND REFILL TRANSMISSION PER 500 HOUR RECOMMENDATION
		F DRAINED OIL OUT OF TRANSMISSION CLEANED UP DRAIN HOLE AND REFILLED.
	L	L LABOR LABOR
		P 70925919 O-RING-X 3 P 79014723P 80-90 BULK
		P *DISCOUNT 10% Subtotal charges this section
011		ROTOR GEARBOX SERVICE D SERVICE ROTOR GEARBOX AND REPLACE OIL PER 500 HOUR RECOMMENDATION
		F DRAINED OLD OIL FROM GEAR BOX.(NOTE: OIL WAS VERY OLD AND NOT CHANGED IN A WHILE) CLEANED DRAIN PLUGS AND REFILLED WITH OIL.
	L	L LABOR LABOR
		P 79014723P 80-90 BULK P *DISCOUNT 10% Subtotal charges this section
012		HYDRAULIC SERVICE
		D CHANGE HYDRAULIC FILTERS INCLUDING RESEVOIR BREATHER AND TOP OFF OIL LEVEL PER 500 HOUR RECOMMENDATION
•		F DRAINED HYDRAULIC OIL FROM RESERVOIR. PULLED OLD FILTERS OFF. INSTALLED NEW FILTERS AND FILLED WITH OIL.
	L	L LABOR LABOR
		P 104309W91 ELEMENT P 79014715Q 821XL QT
		P 112887W1 BREATHER C
		P *DISCOUNT 10% Subtotal charges this section
013		HYDROSTAT SERVICE D CHANGE HYDROSTATIC TRANSMISSION FILTER PER 250 HOUR RECOMMENDATION
	L	F REMOVED OLD FILTER AND INSTALLED NEW. L LABOR
		LABOR P 104309W91 ELEMENT
		P *DISCOUNT 10%
long-hut	ich_servicepg1.lemplate	

COD Date: 06/09/2016

	Year	Make/Model		1	/ehicle Identifica	ation
	CHA 670A			HP36288		
	Stock No	PO	License	Tag	Customer	Telephone
	22979					
ription		Quantity	List	N	let	Total

Cond OpCode T Subtotal charges this section FEEDERHOUSE CYLINDERS 014 D REPLACE FEEDERHOUSE LIFT CYLINDER, CUSTOMER HAS ALREADY PURCHASED AND WILL PROVIDE NEW CYLINDER F REMOVED HYDRAULIC HOSES. DROVE PINS OUT, HAD TO TORCH ONE OUT DUE TO BEING WORN OUT SO BAD. INSTALLED NEW CYLINDER AND PINS. L LABOR L LABOR P 71364016 CYLINDER P P 63834 ROLL PIN-1 P 79023090 CLEANER/BR P CH3K-0360 O-RING-16. P 70933818 FLAT WASHE P *DISCOUNT 10% P COTTERPIN COTTER PIN P 22UH80 LKW 3/8 Subtotal charges this section **FUEL PRIMER PUMP** 015 D FUEL PRIMER PUMP IS COLLECTING DIRT, RESEAL OR REPLACE F REMOVED OLD PRIMER PUMP, CLEANED SURFACE AND INSTALLED NEW PUMP. L LABOR LABOR FUEL PRIMER PUMP AND GASKET P OTHER PARTS P OTHER PARTS Subtotal charges this section CHOPPER ASSEMBLY 016 D REPLACE WORN CHOPPER ASSEMBLY AND KNIVES F REMOVED OLD CHOPPER ASSEMBLY AND ESTIMATED NEEDED REPAIRS. DETERMINED THAT THE CHOPPER ASSEMBLY NEEDED REPLACED. INSTALLED NEW CHOPPER AND DRIVE PULLEY. L LABOR LABOR P 71409833 CHOPPER P 363905X1 CARRIAGE B

Copyright (c) 2014 HBS Systems

P 71315780 SENSOR COL P 71391021 SENSOR P 3009492X1 HEX HEAD B P 70930389 P-CLIP-9.5

P ACP0039260 COMPOUND-T

Total

Invoice: Preview COD Date: 06/09/2016

Year Make/Model			Vehicle Identification			
(CHA 670A			HP3628	8	
Stock No	PO	License	Tag	Customer	Telephone	

Quantity List Net Description Cond OpCode Т P *DISCOUNT 10% P 3HEE8 NUT 5/16 P 2DA91 LKW 5/16 P 3HDX3 FLNUT 5/16 P 1JY72 FLWSH 5/16 P 1JY33 FLWASH 3/8 P 26LH69 NYLOCK 3/8 P 2CA86 BOLT 5/16 P KEYSTOCK KEYSTOCK P 2DA89 LKWASH 1/4 P 3HDX4 FLNUT 3/8 P 23KZ56 BOLT 3/8 P 1JY74 FLW 3/8 P 2CA50 BOLT 1/4 P 1JY70 FLW 1/4 P 4FCA9 HEXNUT 1/4 116082W1 PULLEY P FARM PARTS Subtotal charges this section MAIN DRIVE IDLER 017 D REPLACE PLASTIC BUSHING IN IDLER TENSIONER FOR MAIN DRIVE BELT F REMOVED NUT FOR IDLER TENSIONER AND REMOVED RUBBER AND BUSHING. REPLACED NUT AND BUSHING. TIGHTENED TO SPEC. L LABOR LABOR P 70924095 SPRING NUT P 71194263 BUSHING-13 P *DISCOUNT 10% Subtotal charges this section **HEADER DRIVE PULLEYS** 018 D RESEAL HEADER DRIVE PULLEYS. THEY ARE SEEPING OIL FROM MIDDLE JEOPARDIZING BELTS F REMOVED PULLEYS AND DISASSEMBLED. CLEANED PARTS. INSTALLED NEW SEALS AND INSTALLED BACK ON COMBINE. L LABOR LABOR P 71399483 HUB P 70926647 BACKUP RIN P 70923831 O-RING-3/1 P 70923828 O-RING-3/1

22979

Copyright (c) 2014 HSS Systems

P 71382985 ADAPTER P 71382055 SPACER

Invoice: Preview

COD Date: 06/09/2016

Year	Make/Model		Vehicle Identification	n	
CHA 670A			HP36288		
Stock No	PO	License	Tag Customer	Telephone	
22979					
	Quantity	List	Net	Total	

- P 353062X1 RETAINING
- P 353724X1 HEX HEAD B
- P 70917861 FLAT WASHE
- P 70923584 O-RING-0.1
- P 70923577 O-RING-1/8
- P 70923813 O-RING-1/8
- P 70927745 RETAINING
- P 71304362 BUSHING-14
- P AG523061 FLAT WASHE
- P AG100676 FLAT WASHE
- P 71173857 THRUST WAS
- P 71161396 THRUST BEA
- P 79023090 CLEANER/BR
- 7 7 9 0 2 3 0 3 0 CELANEI
- P 79014728 GREASE
- P *DISCOUNT 10%
- P 23KZ51 BOLT 1/4
- P 1JY29 FLWASH 1/4
- P RETRING RING RETAI
- P 22UH84 LKW 5/8

Subtotal charges this section

019

Cond

OpCode

T

ROTOR INLET HOUSING

D REPLACE LOWER SECTION OF ROTOR INLET HOUSING

Description

FIN ORDER TO GET TO THE INLET HOUSING I HAD TO REMOVED FAN DRIVE BELT, THE IDLER PULLEY AND ACTUATOR. THEN COULD REACH FROM THE SIDE TO ACCESS THE BOLTS. REMOVED ALL THE BOLTS FOR THE INLET HOUSING. LOOSED 2 HYDRAULIC LINES TO SLIDE THE HOUSING OUT THE RIGHT HAND SIDE. THEN STUCK THE NEW ONE IN THE SIDE TO LINE UP AND START THE BOLTS. THE CORNER OF THE UPPER HOUSING WAS WORE AND NEEDED WELDED. TIGHTEN ALL THE BOLTS AND REASSEMBLED THE HYDRAULIC LINES AND FAN DRIVE.

- L
- L LABOR LABOR
- P 71409996 PLATE
- P 353691X1 HEX HEAD B
- P Y704734 FLANGE LOC
- F 1704734 PLANGE LOC
- P 353678X1 HEX CAP SC
- P Y704726 FLANGE LOC
- P 71409970 FLOOR PANE
- P 353691X1 HEX HEAD B
- P 30289PF FLAT WASHE
- P 42907PF LOCK WASHE P 70537291 SNAP FASTE
- P *DISCOUNT 10%

Copyright (c) 2014 HSS Systems

COD Date: 06/09/2016

Year	Make/Model		Vehicle Identification			
C	HA 670A			HP3628	В	
Stock No	PO	License	Tag	Customer	Telephone	
22979						
	Quantity	List	l N	let	Total	

			22979				
Cond	OpCode	T Description		Quantity	List	Net	
•		P 23KZ64 BOLT 7/16 P 23KZ55 BOLT 3/8 P 22TC06 BOLT 3/8 P 1JY33 FLWASH 3/8		Cult	total abayraga	this section	
020		VALVE BLOCK LEAK D REPLACE ORINGS AS NEEDED TO VALVE (RH SIDE OF MACHINE)	REPAIR OIL L		total charges		ı
	L	F REMOVED THE HYDRAULIC HOSES REMOVED VALVE. INSPECTED FOR IT AND REASSEMBLED IN REVERS L LABOR LABOR P 79023090 CLEANER/BR P *DISCOUNT 10% P 400361X1 O-RING-8.9 P 70924048 O-RING-1/1 P 70927974 O RING P 70923841 O-RING07 P 70921205 O-RING09 P 70926356 O RING-NO P 70935902 O RING P CH3K-0360 O-RING-16. P 70928232 RING	R DAMAGE TO	3RD VALV	LVES, AND /E AND RESE		n
021		SIEVE FRAME BROKE OUT D REPAIR CRACKS IN SIEVE FRAME					
	L	L LABOR LABOR		Sub	total charges	this section	n
022		FEEDERHOUSE TENSIONER D REPLACE BEARING IN FEEDERHO	USE DRIVE TE	ENSIONER	PULLEY		
	L	F REMOVED OLD IDLER PULLEY AN L LABOR LABOR P 71309766 IDLER PULL P *DISCOUNT 10%	ID INSTALLED		ototal charges	 s this section	
023		FEEDERHOUSE CHAIN D REPLACE FEEDERHOUSE CONVE	YOR CHAIN A				

Copyright (c) 2014 HBS Systems

COD Date: 06/09/2016

			00000		
Year	Make/Model		Vehicle Ide	entification	
CHA 670A			HP36288		
Stock No	PO	License	Tag Custom	er Telephone	
22979					
	Quantity	List	Net	Total	

OpCode Description Cond T F REMOVED SINGLE POINT FROM FEEDER HOUSE. REMOVED BELT ON RIGHT HAND SIDE REMOVED BOTH PINS. REMOVED BOTH HYDRAULIC CYLINDERS. SET ON CHERRY PICKER AND PULLED FROM COMBINE. REMOVED CHAIN AND SHAFT. CLEANED UP SHAFT AND INSTALLED NEW SPROCKETS AND SLIP CLUTCH, INSTALLED NEW CHAIN AND ASSEMBLED IN REVERSE ORDER. L L LABOR LABOR P 71449017 CHAIN P 116108W1 SPROCKET-1 P 375111X1 NUT P 70911255 SETSCREW-1 P 2563800W1 CLUTCH JAW P 71399511 SPROCKET-3 P 1659650W1 COMPRESS. P 1659630W1 CLUTCH JAW P 1717640W1 WASHER P 71154722 BALL BEARI P ACP0039260 COMPOUND-T P 71149896 OFFSET LIN P DX1233050I #60CH BULK P 70914584 CHAIN LINK P DC7233P LINK, CHAIN P DX1233050I #60CH BULK P 2DA91 LKW 5/16 P 1JY33 FLWASH 3/8 P *DISCOUNT 10% Subtotal charges this section 024 **ELEVATOR CHAINS** D TIGHTEN ELEVATOR CHAINS TO PROPER TENSION F LOOSENED BOLTS FOR TENSIONER AND TIGHTENED CHAIN TO SPEC. AND RETIGHTEN BOLTS L L LABOR LABOR Subtotal charges this section SHAKER DRIVE BELT 025 D REPLACE PITMAN SHAKER DRIVE BELT F REPLACED SHAKER DRIVE BELT L LABOR LABOR

Subtotal charges this section

Copyright (c) 2014 HBS Systems

P 71390199 V-BELT-256 P *DISCOUNT 10%

COD Date: 06/09/2016

288
.00
Telephone
er

Description OpCode T Cond RH BACK DOOR STOP 026 D REPLACE RIGHT HAND BACK DOOR STOP F PULLED SHIELD OFF. DRILLED THE RIVET OUT AND INSTALLED NEW LATCH AND PUT SHIELD BACK ON COMBINE. L L LABOR LABOR P 354057X1 SPLIT PIN-P 700711557 FLAT WASHE P 71398912 ROD P *DISCOUNT 10% Subtotal charges this section LH ROTOR SHIELD LATCH 027 D REPLACE LATCH ON LEFT HAND ROTOR SHIELD F REMOVE ROTOR SHIELD, AND DRILL RIVET OUT. INSTALLED THE NEW LATCH AND REASSEMBLED. L LABOR L LABOR P 70537291 SNAP FASTE P *DISCOUNT 10% Subtotal charges this section SEPARATOR FAN BELT 028 D REPLACE SEPARATOR VARIABLE SPEED FAN DRIVE BELT F BACKED OFF TENSIONER AND REMOVED BELT. INSTALLED NEW BELT AND TIGHTENED TO SPEC. L L LABOR LABOR P 71394352 VAR SPEED P *DISCOUNT 10% Subtotal charges this section 029 RETURN GRAIN ELEVATOR D REPLACE RETURN GRAIN ELEVATOR DRIVE BELT F REMOVED SHIELDS AND SENSOR WIRE. LOOSENED BELT AND INSTALLED NEW BELT. REASSEMBLED IN REVERSE ORDER. L LABOR LABOR P 71385801 V-BELT-278 P *DISCOUNT 10% P 1JY78 FLW 1/2 P COTTERPIN COTTER PIN

Subtotal charges this section

page 9 of 14

COD Date: 06/09/2016

Year Make/Model Vehicle Identification

CHA 670A HP36288

Stock No PO License Tag Customer Telephone

22979

Quantity List Net Total

		T Description Quantity List Net To
Cond	OpCode	T Description Quantity List Net To
030		ENGINE VALVE ADJUSTMENT D ADJUST ENGINE VALVE BACKLASH PER 1000 HOUR RECOMMMENDATION
	L	F REMOVED VALVE COVER, CLEAN THE SURFACE THAT THE GASKET SITS ON. TURN MOTOR TO TDC AND ADJUSTED THE VALVES AND THEN TURN IT 360 DEGREES AND ADJUST THE REST. INSTALL NEW GASKET AND TIGHTEN VALVE COVER. LABOR LABOR VALVE COVER CASKET P 79023090 CLEANER/BR
031		CONCAVE CLEARANCE
031		D CHECK AND ADJUST CONCAVE CLEARANCE PER 50 HOUR RECOMMENDATION
	L	F ADJUSTED CONCAVE CLEARANCE PER SPEC L LABOR LABOR
032		CYLINDER BEATER BARS D REPLACE CLINDER BEATER BARS
•	L	F REMOVED FEEDER HOUSE. REMOVED OLD WEAR BARS AND INSTALLED NEW BARS AND REASSEMBLED IN REVERSE ORDER. L LABOR LABOR P 71393101 BEATER FLI P 364224X1 CARRIAGE B P Y705046 LOCK WASHE P 704031 HEX NUT-1/ P *DISCOUNT 10% P 23KZ56 BOLT 3/8 P 1JY33 FLWASH 3/8 P 26LH69 NYLOCK 3/8
033	L	CHAIN SERVICE D ADJUST TENSION ON ALL CHAINS PER SPEC F ADJUSTED ALL CHAINS TO SPEC L LABOR
		LABOR Subtotal charges this section
034		ROTARY SCREEN BELT

D REPLACE ROTARY SCREEN DRIVE BELT

COD Date: 06/09/2016

Year Make/Model CHA 670A			Vehicle Identification				
			HP36288				
Stock No	PO	License	Tag	Customer	Telephone		
22979							

OpCode Description T Cond F REMOVED SCREEN BELT SPRING AND REMOVED OLD BELT. INSTALLED NEW BELT AND REINSTALLED SPRING. L LABOR L LABOR P 71396754 V-BELT P *DISCOUNT 10% Subtotal charges this section ROTOR DISCHARGE PLATES 035 D REPLACE ROTOR DISCHARGE PLATES F REMOVED OLD PLATES AND INSTALLED NEW ONES. L L LABOR LABOR P 71411718 PLATE P 70923473 HEX HEAD B P Y705046 LOCK WASHE P Y705046 LOCK WASHE P *DISCOUNT 10% Subtotal charges this section ROTOR HARDWARE INSPECTION 036 D INSPECT ROTOR HARDWARE AND RETORQUE AS NEEDED F UPON INSPECTION I FOUND THAT THE FLIGHTING WAS BENT WITCH CAUSED THE BOLT TO SHEER OFF. I HAD TO HEAT UP THE FLIGHTING AND BENT IT BACK. EXTRACTED THE BOLT AND INSTALLED A NEW ONE. L LABOR LABOR P 47972PF BOLT UNC-A P Y705533 FLAT WASHE P *DISCOUNT 10% Subtotal charges this section FRONT ROTOR ELEMENTS 037 D REPLACE FRONT ROTOR THRASHING ELEMENTS F REMOVED SHIELD AROUND ROTOR AND REMOVED ELEMENTS. INSTALLED NEW ELEMENTS AND THE SHIELD. L LABOR LABOR P 2497273W91 PARTS PACK P 700706463 HEX HEAD B P 353771X1 FLAT WASHE

Subtotal charges this section

page 11 of 14

P *DISCOUNT 10%

Invoice: Preview

COD Date: 06/09/2016

Year Make/Model			Vehicle Identification				
	HA 670A			HP3628	В		
Stock No	PO	License	Tag	Customer	Telephone		
22979							
	Quantity	List	1	let	Total		

038

Cond

OpCode

REPLACE SHOE FRAME

Description

D REPLACE SHOE FRAME ASSEMBLY, REPAIR AND ADJUST SHOE AND CHAFFER AS NEEDED

FREMOVED OLD SHOE FRAME ASSEMBLY AND INSTALLED NEW UPPER SHOE FRAME. INSTALLED NEW BEARINGS AND SEALS. ADJUSTED SHAKER ARM PER SPEC. NOTE: INSTALLED UPGRADED SHOE FRAME WITH LARGER CASCADE PAN.

L L LABOR

T

LABOR

- P 71420245 FRAME
- P 71391805 TIE ROD
- P WR10193 BOLT
- P 71465011 CORN CHAFF
- P 1501043W91 BEARING W/
- P 71308770 KIT, BEARI
- P 364578X1 FLAT WASHE
- P 71401429 BEARING HO
- P 2551250W1 BEARING HO
- P ACP0039350 COMPOUND-A
- P 70932845 RIVET
- P 71428769 PAN SEAL
- P 70937253 POP RIVET-
- P 79016936 OIL/PANTHE
- P 375028X1 COLLAR-1"
- P Y705582 FLAT WASHE
- P 71408494 CORNER SEA
- P 71408493 CORNER BRK
- P 71408477 SEAL
- P 71409932 PANEL-CLEA
- P 71408492 CORNER BRK
- P ACP0038740 COMPOUND-T
- P 70931317 CARRIAGE B
- P AG554278 CABLE TIE-
- P 522762D1 CARRIAGE B
- P 704247 LOCKNUT-3/
- P *DISCOUNT 10%
- P 1JY86 FLWASH 7/8
- P 22UH84 LKW 5/8
- P 22TC06 BOLT 3/8
- P 1JY31 WASH 5/16
- P 3HDX4 FLNUT 3/8
- P 23KZ61 BOLT 3/8
- P 1JY74 FLW 3/8

Copyright (d) 2014 HBS Systems

Invoice: Preview

COD Date: 06/09/2016

Year Make/Model CHA 670A			Vehicle Identification HP36288			
22979						
	Quantity	List	1	Vet	Total	

			22979				
Cond	OpCode	T Description		Quantity	List	Net	Total
		P 22UH80 LKW 3/8					
		P 23KZ58 BOLT 3/8					
•		P 2CA86 BOLT 5/16					
		P 1JY72 FLWSH 5/16					
		P 3HEE8 NUT 5/16					
		P 2DA91 LKW 5/16					
		P 3HDX3 FLNUT 5/16					
		P 2DA89 LKWASH 1/4					
		P 4FCA9 HEXNUT 1/4					
		P 23KZ56 BOLT 3/8					
		P HAIRPIN HAIR PIN					
		P MSCREW FASTENER			oo stotal charge	s this section	
000		REPLACE FEEDERHOUSE BELT OF	MIE	Jul	notal onal go	o tino occurri	
039		D REPLACE FEEDERHOUSE BELT OF					
		DREPLACE FEEDERHOOSE BEET OF	V ELI I SIDE				
		FREMOVED OLD BELT AND INSTAL	LED NEW BE	LT. TIGHTE	NED UP TO	SPEC.	
	L	L LABOR					
	-	LABOR					
		P 71427255 V-BELT-496					
		P *DISCOUNT 10%					
				Sul	ototal charge	s this section	
040		WEAR PLATE UNDER FRONT BEAT					
		D WEAR PLATE UNDER THE FRONT	BEATER WO	RN OUT			
•		F REMOVED THE BOLTS AND PULLE		E OUT AND	INSTALLED	NEW	
		PIECE WHILE FEEDER HOUSE WA	S OFF				
	L	L LABOR					
		LABOR					
		P 71411435 CHANNEL					
		P AG555843 HEX HEAD B					
		P Y704742 FLANGE LOC					
		P 364246X1 CARRIAGE B					
		P AG520885 HEX FLANGE P SN3984 HEX HEAD B					
		P *DISCOUNT 10%		SUI	ototal charge	s this section	
041		REPLACE CHOPPER DISCHARGE	VANE				
041		D REPLACE ALL CHOPPER DISCHAI					
		DIELEVOLVE OUG. LEU PROGUN					
		F ASSEMBLED CHOPPER VANES AN	ND INSTALLE	D ON NEW	CHOPPER		
	L	L LABOR					
	_	1.4500					

LABOR

P 71393439 DEFLECTOR

Invoice: Preview

COD Date: 06/09/2016

	Year		Make/Model		Vehicle Identification		
		CHA 670A		and the second	HP36288		8
	Stock	No	PO	License	Tag	Customer	Telephone
	229	79					
nd OpCode T	Description	100	Quantity	List	N	et	Total

P 7700461 CARRIAGE B P 700709602 FLAT WASHE P 42906PF LOCK WASHE P 355565X1 HEX NUT-5/ P 71389473 PLATE P 71411971 EXTENSION, P 71411970 EXTENSION. P 7703499 HEX HEAD B P 703579 HEX HEAD B P 42906PF LOCK WASHE P 71389451 PIANO HING P 40501PF HEX CAP SC P 42905PF LOCKWASHER P 704007 HEX NUT-1/ P 71378250 TAILPLATE P 71389474 SHAFT P 71386195 SPROCKET-1 P 70922080 ROLL PIN-5 P *DISCOUNT 10%

Subtotal charges this section

042 HAULING

O TKC CUSTOMER HAULING

46.00

5.00

HAULED COMBINE FROM CUSTOMER LOCATION NEAR WICHITA, KS TO LDI-HUTCHINSON.

4/7/16. TRK. #8 PER STEVE HARREL

Subtotal charges this section

M SHOP SUPPLIES

VISIT US ONLINE AT WWW.LANGDIESELINC.COM

TOTALS I HEREBY AUTHORIZE THE REPAIR WORK TO BE DONE AS DESCRIBED ON MACHINE(S) NAMED HEREON, ALL REPAIR PARTS ARE TO BE BILLED AT YOUR REGULAR PRICES. LAGREE TO PAY CASH FOR SUCH REPAIRS LABOR AND LABOR ON DELIVERY OF MACHINE(S) OR ON TERMS SATISFACTORY TO YOU, AND UNTIL PAID IN FULL. PARTS ANY UNPAID BALANCE SHALL CONSTITUTE A LIEN ON THIS MACHINERY, I FURTHER AGREE TO PAY ALL COURT SUBLET COST, ATTORNEY'S FEES AND EXPENSES ON ANY UNPAID BALANCE COLLECTED THOUGH AN ATTORNEY, AND MISC AGREE THAT YOU WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO SAID MACHINERY FROM FIRE OTHER THEFT OR OTHER CAUSES BEYOND YOUR CONTROL. SUBTOTAL 38242.43 TOTAL Received By

CASH TOTAL (-3%) #page 14 of 14