

CUSTOMER #: 239515
UNIT# 6

62621 236053

INVOICE

PAGE 1

SERVICE ADVISOR:

COLUM	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	00	STERLING LT9511	2FZNEMCB9YAG19861		193782/193792	T6
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
01JAN00	DD01DEC99		17:00 06JUN18		0.00	CASH
R.O. OPENED	READY		OPTIONS:	ENG:Detroit_Series_55_DSL_12L		05JUN18
15:14 30MAY18	18:53 05JUN18					

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL
A DIAGNOSE AND REPAIR TRANSMISSION (MISSING 2 FORWARD GEARS)

13-T1 CHECK FOR TRANSMISSION COMING OUT OF GEAR
1993 CPTX
2081 CPTX

13-T1 REMOVE SHIFT TOWER AND REBUILD
2081 CPTX

20-T1 TEST DRIVE TO VERIFY REPAIRS
2081 CPTX

1 FULK3399 KT BSHG, KIT ISOLATOR BUSHING
1 FUL4305294 GASKET SHIFT TOWER
1 WEL35P152 PTO GASKET

PARTS: 36.34 LABOR: 624.00 OTHER: 0.00 TOTAL LINE A:
disconnected airlines. unbolted shift tower. removed shift tower.
removed pin holding shifter together. pressed out old bushing. pressed
in new bushing. drilled hole through bushing for new pin. assembled
shift tower. installed shift tower with new gasket and connected
airlines.// test drove and drove good, didn't pop out of gear. 1993

B REPLACE WINDSHIELD

16-T1 MISC REPAIRS TO CAB
1993 CPTX

SUBL PO # 273448 REPLACE WINDSJIELD - AUTO GLASS SOLUTIONS
CPTX

PARTS: 0.00 LABOR: 0.00 OTHER: TOTAL LINE B:

C REPAIR LEFT DOOR (DOESN'T OPEN FROM INSIDE CAB)
16-T1 REPAIR LEFT INSIDE DOOR HANDLE

1993 CPTX

1 A1860091000 LATCH LH DOOR
1 FREIGHT FREIGHT

PARTS: 316.80 LABOR: 195.00 OTHER: 0.00 TOTAL LINE C:
inspected latching mechanism, found inner door handle would move
the rod going to latching assembly but wouldn't open the door, exterior

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

PLEASE PAY
THIS AMOUNT

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

door handle would open the door, removed latching assembly and cleaned up, found piece broke inside of latching assembly, ordered new one. got new latching assembly, installed handle rods and lock rod, installed latch, test and worked good but door didn't shut all the way, adjusted striker and worked good. 1993

D COMPLEMENTARY COURTESY INSPECTION

CCI COMPLEMENTARY COURTESY INSPECTION

1993 ICCI

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE D:

found left rear drive wheel seal leaking, front diff flange leaking, steer axle spring pins wore out, city horn inop, washers inop, bridge is missing lights and fender, 2 clearance lights on back inop, all clearance lights on top of cab inop. 1993

CUSTOMER PAY SHOP SUPPLIES FOR REPAIR ORDER

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	1526.09

DEALER, GENERAL MANAGER OR AUTHORIZED PERSON

(DATE)

CUSTOMER SIGNATURE

PLEASE PAY
THIS AMOUNT

1526.09