

Ship to:

Invoice to:

LONGVIEW, IA		
Date	Time	Page
12/05/17	10:50:07 (Q)	03
Account No.	Phone No.	Invoice No.
		K55435
Ship Via	Purchase Order	
Sales Tax Licence No.		
	Salesperson	
	350	

DESCRIPTION

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
050203	BACKHOE	4803	JD310AB316852		
	310A				
R53223			CAP SCREW	18	
R68281			HOSE	1 N	
R74194			SCREW	8	
R81275			GASKET	1	
SUBLETLC			HEAD TEST	1	
TY26575			COOL-GARD TM	4	
TY26661			BREAKIN OIL	4	
	Break-In Plus		Oil 10W30		
T19044			OIL FILTER	1	
	old oil filter				
T20077			RETAINER	25	
T20168			WASHER	18	
1420			BRAKE CLEANER	1	
80065			SEALANT	1	

10400225

SEGMENT TOTAL==>

***** WORK ORDER TO

PARTS
LABOR
SUBLET
ENVIRONMENTAL
SERVICE ACCESSO
CUSTOMER TOTAL

6368.98

Ship to:

Invoice to:

LONGVIEW TX		
Date	Time	Page
12/05/17	10:50:07 (Q)	01
Account No.	Phone No.	Invoice No.
		X55435
Ship Via	Purchase Order	
Sales Tax Licence No.		
	Salesperson	
	350	

DESCRIPTION

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
050203	BACKHOE	4803	JD310AB316852		
	310A				

SEGMENT# 1 5 2696 XMISC 09/20/17 09/25/17 09/29/17
 DIAGNOSE OIL IN WATER

CORRECTION:

PRESSURE TESTED COOLING SYSTEM, FOUND IT WOULD NOT HOLD
 PRESSURE. REPLACED OIL COOLER, FLUSHED RADIATOR SEVERAL
 TIMES TO GET OIL OUT, PROBLEM REMAINS.

FRT	SHIP & HANDLING	2
JD5626	LABEL	1
RE31929	OIL COOLER	1 N
R99802	HOSE	2
T19044	OIL FILTER	1
	old oil filter	
T71709	LABEL	2

SEGMENT TOTAL==>

10400225

SEGMENT# 2 5 2721 XMISC 09/20/17 10/04/17 09/29/17
 DIAGNOSE RIGHT STABILIZER LEAKING DOWN 1.00 1.00

CORRECTION:

DID BY-PASS TEST ON CYLINDER, FOUND STABILIZER CYLINDER
 BY-PASSING. REMOVED CYLINDER. CUSTOMER PROVIDED NEW
 CYLINDER, INSTALLED CYLINDER.

FRT	SHIP & HANDLING	1	PARTS
			LABOR

SEGMENT TOTAL==>

10400225

SEGMENT# 3 5 INTER XMISC 09/20/17 10/04/17 09/29/17

CONTINUED ON PAGE 02

Received By _____

Ship to:

Invoice to:

Date	Time	Invoice No.
12/05/17	10:50:07 (Q)	02
Account No.	Phone No.	K55435
Ship via		Jer
Sales Tax Licence No.		
	Salesperson	350

DESCRIPTION

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS
050203		4803 JD310AB316852		
BACKHOE				
310A			1.00	1.00
DIAGNOSE TACH NOT WORKING				
<u>CORRECTION:</u>				
REPLACED TACH CABLE, TESTED TACH EVERYTHING WORKS AS IT SHOULD.				
AT32915		CABLE	1 N	
FRT		SHIP & HANDLING	1	
				PARTS
				LABOR
		SEGMENT TOTAL==>		
10400225				

SEGMENT#	4	5	2721	XMISC	09/20/17	09/25/17	09/29/17	18.00	18.00
INFRAME ENGINE									
<u>CAUSE:</u>									
ELECTROLYSIS ON LINERS.									
<u>CORRECTION:</u>									
REMOVED ALL COVERS, HOOD, DRAINED OIL, AND ANTIFREEZE.									
REMOVED HEAD, OIL PAN, PISTON, LINERS, AND BEARINGS. HEAD WAS PRESSURE TESTED, AND CHECKED FOR FLATNESS.									
CLEANED ALL SURFACES, REPLACED PISTONS, LINERS, AND BEARINGS, CHECKED LINER PROTRUSION, IT WAS WITHIN SPEC.									
ASSEMBLED ENGINE, TORQUED ALL BOLTS TO SPEC, FILLED WITH OIL AND ANTIFREEZE, RAN MACHINE. SAW NO LEAKS OR PROBLEMS, INSTALLED ALL COVERS.									
AT17387				FILTER ELE				1	
AT27622				CAP *				4 N	
FRT				SHIP & HANDLING				2	
L0034094				LUBE				1	
RE32011				O-RING KIT				4	
RE527293				ENGINE OVERHAUL				1	
Engine Overhaul Kit									

CONTINUED ON PAGE 03