

Customer: 6000

H&K PLUMBING

RO: C104443

Unit: 6J340928

Subtotal Parts:

Problem #10**Customer**

COMPLAINT:

WELD PTO BRACKET AND PAINT.

CORRECTION:

WELDED PTO BRACKET AND PAINTED AND REINSTALLED.

LABOR

PARTS:

	List	Unit	04 T/C	Ext	Price
1.00	FLTACBC185	4.44	01		
2.00	CLEANER.FLEETRITE CHLORINATED		01		
2.00	CHASP983 PAINT BLACK GLOSS		01		
	30755R1 NUT				

Subtotal Labor:

Subtotal Parts:

Problem #11**Customer**

COMPLAINT:

REPLACE CAB BUSHINGS

CORRECTION:

REMOVED FENDERS ON BOTH SIDES, REMOVED AIR HOSES FROM ABS
BRAKE MODULE AND HARNESS. JACKED UP CAB AND REMOVED OLD
BUSHINGS,REINSTALLED NEW WITH HARDWARE.REINSTALLED RELATED
PARTS.

LABOR

PARTS:

	List	Unit	04 T/C	Ext	Price
5.00	BDT18108X CABLE TI		01		
5.00	BDTC24706 CABLE TI		01		
4.00	31075R1 BOLT		01		
4.00	30756R1 NUT		01		

Subtotal Labor:

Subtotal Parts:

Problem #12**Customer**

COMPLAINT:

STORAGE FEES. WORK COMPLETED 05/02. CUSTOMER NOTIFIED.
STORAGE FEES STARTED 05/13-\$25.00 PER DAY/\$125.00 PER WEEK.

OTHER:

	List	Unit	04 T/C	Ext	Price
STORAGE 5/13-5/19			01		125.00*
STORAGE 5/20-5/26			01		125.00*
STORAGE 5/27-6/2			01		125.00*
STORAGE 6/3-6/9			01		125.00*
STORAGE FEES 05/27-05/31			01		125.00*
STORAGE JUNE 2019			01		500.00*
STORAGE JULY 2019			01		575.00*
STORAGE AUGUST 2019			01		550.00*

Subtotal Other:

2250.00

Total Labor:

10,734.40

Total Parts:

7,488.21

Total Other:

2250.00

REPAIR ORDER SUBTOTAL

20,472.61

TOTAL MISC. SUPPLIES

DEDUCTIBLE

*SALES TAX

Customer: 6000 H&K PLUMBING RO: C104443 Unit: 6J340928

1.00	FUL4305294 GASKET	01
4.00	PTX09979	01
	RED THREADLOCKER SQUEEZE TUBE	
2.00	BDT23846 TERM BOW	01
6.00	BDTC24706 CABLE TI	01
2.00	732509 WIRE WHITE 14GA	01
1.00	BDT42405 10MM X1.5 NUT	01
1.00	BDT42454 METRIC L	01
2.00	2506705C1 CLAMP; RAD. SHRINK, 2.50"	01
1.00	LF9025 LUBEFILT- SEE	01
6.00	ZSH9404206021G	01
	ANTI FREEZE 50/50 PREMIX ELC r	
2.00	ZSH9404206021G	01
	ANTI FREEZE 50/50 PREMIX ELC r	
1.00	NT26025BLK 5/32 NYLON AIR TUBING	01
2.00	31072R1	01
	BOLT M12 X 120 PHC CL 10.9 FL	
2.00	3574678C1 BUSHING	01
1.00	1833096C95 KIT	01
1.00	1836243C1 GASKET	01
1.00	1812559C1 SEAL	01
1.00	690835C1 CLAMP	01
1.00	1842730C3 RING	01
1.00	1841938C1 SEAL	01
1.00	1886793C2 GASKET	01
1.00	1842623C96 KIT, TURBO MOUNTING	01
1.00	3520250C2 ELBOW	01
10.00	BDT07480 3M SURF	01
2.00	FLTACBC185	01
	CLEANER.FLEETRITE CHLORINATED	
10.00	BDT18108X CABLE TI	01
10.00	BDTC24706 CABLE TI	01
11.00	1841365C3 BOLT	01

Subtotal Labor:

Subtotal Parts:

Problem #08**Customer**

COMPLAINT: REPAIR EXHAUST MANIFOLD LEAK.

CORRECTION: REMOVED OLD MANIFOLD AND BOLTS HAD TO EXTRACT TWO BROKEN BOLTS.REINSTALLED NEW MANIFOLD AND NEW BOLTS.TESTED OK.

LABOR:

PARTS:	List	Unit	T/C	Ext	Price
1.00	1842351C1 GASKET		04		
			01		

Subtotal Labor:

Subtotal Parts:

Problem #09**Customer**

COMPLAINT: FAN HUB BEARINGS ARE VERY LOUD AND GRINDING.

CORRECTION: REMOVED FAN HUB TO GAIN ACCESS TO FRONT COVER AND NOTICED THE BEARINGS ARE GRINDING AND HARD TO TURN.REPLACED FAN HUB.

LABOR:

PARTS:	List	Unit	T/C	Ext	Price
1.00	HOR994931 NUT		04		
1.00	HOR99A4927		04		
	DRIVE.ASSY SHEAVE 8 PK 201.2 O		04		

Subtotal Labor:

Customer: 6000

H&K PLUMBING

RO: C104443

Unit: 6J340928

Subtotal Labor:

Subtotal Parts:

Problem #05**Customer**

COMPLAINT: COOLANT LEAK FROM ENGINE AREA.
CORRECTION: PRESSURE TESTED COOLING SYSTEM. FOUND COOLANT LEAKING AT THE THERMOSTAT HOUSING AND COOLANT HOSE. DRAINED DOWN COOLANT. REPLACED THE T-STAT SEAL AND TWO HOSES. REASSEMBLED AND FILLED COOLING SYSTEM WITH RECOVERED COOLANT. TOPPED OFF THE SYSTEM AND PURGED ALL AIR FROM THE SYSTEM. TESTED FOR LEAKS-OK. RAN TO OPERATING TEMP AND CHECKED TEMPERATURES-ALL WITHIN SPEC-OK.

LABOR:							
PARTS:		List	Unit	T/C	Ext	Price	
1.00	1841771C1 SEAL			01			
1.00	1844215C2 TUBE ASSY WATER OUTLET			01			
3.00	2506704C1 CLAMP; RAD. SHRINK, 2.25"			01			
1.00	3583399C1 HOSE			01			
1.00	1841227C1 GASKET			01			
1.00	1841301C1 TUBE			01			
1.00	1842662C91 KIT			01			
1.00	1842663C93 KIT			01			
1.00	1845232C1 ELBOW			01			
1.00	1847539C91 ELBOW			01			
1.00	3596503C1 CLAMP			01			

Subtotal Labor:

Subtotal Parts:

Problem #06**Customer**

COMPLAINT: DIAGNOSE OIL LEAK AND ADVISE. WITH ESTIMATE.
CORRECTION: STEAMED CLEAN ENGINE AREA FROM BELOW TO FIND OIL LEAKS. REAR MAIN IS LEAKING, FRONT COVER IS LEAKING AND AIR COMPRESSOR. APPROVED TO REPAIR FROM DUSTIN TO LJC. 04/17/19

LABOR: 04
 Subtotal Labor:

Problem #07**Customer**

COMPLAINT: R&R FRONT COVER/REAR COVER GASKET/FRONT CRANK SEAL. DIP STICK TUBE SEAL. REAR CRANK SEAL. TURBO MOUNTING KIT.
CORRECTION: REMOVED FRONT ENGINE ASSEMBLY TO GAIN ACCESS TO FRONT COVER. REMOVED FRONT & REAR COVERS. CLEANED AREA AND REINSTALLED WITH NEW SEALS & GASKETS. ALSO REPLACED FRONT CRANK SEAL AND DIP STICK TUBE SEAL. HAD TO REMOVE OIL PAN TO REMOVE FRONT COVERS. REINSTALLED OIL PAN WITH NEW GASKET. REMOVED TRANSMISSION AND REMOVED OLD CRANK SEAL. REINSTALLED TRANSMISSION AND RECHECKED FOR LEAKS ALL TEST OK.

LABOR:							
PARTS:		List	Unit	T/C	Ext	Price	
10.00	BDTC24706 CABLE TI			01			
2.00	1014312 3/4" MASKING TAPE YELLOW			01			
2.00	3549169C2 INSULATR			01			
1.00	7652677 GRAY RTV			01			
1.00	3669086C2 BEARING			01			

Printed: 9/9/2019 2:15 pm

Customer: 6000 H&K PLUMBING RO: C104443 Unit: 6J340928

1.00	1842382C2 GASKET	01
1.00	PTX09979	01
1.00	RED THREADLOCKER SQUEEZE TUBE	01
1.00	100FR FREIGHT-INTERNATIONAL	01
2.00	BDT40901 EXTEND P	01
2.00	BDTC85878 HARDENED	01
2.00	2506705C1 CLAMP; RAD. SHRINK, 2.50"	01

Subtotal Labor:

Subtotal Parts:

Problem #02**Customer**

COMPLAINT: FUEL GAUGE IS INOP.
 CORRECTION: VERIFIED CONCERN. PERFORMED DIAG AND TRACED CONCERN TO THE FUEL TANK SENDER-SENDER BROKEN WITH PIECES IN THE TANK. RECOVERED THE FUEL. REMOVED THE TANK AND FISHED OUT THE BROKEN SENDER PIUECES. REPLACED SENDER ASSY AND REASSEMBLED COMPLETE. FILLED TANK WITH RECOVERED FUEL AND TESTED SENDER AND GAUGE-OK.

LABOR			04		
PARTS:		List	Unit	T/C	Ext Price
1.00	1842626C96 KIT			01	
1.00	6132734C91			01	
	GAUGE.FUEL SENDER. 23 INCH. 33				

Subtotal Labor:

Subtotal Parts:

Problem #03**Customer**

COMPLAINT: GREASE, OIL, FILTER, 30 POINT INSPECTION
 CORRECTION: PERFORMED GOF AND 30 POINT INSPECTION. ITEMS FOUND ON THE PM INSPECTION: MULTIPLE BOX LIGHTS INOPERATIVE, ENGINE OIL OR COOLANT LEAK, FRONT DRIVE AXLE AIR BRAKE HOSE CHAFED,MISSING GREASE ZERK AT THE LIFT AXLE TIE ROD, TAG AXLE BRAKE LININGS AT 20%, DRIVE AXLE BRAKES OUT OF ADJUSTMENT, GREASE ZEK MISSING ON THE CLUTCH CROSS AHFT, R/S STEER AXLE HUB LOW ON LEAK, STEER AXLE BRAKE LININGS AT 25%, MUDFLAPS TOO SHORT TO BE DOT LEGAL, ENGINE AIR FILTER DIRTY, RIGHT FWD DRIVE AXLE FLANGE GASKET LEAKS.

LABOR: GOF			04		180.00
PARTS:		List	Unit	T/C	Ext Price
1.00	LF9025 LUBEFILT-	SEE		01	
32.00	OIL QUARTS OF OIL T5			01	
3.00	GR GREASE LBS.			01	

Subtotal Labor:

Subtotal Parts:

Problem #04**Customer**

COMPLAINT: REPLACE FUEL FILTER
 CORRECTION: REPLACED FUEL FILTER CARTRIDGE

LABOR: FUEL			04		
PARTS:		List	Unit	T/C	Ext Price
1.00	1842638C92			01	
	KIT SEE L9684F ALSO FS19684E				

Printed: 9/9/2019 2:15 pm

CUST# 6000

C.O.D

RO# C104443
 START 4/1/19 12:13
 BILLED 9/9/19 14:15
 PO# COD
 WRITER LJC
 APPROVAL DUSTIN
 PROMISED 0/0/00
 DEDUCTIBLE

PHONE:

Service Unit

OWNER: 6000 UNIT# 6J340928 2006 INTL 7500 SFA 6

CURR MI 221,898.0
CURR HR 75,950.0

PROD DT: 12/7/05
 DELIVERED: 12/5/06
 VIN: 1HTWPAZT46J340928
 DOT INS:

ENGINE: HT570 340HP
 SERV. CONT:

8R7636

Unit Warranty

WARRANTY EFF: 12/5/06 EXT: N

UNIT: 23
 ENG: 570HM2U2097360

EXP: 0/0/00
 EXP: 0/0/00

Repair Order Details**Problem #01****Customer**

COMPLAINT: VERIFIED FAILED INJECTORS. ADVISED CUSTOMER AND REPLACED ALL 6 INJECTORS AND RESEALED THE HP OIL RAIL. DURING REASSEMBLY, FOUND THE ENGINE BRAKE HYDRA FORCE VALVE FAILED. REPLACED THE VALVE AND COMPLETED REASSEMBLY. CLEARED CODES

CAUSE: 08/22/19 ljc spoke with dustin and he said they would be in next week to pay off truck.

CORRECTION: VERIFIED FAILED INJECTORS. ADVISED CUSTOMER AND REPLACED ALL 6 INJECTORS AND RESEALED THE HP OIL RAIL. DURING REASSEMBLY, FOUND THE ENGINE BRAKE HYDRA FORCE VALVE FAILED. REPLACED THE VALVE AND COMPLETED REASSEMBLY. CLEARED CODES AND TESTED-OK.

LABOR**PARTS:**

	List	Unit	04 T/C	Ext	Price
6.00	5010659R92		01		
	INJECTOR ASSY. REMAN 570 HIGH				
6.00	5010659R92 (CORE CHARGE)		01		
1.00	1822135C1 RING		01		
6.00-	5010659R92 (CORE CREDIT)		01		
1.00	1844402C1 VALVE		01		
1.00	100FR FREIGHT-INTERNATIONAL		01		
4.00	BDT40923 EXTEND P		01		
2.00	FLTACBC185		01		
	CLEANER,FLEETRITE CHLORINATED				
5.00	PABS030 ABSORBANT PADS - INDIVIDUAL		01		
3.00	1850815C2		01		
	BOLT DAMPER M12 X 40MM X 1.25				
2.00	1845040C1 STUD		01		
2.00	1842603C1 BOLT		01		
1.00	1845004C92 MANIFOLD		01		

Signature: _____ Printed Name: _____ Date: _____