

Repair Invoice

2009 International 7400
FP9299

A 3033

Invoice

COP

3033

BILL TO

INVOICE #	DATE	TOTAL DUE	ENCLOSED
	03/19/2021	\$13,724.09	
ITEM			
IH 7400			
DESCRIPTION	QTY	RATE	AMOUNT
RANGE INHIBIT LIGHT ON check oil level and check for burnt smell nothing found. Inactive fault code PO894 component slipping. check main pressure within spec. Check pressures on first gear and reverse. Pressure within spec. Fault code 894 became active in reverse. C3 clutch failed. Replaced turbo and exhaust manifold; extracted 3 bolts, drilled and helicoiled one hole. Replaced freeze plug behind exhaust manifold. Replaced transmission, lengthened driveline to accommodate used transmission length difference. Replaced EGR valve and manifold.	42.50		
Shop Supply	1		
ELC COOLANT PER GALLON	4		
U-joint strap kit; mobil delvac 1 ATF	1		
hanger bearing; tubing; 6" wide 1710 1/2rd; nut 1-1/4 18 sl.; washer 1.281 I.D.	1		
manifold assy exhaust; nut flange; gasket exhaust single layer; bolts prev torque; studs, prevailing torque bolttube assy ebp sensor; sensor ebp; clamp; o-ring; plug cup; gasket, exhaust manifold; stud turbo adapter;	1		
kit, reman turbo 570 md; clamp; heat exchanger; tube; o-rings; tube turbo oil drain; clamp; valve assy, EGR w/ manifold	1		
Transmission (2009 International DURASTAR (4300)	1		
VH Freight transmission in and core return	2		
Email us at	to recieve your	BALANCE DUE	\$13,724.09
invoices via email with online payment options!			

A finance charge will be added to any balances not paid within 30 days.