

## INVOICE

62181

Org. Est. # 176104

## Invoice from History

Printed Date: 09/13/2021

Work Completed: 01/20/2021

2005 Isuzu - NPR - 6.0 Gas

Lic #:

Odometer In : 78530

Odometer Out : 78540

VIN #: 4KLB4B1U7 5J803707

Part Description	Qty	Sale	Ext	Labor Description	Ext
Blind Spot Mirror	2.00			The customer stated the heat was working well then started not working and the temp gauge is getting hot. Also would like round spot mirrors replaced and insert above right headlamp replaced	
Right headlamp upper insert	1.00			Test and inspect engine overheat and heater not working	
Cylinder Head Bolt Set	2.00			The technician noted	
Cylinder Head Gasket Set	1.00			We were able to duplicate customers concern, the coolant level is full and there are no external leaks, there was stop leak in this system prior to first visit, there is signs of internal combustion leak and restricted flow in radiator recommend remove heads and have pressure tested and replace gaskets. Would also replace radiator due to stop leak in system	
Radiator	1.00			Replace spot mirrors	
Detonation Knock Sensor	2.00			Replace insert above right headlamp	
Radiator Cap - Safety Type	1.00			Remove and replace cylinder head gaskets	
Coolant Temperature Sensor	1.00			Machine shop	
Spark Plug - Double Platinum	8.00			Gold Coolant System Service & Flush	
Spark Plug Wire Kit - Premium	1.00			Inspect radiator cap, Inspect belts & hoses,	
Gold Antifreeze Extended Life 50/50	4.00			Inspect cooling fan operation,	
VPS Coolant Flush Kit	1.00			Pressure test for leaks	
Hose Clamp	1.00			Pressure test coolant system after flush is complete	n/c
SAE 5W30 Univr Oil Co, Eco Ultra	6.00			Environmental Handling Fee	
Syn Blend API SN				Premium Oil Change & Lube	
Oil Filter	1.00			Replace Oil & Filter, Inspect Oil Level, Inspect Tire Pressure, Lube Chassis, Hinges, Locks, Grease Zerts, Inspect Vent Temperature, Perform Multipoint Inspection	
Water Pump - New	1.00			Reset Oil Change Light (if applicable)	n/c
Shop Supplies				Oil & Filter Recycling Fee	
				Remove and replace water pump	
				***Vehicle Memo***	
				***Disclaimer for Commercial Vehicles:	
				6 Months Warranty on Parts, 90 Day Warranty on Labor, Warranty described below does not apply to any Commercial Vehicle.***	



## INVOICE

62181

Org. Est. # 178104

## Invoice from History

Printed Date: 09/13/2021

Work Completed: 01/20/2021

2005 Isuzu - NPR - 6.0 Gas

Lic # :

Odometer In : 78530

Odometer Out : 78540

VIN # : 4KLB4B1U7 5J803707

Part Description	Qty	Sale	Ext	Labor Description	Ext
------------------	-----	------	-----	-------------------	-----

[ Payments - Debit Card - \$5,271.00 ]

Vehicle Received: 1/20/2021

Customer Number : 22153

I hereby authorize the above repair work to be done along with necessary material & hereby grant you &/or your employees permission to operate the vehicle herein described on street, hwy's or elsewhere for purpose to test &/or inspect. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. Warranty on parts & repair labor is 2 years or 24,000 miles unless otherwise stated. Dealer Parts, Value line & LOF excluded. Warranty must be performed in our shop, cannot exceed original cost of repair.

Signature \_\_\_\_\_ Date \_\_\_\_\_

Labor:

Parts:

Sublet:

SubTotal:

Tax:

Total: 5,271.00

Bal Due: \$0.00



## INVOICE

62062

Org. Est. # 175956

## Invoice from History

Printed Date: 09/13/2021

Work Completed: 12/23/2020

2005 Isuzu - NPR - 6.0 Gas

Lic # :

Odometer In : 78451

Odometer Out : 78451

VIN # : 4KLB4B1U7 5J803707

Part Description	Qty	Sale	Ext	Labor Description	Ext
Hazard switch	1.00			The customer stated the blinkers are stuck on and the heater is not working also inspect tires and all fluids and change oil	
Flasher	1.00			Test and inspect blinker issue	
Butt Connector	12.00			The technician noted	
Pig Tail (P)	1.00			The hazard switch is missing and a toggle switch has been installed with other wiring recommend remove extra wiring and replace switch and flasher	
Replay Connector	1.00			Remove wiring and install correct hazard switch	
Retainer	5.00			Remove front rack	
Light Bulb	2.00			Remove and replace front turn signal bulbs	
Gold Antifreeze Extended Life 50/50	2.00			After installing switch and rewiring the turn signal and emergency flashers are working	
Transmission Input Speed Sensor	1.00				
Heater core	1.00			There is heat in the cab however the mode from floor to defrost will not work recommend diagnose	
Thermostat - Standard - OE Temp	1.00				
Freon - oz	4.00			The check engine light is on recommend diagnose	
R134A Compressor Oil - oz	2.00			Scan test, retrieve computer codes	
Shop Supplies				Inspect and test for failed components	
				The technician noted the codes in the computer are P0327 Knock Sensor A circuit low P0717 Input speed sensor a no signal Recommend replace input speed sensor first and retest for other codes	
				Test and inspect HVAC mode operation	
				The technician noted	
				The coolant level was low once we added coolant the modes do not switch will require removing heater box to repair	
				The technician noted	
				We followed cable to the heater box and found adjuster is seized we attempted to manually move and there is obstruction inside heater box will require removing box and opening up to find issue	
				Remove and replace transmission input speed sensor	
				Remove HVAC box and open for repair	
				Once we opened heater box we found heater core is not flowing and there is debris in the door system recommend replace heater core and free doors	
				The technician noted	
				The thermostat is not closing allowing engine to get to operating temperature recommend replace	
				Remove and replace thermostat	
				A/C Reclaim, Evacuate and Recharge System	

Technician  
 Name: [Redacted]  
 Title: [Redacted]  
 Signature: [Redacted]



## INVOICE

62062

Org. Est. # 175956

Work Completed: 12/23/2020

2005 Isuzu - NPR - 6.0 Gas

Lic # :

Odometer In : 78451

Odometer Out : 78451

VIN # : 4KLB4B1U7 5J803707

Qty	Sale	Ext	Labor Description	Ext
-----	------	-----	-------------------	-----

Identify Freon, Document pressure prior to service, reclaim, evacuate and recharge system to proper specification, Test system operation, Measure duct temperature, Evaluate vent operation.

Pre-Service Pressure: Low \_\_\_\_\_ High \_\_\_\_\_  
After Service Pressure: Low \_\_\_\_\_ High \_\_\_\_\_

Duct Temperature: \_\_\_\_\_

Vent Operation OK: Y \_\_\_\_\_ N \_\_\_\_\_

Belt Condition OK: Y \_\_\_\_\_ N \_\_\_\_\_

(Loss of refrigerant is not a warranty covered item.)

The technician noted

On final road test the check engine light did come back on with knock sensor codes recommend replace knock sensors

Labor:  
Parts:

SubTotal:

Tax:

Total: 2,648.34

Bal Due: \$0.00

[ Payments - Visa - \$2,648.34 ]

Vehicle Received: 12/3/2020

Customer Number : 22153

I hereby authorize the above repair work to be done along with necessary material & hereby grant you &/or your employees permission to operate the vehicle herein described on street, hwy's or elsewhere for purpose to test &/or inspect. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. Warranty on parts & repair labor is 2 years or 24,000 miles unless otherwise stated. Dealer Parts, Value line & LOF excluded. Warranty must be performed in our shop, cannot exceed original cost of repair.

Signature \_\_\_\_\_

Date \_\_\_\_\_