DN2412

Estimate

Date:

3/27/2020

Amount

Authorizer

Rate

Bill To

Parts #36 Hose Clamp - 87142 - A

Parts Clean and repair radiator - 49793 - A

Remit Payment To

Service Writer

Quantity

Service Order Purchase Order Item Description Complaint: Engine has low power OOS Cause: Worn out, told to remove engine Type: Other Labor Correction: Engine / Overhaul / Removed engine and transmission. Transferred all parts to used bus engine. Installed engine and transmission. Parts Gasket - 6D1004 - A Parts Water Pump - 20R-0586 - A Parts Engine Mount - A123160 - A Parts Freight - Freight - A Parts Belt Tensioner - 38509 - A Parts Hex Nut - 10242 - A Parts Oil Tube Seal - 101A/29546229 - A Donaldson filter - P553202 - A Parts Parts Transmission Filter - PT9415MPG-K1TJAB - A 1/4 Flat Washer - FA88445 - A Parts 15.25 black cable tie - 94613 - A Parts 1/2 Strap & Bolt Kit - 6.5-70-18X - A Parts Ribbed Belt - 735K7D1070735 - A Parts Belt - 9335 - A Parts Gp Seal - 222-3909 - A Parts GP Seal - 245-7339 - A Parts Bushing kit - AM225 - A Parts Foam Clean - 96030 - A Parts Cat oil filter - 1R-1807 - A Parts Cat oil filter - 1R-0751 - A Parts M12 Lock Washer - 80278 - A Parts 1" cable clamp - 17015 - A

Description Quantity Rate Amount M6x1.0x20mm Cap Screw - 10204 - A 5/16 Flat Washer - FA88446 - A M8 Flat Washer - 87510 - A M12x1.75x25mm Cap Screw - 62693 - A Parts M12 Lock Washer - 80278 - A Parts M6 x 10 Hex Nut - 10240 - A Parts M6 Flat Washer - 87508 - A Parts M6x1.0x25mm Cap Screw - 10205 - A 3/8 Flat Washer - FA88447 - A Parts M8x1.25x30mm Cap Screw - 10215 - A Parts 1/4 Drain valve w/5' cable - 12105MT - A A/C oring - M96-2123 - A Parts Parts Lamp. model 15 - 15200R - A 15.5" black cable tie - 94611 - A Parts 1/2 tube x 1/2 pipe brass male elbow - 84288 - A Blue butt connector - 92823 - A Parts Parts 15.25 black cable tie - 94612 - A Parts 1/2-20x3/4 G8 Cap Screw - FA68001 - A Parts Lamp, 2.5" red LED round - M11300R - A Clearance Marker Pigtail - 94902 - A 1/4 Flat Washer - FA88435 - A Parts Parts 1/4 Lock washer - FA528A - A 1/4 Flat Washer - FA88445 - A Parts Cap, fuel tank - FRTCB - A Subtotal \$6,444.72 Complaint: Replace Data link connector

Cause: Customer request (Inspection)

Labor Correction:

Chassis / Chassis / Aquire Data link connector from old school bus, Pull Cat wiring schematics from SIS. Located pin locations and ran wires for data link. Mounted data link connector and tested all is good.

Parts ATO 30 green fuse - 84790 - A

Parts Socket - 1261768 - A

Parts Red butt connector - 92822 - A

Parts Blue butt connector - 92823 - A

Parts ATO 5 tan fuse - 83025 - A

Parts 1/4" stud blue ring terminal - 25263 - A

Parts Blue w/brass sleeve butt connector - 94728 - A

Parts .250" tab blue male quick slide - 25287 - A

Parts Connector Kit - 48215 - A

Parts Window Handle - 76945 - A

Parts Cable - 43-RVC-84 - A

	Description	Quantity	Rate	Amount
Parts	9/16 G8 Lock Nut - 53984 - A			
Parts	15.25 black cable tie - 94612 - A			
Parts	M8x1.25x20mm Cap Screw - 10213 - A			
Parts	3/32 x 1 Cotter Pin - 1010 - A			
Parts	1/4-20 G8 Hex nut - FA68400 - A			
			Subtotal	\$113.61
Comp	laint: Add fire extinguisher		The second secon	
Cause	e: Missing (Inspection)			
Labor	Correction: Chassis / Cab / Install fire extinguisher			
Parts	Fire Extinguisher W/ Bracket - 466422 - A			
			Subtotal	\$163.63
1 8 1 - 100	Shop Supplies			
Unit:	AT51 VIN: 1GBT7H4C4WJ111234	Labo	or	
	sis: 376,592 Miles	Parts	s	
		Subt	total	
		Total	ı	\$7,196.80

Date:

2/1/2021

Bill To

	Service Order	Purchase Order	Service Writer	Autho	rizer
tem	Description		Quantity	Rate	Amount
Compl	laint: Preform Complete Service)			
Cause	: Unit due for service				
Labor	Correction: Engine / Filters / Preform com	plete service and repair multiple air leaks			
Parts	Filter, fuel, Fleetguard - FF532	24 - A			
Parts	Fleetguard lube filter - LF667	- A			
Parts	Filter, fuel, Donaldson - P5532	202 - A			
Parts	3/8 tube brass sleeve - 84322	-A			
Parts	3/8 tube brass nut - 84327 - A				
Parts	Filter, air, Fleetguard - AF487	B - A			
Parts	3/8 tube brass union - 84254	- A			
				Subtotal	\$452.55
processor Medican	Shop Supplies				
	AT51 VIN: 1GBT7H4C4WJ111	234	Labor		
Chassis: 376,592 Miles			Parts		
			Subtota	al	
			Total		\$507.79

Date:

2/16/2021

Bill To

	Service Order	Purchase Order	Service Writer	Au	thorizer
ltem	Description		Quantity	Rate	Amount
PM: Fe	deral Annual DOT Inspection	n			
Cause:	PM Due				
Labor	Correction: Chassis / Chassis / Federa	al Annual DOT Inspection			
Parts	Turn Signal Lever - 49277	- A			
				Subtotal	\$119.89
Compl	aint: Mount Fire extinguishe	r			
Cause:	Missing (Inspection)				
Labor	Correction: Chassis / Cab / Install new	v fire extinguisher and mount			
Parts	Wiper Switch - DS494 - A				
				Subtotal	\$150.29
Compl	aint: PS leak				
Cause	: Bad hose (Inspection)				
Labor	Correction: Engine / Lubrication / Rep	lace hose			
Parts	Metric Male connector - Al	DM18X1.5MWO-8MJ - A			
Parts	Power Steering Hose - ho	se - A			
				Subtotal	\$276.60
Compl	aint: Major Oil leak				
Cause	Customer request (Inspection))			
Labor	Correction: Engine / Lubrication / Res	eal top side of engine			
Parts	Cancel Cam - 83232 - A				
Parts	Triple Lok - V5OX-S - A				
Parts	#8 x 1 hex head screw - P	28961 - A			
Parts	3/4" cable clamp - 17011 -	A			
				Subtotal	\$1,013.47

Description	Quantity	Rate	Amount
Shop Supplies			
Unit: AT51 VIN: 1GBT7H4C4WJ111234 1998 Chevrolet C7 Chassis: 376,592 Miles	Labor		
Citasers. 370,002 miles	Parts		
	Subtotal		
	Total		\$1,724.99

Date:

5/12/2021

BIII To

Remit Payment To

Authorizer Service Writer Purchase Order Service Order Amount Rate Quantity Item Description Complaint: Unit got hit by a skid steer on job site Cause: Inspect truck for damage Type: Unscheduled repair Labor Correction: Chassis / Cab / Inspected the front suspension and measured the steer axle placement. Nothing looks to have moved. The hood has moved back approximately 1/4". This is allowing the door on the passenger side to hit the hood when the door is opened and closed. The hood was adjusted several times to try to get the clearance better. Due to the bushings on the hood pivot point being pretty much gone the proper adjustment could not be obtained. The bushings will need to be replaced to get the hood to adjust correctly. All of the fluids were checked. The engine oil was right at two gallons low. It was topped off. All of the brakes were adjusted as they were a ways out of spec. The clevis pin on the left rear drive axle was coming out as the cotter pin is missing. The pin was reinstalled and a new cotter pin installed. ADVISED THE DRIVER TO NOT OPEN THE PASSENGER DOOR UNTIL THE HOOD PIN BUSHINGS CAN BE REPLACED. Parts 15W40 - 10000004634 - A Labor Tow Unit to Apex - A Parts 7/64 x 1 Cotter Pin - 1021 - A Subtotal \$545.93 Shop Supplies Unit: AT51 VIN: 1GBT7H4C4WJ111234 Labor 1998 Chevrolet C7 Chassis: 376,592 Miles Parts Subtotal Total \$573.55

Date:

6/10/2021

Bill To

	Service Order	Purchase Order	Service Writer	Autho	orizer
Item	Description		Quantity	Rate	Amount
Comple	aint: Jerry Rig A Turn Sig	nal Switch			
Cause:	Turn signal switch not op	erating properly Type: Damage caused by driver			
Labor	Correction: Chassis / Lighting & Ele	ectrical / Repair turn signal switch			
Parts	Cancel Cam - 83232 - /	4			
Parts	Dimmer Switch Connec	tor - HP3920 - A			
Parts	Dimmer Switch - DS72	- A			
Parts	Freight - Freight - A				
Parts	Steering Column - 238-	01457 - A			
Parts	.250" tab blue male qui	ck slide - 25287 - A			
Parts	.250" tab blue female q	uick slide - 81114 - A			
Parts	.250" tab blue female d	sc. flag - 88735 - A			
				Subtotal	\$740.67
	Shop Supplies				
	T51 VIN: 1GBT7H4C4W	/J111234	Labor		
1998 Chevrolet C7 Chassis: 376,592 Miles		Parts			
			Subtotal		
			SEDCO (7	.5000% of \$629.64)	
			Total		\$823.53

Date:

7/13/2021

Bill To

Remit Payment To

Total

\$515.77

Authorizer Service Writer **Purchase Order** Service Order Amount Rate Quantity Item Description Complaint: Diag. and Repair the Blower Motor and the Power Port are Inop. Cause: Blower motor mounts and fan broke Chassis / Chassis / Remove old blower motor and replace with new . Test blower motor Labor Correction: operation Parts Blower Motor - PM149 - A Parts Charge Fitting - 75R5813 - A \$325.51 Parts Charge Fitting - 75R5814 - A Subtotal Complaint: Repair Tarp Cause: Rear cross bar broke Type: Unscheduled repair (Inspection) Chassis / Chassis / Unroll tarp remove old cross bar and replace with new . Roll tarp in and check operation of tarp Parts 3 Stud Red lamp - 53702 - A 10-24x3/4 Machine Screw - 90083 - A #10 flat washer - 511 - A #8 x 1 hex head screw - P28961 - A Parts A/C seal - MT0177 - A \$141.92 Subtotal Shop Supplies Labor Unit: AT51 VIN: 1GBT7H4C4WJ111234 1998 Chevrolet C7 **Parts** Chassis: 376,592 Miles Subtotal

Date:

7/29/2021

Bill To

Remit Payment To

Quantity

Service Order

Purchase Order

Service Writer

Authorizer Travis Littlejohn

Rate

Item Description

Complaint: Repair Transmission Leak

Cause: Fitting for pto came loose Type: Unscheduled repair

Labor Correction:

Transmission / PTO / I spent an hour washing the truck pulled into the bay had lester engage the pto and found a fitting leaking. Tightened the fitting and verified repair. Topped off oil and returned the truck to service note the driver needs to check oil level in the morning. Also theres added time on this OP for helping lester with the paccar software on truck 52 and checked a coolant leak on truck 45. Washed truck after repair

Parts 21C Synzol HD ATF - 10000004872 - A

Subtotal

\$370.04

Amount

Shop Supplies

Unit: AT51 VIN: 1GBT7H4C4WJ111234

1998 Chevrolet C7 Chassis: 376,592 Miles Labor

Parts

Subtotal

Total

\$418.38

Date:

8/19/2021

Bill To

	Service Order	Purchase Order	Service Writer	Author	izer
ltem	Description		Quantity	Rate	Amount
Comp	laint: Service Unit				
Cause	: Pm service Type: Preventive m	naintenance			
Labor	Correction: Engine / Filters / Raise hood. Dr air filter. Check fluid in both diffe	rain oil from engine. Replace oil filter rentials and transmission.	and fuel filters and		
Parts	Filter, air, Fleetguard - AF4878 -	A			
Parts	Filter, fuel, Fleetguard - FF5324	- A			
Parts	Fleetguard lube filter - LF667 - A				
Parts	Filter, fuel, Donaldson - P553202	2-A		Subtotal	\$254.22
	Shop Supplies				
	NT51 VIN: 1GBT7H4C4WJ1112	34	Labor	,	
	Chevrolet C7 is: 376,592 Miles		Parts		
			Subto	tal	
			Total		\$281.84

Date:

9/18/2021

Bill To

Cause: Customer request Type: Unscheduled repair (inspection)

	Service Order	Purchase Order	B		
	The second secon		Service Writer	Authori	zer
ltem	Description		0		
Com	plaint: Make repairs to truck		Quantity	Rate	Amoun
Caus	e: Adjust pto cable . Replace rigi	ht hand rear tail light . Replace spot m	pirrore Type: Other		
Labor	r Correction:	il light and rewire light . Replace spot			
Parts	6"Convez SS Mirror - 610191 -	- A			
Parts	3 Stud Red lamp - 53702 - A				
Parts	1/4" stud blue ring terminal - 25	5263 - A			
Parts	Blue w/brass sleeve butt conne	ector - 94728 - A			
Parts	8-32x1 Machine Screw - 90065	5 - A			
Parts	8-32 hex nut - 1208 - A				
Parts	Red butt connector - 92822 - A				
Parts	10-32x3/4 Machine Screw - 900	072 - A			
Parts	#10 Flat Washer - 527 - A				
Parts	AD Actuator - 604-103 - A				
Parts	15.25 black cable tie - 94613 - A	λ			
Parts	GMC 15681060 Hump Hose GM	и - 15681060 - A			
Parts	Pre-Vent Base & Vent/ Fill Cap,	2in - CEN 60001 - A			
Parts	Coupling, 2in Black - PIP B0200	:-A			
Parts	Cable - 43C-RVC - A				
				Subtotal	\$753.71
Comp	laint: Repair lights		A ser alternative de colonical de la colonica de la colonical	and the state of t	
Cause	: Customer request (Inspection)				
abor	Correction:	Annala Habita			
	Chassis / Lighting & Electrical / R	tepair lights		S. 14.4.1.1	transaction de la constant de la con
				Subtotal	\$364.32

\$2,270.30

Total

Date:

9/22/2021

Bill To

Remit Payment To

Authorizer Service Order Purchase Order Service Writer Amount Rate Description Quantity Item Complaint: Service call bed will not lower Cause: Broken cable and lever Labor Correction: Chassis / Chassis / Gathered tools drove out to the trucks location and moved adjuster in far enough to let the bed lower. Once bed was down cleaned tools and drove back to the shop. \$367.50 Subtotal Complaint: Repair PTO Cable Cause: Bed won't go diwn Type: Unscheduled repair (Inspection) Labor Correction: Chassis / Chassis / Remove pto shift cover . Remove pto control and cable . Send cable out to be rebuilt. Install new pto cable and reroute away from exhaust. Had to have other tech s help adjust cable . CABLE IS NOT RIGHT BUT WAS TOLD TO RUN ANY WAY by Travis little John Subtotal \$445.50 Shop Supplies Labor Unit: AT51 VIN: 1GBT7H4C4WJ111234 1998 Chevrolet C7 **Parts** Chassis: 376,592 Miles Subtotal \$926.41 Total