

Contact	Payment terms	COD	Ship via	None Specified
Contact phone	Primary phone			Prepay and Add
Vehicle Info:	Year/Make/Model	2007 / KW / W-900	Cust Unit #	
	VIN/Short VIN	1NKWL40X57J170590 / 7J170590	Miles/Hours	0 / 0
Repair Order no.	Operation #	2		
Condition				
Correction				

Part number	Description	Ord	Del	List Price	Unit price	Ext. price
263_509						
Labor						

Repair Order no.	Operation #	3				
Condition	Replace Broken Flywheel Housing					
Correction	R&R Trans, Clutch, Flywheel, Mounts and Housing to Replace Broken Housing. DG					
Part number	Description	Ord	Del	List Price	Unit price	Ext. price
072_MU-155698-12XB10-2	15.5 CLUTCH WITH 4400 PLATE LOAD	1	1			
Core exchange						
029_306VV	PILOT BRG W/VITON SEAL	1	1			
116_FLYWHEEL1	REGRIND FLAT FLYWHEEL	1	1			
	WO Unit # Pending					
022_127760	2" CLUTCH BRAKE	1	1			
341_4965569	ISX REAR CRANK SEAL	1	1			
110_4305294	GSKT SHIFT LEVER	1	1			
212_SP2-12535	THREADLOCKER-BLUE GEL	1	1			
033_13MK5708	8 BOLT .010 GASKET	1	1			
033_13MK5708	8 BOLT .010 GASKET	1	1			
010_250-70-18X	STRAP KIT W/BOLTS	2	2			
345_550044796	BULK GME 40W SYN	16	16			

Contact	Payment terms COD		Ship via	None Specified		
Contact phone	Primary phone			Prepay and Add		
Vehicle info:	Year/Make/Model	2007 / KW / W-900	Cust Unit #			
	VIN/Short VIN	1NKWL40X57J170590 / 7J170590	Miles/Hours	844994 / 0		
Repair Order no.	Operation # 9					
Condition	Replace egr valve, Turbo, Gear Housing					
Correction						
Part number	Description	Ord	Del	List Price	Unit price	Ext. price
341_3033247	O-RING SEAL	4	4			
341_3104229	EXHAUST GASKET	1	1			
341_4955422RX	REMAN EGR VALVE	1	1			
Core exchange						
341_2881993RX	TURBO CHARGER ASSEMBLY	1	1			
Core exchange						
341_4928593	SENSOR PRESSURE	1	1			
341_4059393	GEAR HOUSING	1	1			
Labor						

Shop supplies

Total merchandise

Total cores

Total labor

Tax amount

Invoice total

\$8,511.67

Contact	Payment terms	COD	Ship via	None Specified
Contact phone	Primary phone			Prepay and Add

Part number	Description	Ord	Del	B/O	List Price	Unit price	Ext. price
-------------	-------------	-----	-----	-----	------------	------------	------------

Labor - Repair Shop	Labor - repair broken bolts & replace studs						
---------------------	---	--	--	--	--	--	--

Vehicle info:	Year/Make/Model	2007 / KW / W-900	Cust Unit #	207
	VIN/Short VIN	1NKWL40X57J170590 / 7J170590	Miles/Hours	844994 / 0

Repair Order no.	Operation #	1
------------------	-------------	---

Condition	Air leak and brake problem, chamber?
-----------	--------------------------------------

Correction	<p>WITH EVERYTHING HOOKED UP I TRIED THE BRAKES. TRAILER KNOB WILL NOT STAY PUSHED IN AND NEITHER WILL THE TRUCK. DISCONNECTED THE TRIALER AND TRACTOR WORKED PROPERLY BUT THE TRIALER KNOB STILL WOULDNT. PINCHED OFF TRAILER CHAMBERS AND TRIED AGAIN. SAME THING. DISCONNECTED THE TRAILER AND PLUGGED OFF WHERE THE TRAILER HOOKS UP. SAME THING. WE NOW KNOW IT IS NOT A PROBLEM WITH THE TRIALER. REPLACED THE DASH VALVE AND IT DID THE SAME THING. REPLACED THE TRACTOR PROTECTION VALVE AND IT STILL DID THE SAME THING. DISCONNECTED ALL AIRLINES, ONE AT A TIME, LEADING TO THE DASH VALVE FROM THE PROTECTION VALVE. IT STILL WAS DOING THE SAME THING. PULLED THE DASH VALVE BACK OUT AND MADE SURE ALL LINE WERE CONNECTED PROPERLY AND THEY WERE. AFTER MESSING WITH THE DASH VALVE AND UNDOING ALL THE LINES AND PLUGGING THEM BACK IN THE BRAKES JUST STARTED TO WORK. GUESSING A PIECE OF SOMETHING LIKE DIRT WAS IN THE DASH VALVE NOT ALLOWING THE VALVE TO WORK PROPERLY. PUT EVERYTHING BACK TO THE WAY IT WAS AND TRIED THE BRAKES A WHOLE LOT OF TIMES TO MAKE SURE THEY WERE GOING TO WORK PROPERLY. COULD NOT GET THEM TO MESS UP AGAIN. GM</p>
------------	---

Part number	Description	Ord	De!	B/O	List Price	Unit price	Ext. price
001_PART_NC	PART - NO CORE	1	1	0			
ball valve 1/4/x1/4f							
001_PART_NC	PART - NO CORE	1	1	0			
male nipple							
SSA_800257	MV-3 VALVE	1	1	0			
SSA_103081	R-7 RELAY VALVE	1	1	0			

Labor

Repair Order no.	Operation #	2
------------------	-------------	---

05.03	Cust acct#	Cust PO#	Page	2 of 4			
Condition	Repair oil leak, may be front cover						
Correction	WASHED OFF FRONT COVER AREA AND RAN ENGINE. FOUND SEVERAL OIL LEAKS COMING FROM INNER GEAR HOUSING AND INJECTOR CAM PLATE. REMOVED ALL NECESSARY COMPONENTS NEEDED TO REMOVED INNER GEAR HOUSING. CLEANED ALL COMPONENTS. REINSTALLED GEAR HOUSING WITH NEW GASKET. REINSTALLED ALL PREVIOUSLY REMOVED COMPONENTS. RAN ENGINE AND CHECKED FOR LEAKS. NONE FOUND.DG						
Part number	Description	Ord	Del	B/O	List Price	Unit price	Ext. price
341_3679931	O-RING SEAL	1	1	0			
341_3679932	O-RING SEAL	1	1	0			
341_4955383	OIL SEAL KIT	1	1	0			
341_4962721	RECTANGULAR STRIP SEAL	1	1	0			
341_4962722	RECTANGULAR STRIP SEAL	1	1	0			
341_4965690	SUPPORT ACCESSORY DRIVE GASKET	1	1	0			
Labor							

Repair Order no.	Operation # 4						
Condition	In Frame						
Correction	REMOVED RADIATOR. MOUNTING BOLTS WERE STRIPPED AND NEEDED TO BE CUT OFF. REMOVED CYLINDER HEAD, OIL PAN, PISTONS, PISTON OILERS, AND LINERS. CLEANED ALL COMPONENTS. INSTALLED NEW LINERS, PISTONS, ROD AND MAIN BEARINGS, CYLINDER HEAD, INJECTORS, CAMSHAFTS, AND ROCKER ARMS. NOTICED SOME FLAKING OF A COUPLE CAM LOBES AND ROCKER ARMS. CUSTOMER ELECTED NOT TO REPLACE THESE DUE TO COST. SENT RADIATOR TO RADIATOR SHOP FOR MOUNTING BOLT REPLACEMENT.CHANGED OIL AND FUEL FILTERS. INSTALLED RADIATOR AND ALL REMAINING COMPONENTS. PRIMED FUEL SYSTEM AND STARTED ENGINE. ENGINE RUNS GOOD WITH NO LEAKS FOUND. TEST DROVE TRUCK WITH NO ISSUES. DG						
Part number	Description	Ord	Del	B/O	List Price	Unit price	Ext. price
341_3042401	GROMMET	1	1	0			
341_3330537	O-RING SEAL	6	6	0			
341_3330538	O-RING SEAL	6	6	0			
341_3347937	O-RING SEAL	6	6	0			
341_3347939	O-RING SEAL	6	6	0			
341_4089405	SET, ROD BEARING [STD]	6	6	0			
341_4299124	O-RING SEAL	1	1	0			
341_4299125	O-RING SEAL	1	1	0			
341_4318947	THERMOSTAT	1	1	0			
341_PART_NC	CUMMINS - NO CORE	1	1	0			
o/h kit 4376174							
341_PART	CUMMINS PART	1	1	0			

INVOICE

Invoice #

SO #

Date

Writer

Page 3 of 4

Inv: Cus.

cyl head 5413782rx

Core exchange

760_8D50000

760_BF1259

341_3681221

GRX_300034094

341_4089405

341_4985562

341_212161

341_3049221

341_PART_NC

adj screw 4059377

341_3104392

341_3688114

001_PART_NC

supplies radiator repair

001_PART_NC

bushing rad support

345_500010048

GRX_RAF-TITANIUM

Labor

Labor - Repair Shop

HIGH EFFCY DUAL-FLOW LUBE SPIN-
ON

FUEL/WATER SEPARATOR

RAIL HOLD DOWN BOLTS

105 LUBRIPLATE

SET, ROD BEARING [STD]

GSKT

O-RING SEAL

O-RING SEAL

CUMMINS - NO CORE

VALVE COVER GASKET

PLUG, GEAR COVER

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

PART - NO CORE

1 1 0

1 1 0

1 1 0

1 1 0

1 1 0

1 1 0

2 2 0

2 2 0

1 1 0

1 1 0

1 1 0

1 1 0

2 2 0

52 52 0

16 16 0

Shop supplies

Total merchandise

Total cores

Total labor

Tax amount

Invoice total

\$22,270.75

INVOICE

Invoice #

SO #

Date 03/21/2019

Writer

Page 1 of 4

Sold
to:

Ship
to:

Contact	Payment terms	COD	Ship via	None Specified
Contact phone	Primary phone			Prepay and Add

Part number	Description	Ord	Del	B/O	List Price	Unit price	Ext. price
-------------	-------------	-----	-----	-----	------------	------------	------------

Labor - Repair Shop	Labor - repair broken bolts & replace studs						
---------------------	---	--	--	--	--	--	--

Vehicle Info:	Year/Make/Model	2007 / KW / W-900	Cust Unit #	207
	VIN/Short VIN	1NKWL40X57J170590 / 7J170590	Miles/Hours	844994 / 0

Repair Order no.	Operation #	1
------------------	-------------	---

Condition	Air leak and brake problem, chamber?
-----------	--------------------------------------

Correction	WITH EVERYTHING HOOKED UP I TRIED THE BRAKES. TRAILER KNOB WILL NOT STAY PUSHED IN AND NEITHER WILL THE TRUCK. DISCONNECTED THE TRIALER AND TRACTOR WORKED PROPERLY BUT THE TRIALER KNOB STILL WOULDNT. PINCHED OFF TRAILER CHAMBERS AND TRIED AGAIN. SAME THING. DISCONNECTED THE TRAILER AND PLUGGED OFF WHERE THE TRAILER HOOKS UP. SAME THING. WE NOW KNOW IT IS NOT A PROBLEM WITH THE TRIALER. REPLACED THE DASH VALVE AND IT DID THE SAME THING. REPLACED THE TRACTOR PROTECTION VALVE AND IT STILL DID THE SAME THING. DISCONNECTED ALL AIRLINES, ONE AT A TIME, LEADING TO THE DASH VALVE FROM THE PROTECTION VALVE. IT STILL WAS DOING THE SAME THING. PULLED THE DASH VALVE BACK OUT AND MADE SURE ALL LINE WERE CONNECTED PROPERLY AND THEY WERE. AFTER MESSING WITH THE DASH VALVE AND UNDOING ALL THE LINES AND PLUGGING THEM BACK IN THE BRAKES JUST STARTED TO WORK. GUESSING A PIECE OF SOMETHING LIKE DIRT WAS IN THE DASH VAIVE NOT ALLOWING THE VALVE TO WORK PROPERLY. PUT EVERYTHING BACK TO THE WAY IT WAS AND TRIED THE BRAKES A WHOLE LOT OF TIMES TO MAKE SURE THEY WERE GOING TO WORK PROPERLY. COULD NOT GET THEM TO MESS UP AGAIN. GM
------------	--

Part number	Description	Ord	Del	B/O	List Price	Unit price	Ext. price
001_PART_NC	PART - NO CORE	1	1	0			
ball valve 1/4/x1/4f							
001_PART_NC	PART - NO CORE	1	1	0			
male nipple							
SSA_800257	MV-3 VALVE	1	1	0			
SSA_103081	R-7 RELAY VALVE	1	1	0			

Labor

Repair Order no.	Operation #	2
------------------	-------------	---

INVOICE

Invoice #

SO #

Date 03/21/2019

Writer

Page 2 of 4

Invt:Cust

Cust acct#

Cust PO#

Condition

Correction

Repair oil leak, may be front cover

WASHED OFF FRONT COVER AREA AND RAN ENGINE. FOUND SEVERAL OIL LEAKS COMING FROM INNER GEAR HOUSING AND INJECTOR CAM PLATE. REMOVED ALL NECESSARY COMPONENTS NEEDED TO REMOVED INNER GEAR HOUSING. CLEANED ALL COMPONENTS. REINSTALLED GEAR HOUSING WITH NEW GASKET. REINSTALLED ALL PREVIOUSLY REMOVED COMPONENTS. RAN ENGINE AND CHECKED FOR LEAKS. NONE FOUND.DG

Part number	Description	Ord	Del	B/O	List Price	Unit price	Ext. price
341_3679931	O-RING SEAL	1	1	0			
341_3679932	O-RING SEAL	1	1	0			
341_4955383	OIL SEAL KIT	1	1	0			
341_4962721	RECTANGULAR STRIP SEAL	1	1	0			
341_4962722	RECTANGULAR STRIP SEAL	1	1	0			
341_4965690	SUPPORT ACCESSORY DRIVE GASKET	1	1	0			

Labor

Repair Order no.

Operation # 4

Condition

Correction

In Frame

REMOVED RADIATOR. MOUNTING BOLTS WERE STRIPPED AND NEEDED TO BE CUT OFF. REMOVED CYLINDER HEAD, OIL PAN, PISTONS, PISTON OILERS, AND LINERS. CLEANED ALL COMPONENTS. INSTALLED NEW LINERS, PISTONS, ROD AND MAIN BEARINGS, CYLINDER HEAD, INJECTORS, CAMSHAFTS, AND ROCKER ARMS. NOTICED SOME FLAKING OF A COUPLE CAM LOBES AND ROCKER ARMS. CUSTOMER ELECTED NOT TO REPLACE THESE DUE TO COST. SENT RADIATOR TO RADIATOR SHOP FOR MOUNTING BOLT REPLACEMENT.CHANGED OIL AND FUEL FILTERS. INSTALLED RADIATOR AND ALL REMAINING COMPONENTS. PRIMED FUEL SYSTEM AND STARTED ENGINE. ENGINE RUNS GOOD WITH NO LEAKS FOUND. TEST DROVE TRUCK WITH NO ISSUES. DG

Part number	Description	Ord	Del	B/O	List Price	Unit price	Ext. price
341_3042401	GROMMET	1	1	0			
341_3330537	O-RING SEAL	6	6	0			
341_3330538	O-RING SEAL	6	6	0			
341_3347937	O-RING SEAL	6	6	0			
341_3347939	O-RING SEAL	6	6	0			
341_4089405	SET, ROD BEARING [STD]	6	6	0			
341_4299124	O-RING SEAL	1	1	0			
341_4299125	O-RING SEAL	1	1	0			
341_4318947	THERMOSTAT	1	1	0			
341_PART_NC	CUMMINS - NO CORE	1	1	0			
o/h kit 4376174							
341_PART	CUMMINS PART	1	1	0			

INVOICE

Invoice #

SO #

Date 03/21/2019

Writer

Page 3 of 4

Invnt:Cust	Cust acct#	Cust PO#			
cyl head 5413782rx					
Core exchange					
760_BD50000	HIGH EFFCY DUAL-FLOW LUBE SPIN-ON		1	1	0
760_BF1259	FUEL/WATER SEPARATOR		1	1	0
341_3681221	RAIL HOLD DOWN BOLTS		1	1	0
GRX_300034094	105 LUBRIPLATE		1	1	0
341_4089405	SET, ROD BEARING [STD]		1	1	0
341_4985562	GSKT		1	1	0
341_212161	O-RING SEAL		2	2	0
341_3049221	O-RING SEAL		2	2	0
341_PART_NC	CUMMINS - NO CORE		1	1	0
adj screw 4059377					
341_3104392	VALVE COVER GASKET		1	1	0
341_3688114	PLUG, GEAR COVER		1	1	0
001_PART_NC	PART - NO CORE		1	1	0
supplies radiator repair					
001_PART_NC	PART - NO CORE		2	2	0
bushing rad support					
345_500010048	ROTELLA T4 15W40 BULK - QT		52	52	0
GRX_RAF-TITANIUM	PREMIUM ANTI-FREEZE GOLD		16	16	0
Labor					
Labor - Repair Shop	Labor - repair broken bolts & replace studs				

Shop supplies

Total merchandise

Total cores

Total labor

Tax amount

Invoice total \$22,270.75