Tax Status	Terms	P.O.#	Service Date /	Invoice Date
TAX	CHARGE		2/04/2017	2/22/2017



BY:

Serial Number	Unit Number	Make / Model	Year	License Number	Mileage
1NKDX00X67J202872	DT0163	KW/T800	2007		231917

OPERATION 1

COMPLAINT: STEAM CLEAN ENTIRE ENGINE

VMRS CODE: 01-045-020-001-41-20

CORRECTION: WASH-ENGINE ASSEMBLY - COMPLETE-ENGINE ASSEMBLY-

LUBRICATION OR OIL SOAKED

STEAMED OFF COMPLETE ENGINE BEFORE REPAIRS.

Labor Total --

Total Operation 1 --

OPERATION 2

COMPLAINT: RUN & CHECK FOR OIL LEAKS & ADVISE ON FINDINGS.

VMRS CODE: 01-045-020-001-06-20

CORRECTION: INSPECT-ENGINE ASSEMBLY - COMPLETE-ENGINE ASSEMBLY-

LUBRICATION OR OIL SOAKED

T/S FOR OIL LEAKS & FOUND FRONT ENGINE COVER LEAKING AT THE

MTG & ALSO SIGNS OF FRONT CRANK SEAL LEAKING, ADVISED

DARRIN ON FINDINGS, AND FRONT MOTOR MOUNTS WERE SHOT, DARRIN ADVISED ALSO WHILE RADIATOR WAS OUT TO INSTALL NEW FAN BLADE REMOVE HOSES, UNBOLT A/C CONDENSER AND SWING TO THE SIDE,



CONTINUED

Tax Status	Terms	P.O#	Service Date	Invoice Date
TAX	CHARGE		2/04/2017	2/22/2017

OPERATION 2

REMOVE RADIATOR ASSY, REMOVE PAN AND HUB, REMOVE BELTS, AND FRONT COVER, CLEAN ALL PARTS, INSTALL NEW COVER SEAL, FRONT CRANK SEAL AND ACC DRIVE SEALS, REINSTALL FAN HUB AND NEW FAN BLADE, INSTALL FRONT MOTOR MOUNTS, INSTALL RADIATOR AND BOLT BACK A/C CONDENSER, INSTALL HOSES, CONTINUE TO STEP 5 FOR OVERHAUL.

Labor Total --

4089995 3804304 4955665 2863701	SEAL, RECTA. KIT, OIL KIT, SEAL FRONT W/ SLE SEAL, O RIN.	1111
3820945	SEAL, RECTA.	i

Parts Total ---Total Operation 2 --

OPERATION 3

COMPLAINT: ITEMS NOT INCLUDE ON ORIGNAL OVERHAUL ESTIMATE VMRS CODE: 01-044-003-215-03-18

CORRECTION: REPLACE WITH NEW-O-RING / SEAL - FUEL SOLENOID-FUEL PUMP.

LEAKING

PARTS ONLY, AUTH AS PER DARRIN.

Labor Total -- NO CHG

MOTOR MOUNT KIT 11762 4735-44003-14 BLADE-FAN .

Parts Total ..____ Total Operation 3 ..

OPERATION 4

COMPLAINT: CHECK ENGINE LIGHT IS ON, CHECK & ADVISE

VMRS CODE: 01-043-004-088-24-19

CORRECTION: REPAIR-WIRING - TURBOCHARGER TURBOCHARGER ASSEMBLY LOOSE PULLED UP CODES & FOUND 196 ACTIVE. BEGAN T/S CODE, OHMED

OUT SENSOR & WAS OK. CHECKED THE WIRE BY ITSELF & CHECKED OK CHECKED WIRING FROM ECM PLUG TO CONNECTOR BY THE ACTUATOR & WIRING WAS OK. WIRING FROM 8 WAY PLUG TO SENDER CHECKED WITH AN OPEN. CHECK HARNESS FOUND OPEN CURCUIT IN HARNESS, REPAIR

CONTINUED

Tax Status	Terms	P.O.#	Service Date	Invoice Date
TAX	CHARGE	DT0163	2/04/2017	2/22/2017

OPERATION 4

WIRING IN HARNESS, REROUTE HARNESS AS NOT TO PULL WITH ENGINE TORQUE, CLEAR FAULTS, AFTER OVERHAUL COMPLETED, VERIFY NO FAULTS ALL CHECK OK.

Labor Total · ·

CN26400 CN50200 TERMINAL FPACK 150SER

1

SEAL-PACKARD 150 SERIE

Parts Total ·· _____
Total Operation 4 ··

OPERATION 5

COMPLAINT: PERFORM IN-FRAME OVERHAUL

VMRS CODE: 01-045-019-000-14-44 CORRECTION: INSTALL-OVERHAUL KIT INSTALL-OVERHAUL KIT - ENGINE-OVERHAUL KIT - ENGINE-WORN REMOVED AIR CLEANER & PIPING. REMOVED VALVE COVER & DISASSEM

REMOVED AIR CLEANER & PIPING, REMOVED VALVE COVER & DISASSEM BLED TOP SIDE OF ENGINE. REMOVED CYLINDER HEAD, DRAINED OIL & REMOVED PAN. PULLED ALL PISTONS & LINERS, CLEANED BLOCK FOR REASSEMBLY. REPLACED ALL MAIN BRGS, INSTALLED ALL NEW LINERS, PISTONS & RINGS. TRANSFERED ALL FITTINGS OVER TO REMAIN CYLINDER HEAD & INSTALLED, TORQUED TO SPECS. REPLACED OIL PUMP & WATER PUMP. ASSEMBLED TOP SIDE OF ENGINE & SET OVERHEAD. INSTALLED VALVE COVER. INSTALLED ALL ACCESSORIES ON BOTH SIDES OF ENGINE INSTALLED NEW OIL BLUTCH EDUTE OF ENGINE ON BOTH SIDES OF ENGINE. INSTALLED NEW OIL FILTER & PUT NEW OIL IN ENGINE. PRIMED FUEL SYSTEM & RAN TO CHECK OVER, TOPP-

ED OFF COOLANT & TEST DRIVE, RECHECK FLUIDS.

Labor Total --

RX2864028RX CX2864028RX CR2864028RX 4003950 4918787 3688114CUM RX4955708RX CX4955708RX CR4955708RX 3032787	HEAD, CYLIN. HEAD, CYLIN. HEAD, CYLIN. PUMP, LUBRI. KIT, OVERHA. PLUG-GEAR COVER KIT, WATER KIT, WATER KIT, WATER KIT, WATER SEAL, ORIN.	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
3032787 CT05317	SEAL,O RIN. TIE-CABLE 15.5" LONG	25

CONTINUED

Tax Status	Terms	P.O.#	Service Date	Invoice Date
TAX	CHARGE	DT0163	2/04/2017	2/22/2017

OPERATION 5 CT05512			
3682826CUM GROMMET . 8 LF14000NNFLG FILTER . 1 3P1156 SEAL-O-RING 2 500004741 OIL 15W40 BULK R 10 RF5100 AF RED ELC 50/50 1G 1 4965698CUM SCREW-HEX FLANGE HEAD 1 4965512CUM SPACER-ISX. 1 4318947CUM THERMOSTAT. 1	OPERATION 5		
Total Operation 5	3682826CUM LF14000NNFLG 3P1156 500004741 RF5100 4965698CUM 4965512CUM 4318947CUM	GROMMET . FILTER . SEAL-O-RING OIL 15W40 BULK R AF RED ELC 50/50 1G SCREW-HEX FLANGE HEAD SPACER-ISX. THERMOSTAT. SEAL THERMOSTAT	8 1 2 1 0 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1

Labor Total Parts Total Shop Supplies Sales Tax

TOTAL DUE

15,908.34

Tax Status	Terms	P.O.#	/	Service Date	Invoice Date
TAX	CHARGE	DT0163		11/20/2018	11/28/2018

Serial Number	Unit Number	Make / Model	Year	License Number	Mileage
1NKDX00X67J202872	DT0163	KW/T800	2007		266353

OPERATION 1

COMPLAINT: C/A FOR UNIT HAS AN ENGINE KNOCK. CONTACT SALINA ON THIS. VMRS CODE: 01-999-000-000-AD-00

CORRECTION: ADDITIONAL TOTAL VEHICLE COMPONENTS TOTAL VEHICLE NO

FAILURE

REMOVED THE AIR PIPE, THE ATA PIPE, THE AIR FILTER, THE VALVE COVER, THE JAKES, AND THEN RAN THE OVERHEAD.
REINSTALLED THE ACCESS ITEMS AND THEN RAN THE UNIT TO FIND NO SIGN OF A KNOCK. ALTHOUGH AFTER RUNNING THE UNIT A LITTLE LONGER, POUND THERE WAS A FUEL KNOCK. PERFORMED THE CYLINDER CUT OUT TEST AND FOUND THE NUMBER FIVE INJECTOR WAS LEAKING. ADVISED ON THE FINDINGS AND PER THE CUSTOMER, GOT AUTHORIZATION TO REPLACE THE NUMBER 4, 5, AND 6 INJECTORS. REMOVED THE ACCESS ITEMS AND REPLACED THE INJECTORS.
REINSTALLED THE ACCESS ITEMS AND STARTED THE UNIT TO FIND NO PURTHER ISSUES.

FURTHER ISSUES.

Labor Total · ·

RX4902921PX CX4902921PX CR4902921PX INJ, CELEC. CHG

CREDIT

3 3

CORE 2864516 HARNESS, ET.

Parts Total ·-Total Operation 1 ·--

OPEN 24/7 FOR ALL MAKES SERVICE AND PARTS

REPAIR ORDER SUMMARY	AMOUNT
Labor Total	
Parts Total Shop Supplies	
Sales Tax	

TOTAL DUE

3,001.08

08.1811

Tax Status	Terms	P.O.#	Service Date	Invoice Date
TAX	CHARGE	DT0163	6/20/2019	6/28/2019

Serial Number	Unit Number	Make / Model	Year	License Number	Mileage
1NKDX00X67J202872	DT0163	KW/T800	2007		280691

OPERATION 1

COMPLAINT: CA FOR CLUTCH ISSUES HAVING ISSUES GETTING INTO GEAR . TO

GET IT IN YOU MUST START WITH CLUTCH PEDAL DOWN . - ON THE WAY TO THE SHOP CLUTCH LOST ALL FREE TRAVEL

01-023-002-000-03-44 VMRS CODE:

CORRECTION: REPLACE WITH NEW-CLUTCH-CLUTCH-WORN

REMOVED DRIVE LINE, HYD PUMP, BELLY PAN, AIR LINES, GREASE, HOSES, INSPECTION COVER, THROW OUT BEARING, REMOVED CLUTCH BOLTS, BELL HOUSING BOLTS, CLEANED TRANS AND TRANS BELL HOUSING. REMOVED FLY WHEEL AND TURNED REAR MAIN SEAL, IT IS LEAKING. REMOVED FEI WHEEL AND TORNED REAK MAIN SEAL, IT IS LEAKING. REMOVED REAR MAIN SEAL, CLEANED SURFACE, AND INSTALLED NEW SEAL. REMOVED FLY WHEEL, INSTALLED CLUTCH ON TRANS, INSTALLED TRANS BELL HOUSING BOLTS, TIGHTENED CLUTCH TRANS, INSTALLED TRANS BELL HOUSING BOLTS, TIGHTENED CLUTCH
BOLTS, INSTALLED CLUTCH LINKAGE, AND ADJUSTED LINKAGE FOR 2
INCHES OF FREE PLAY. ROUTED AND INSTALLED GREASE LINES AND
PTO LINES. INSTALLED PTO PUMP AND CONNECTIONS. REMOVED
BROKEN PUMP HANGER BRACKET, CLEANED UP BROKEN ENDS AND
WELDED THEM BACK TOGETHER, RE-INSTALLED BRACKET TO PUMP.
RE-INSTALLED BELLY BAR AND DRIVELINE ALONG WITH COOLER LINES
AND BELL HOUSING COVER. CHECKED TRANS FLUID AND IT IS GOOD,
GREASED EVERYTHING AND TEST DROVE.

Labor Total · ·

KPNCB1219-Y1962	COUPON - \$15 OFF CLTU	1
MMM08880	BRAKE CLEAN	2
4089542	KIT, SEAL .	1
6306LLUA1C3/2E	BEARING BALL	1
127760 - 50	BRAKE CLUTCH (75PC	1
E80-1012-008	SPACER TRANS SPRING	2
HWC02804	BUGGY SCREW	2
41151 IMP	HEX NUTS 1/4-28	2
CT05512	TIE-CABLE 15.25"LARGE	10
CT05317	TIE WRAP BLACK 15.5	20
RF020064	NYLON TUBING 1/4"ODX 1	1

Tax Status	Terms	P.O.#	Service Date	Invoice Date
TAX	CHARGE	DT0163	6/20/2019	6/28/2019

	OPERATION 1		
	90655IMP 90650IMP 91200IMP 16602IMP 77611IMP 16623IMP 77612IMP 6.5.70.18X	FITTING ABNUT 1/4" FITTING BRASS UNION QUICK 1/4 " A/B HEX BOLT 1/4·20X3/4 WASHER FLAT 1/4 HX CP PL USS 5/16X3/ WASHER FLAT 5/16 KIT STRAP&BOLT	1 1 1 2 2 2 2 2
I	309701-82	SELF-ADJ 15.5, 1700 TR	Parts Total ··

Total Operation 1 ..

OPERATION 2

COMPLAINT: REPLACE FORWARD DRIVE AXLE AIR BAG
VMRS CODE: 01-016-008-001-03-12
CORRECTION: REPLACE WITH NEW-AIR SPRING - REAR, AIR SUSPENSION-AIR
RIDE SUSPENSION-BROKEN

SUPPORTED FRONT DRIVE AXLE, REMOVED AIR CONNECTIONS TO BAG AND REMOVED THE BAG. SWAPPED FITTING OVER AND INSTALLED NEW BAG. CHAINED AXLE UP AND REMOVED JACK STANDS, REMOVED WHEEL LIFTS FROM TRUCK AND VERIFIED ALL TRANSMISSION FUNCTIONS WORKED PROPERLY INCLUDING PTO/BED OPERATION. TEST DROVE AND VERIFIED NO ISSUES.

Labor Total · ·

60271-002

AIR SPRING ASSY PRIMAX

Total Operation 2 .--

OPEN 24/7 FOR ALL MAKES SERVICE AND PARTS .

REPAIR ORDER SUMMARY	AMOUNT
Labor Total	
Parts Total	
Shop Supplies	
Coupons	
Sales Tax	

TOTAL DUE

JUN - - 2019

3.921.11

08-6811