

INVOICE # 4459
DATE 08/15/2022

VIN#
8J632211

MAKE/MODEL
07 International 7400

QTY	ACTIVITY	DESCRIPTION	RATE	AMOUNT
4	Labor	Diagnose brake system. Replace 2 drive axel brake chambers. Replace 2 slack adjusters.		
2	30/30 complete brake chamber			
2	Brake chamber clevis & pin kit			
2	Slack adjusters			
2	Labor	Replace 1 quick release valve (leaking) & a parking brake relay valve (leaking)		
1	Parts	QR valve		
1	Parts	R12 relay valve		
2	KM:Air Fitting:1469x6x6	3/8x3/8 Male Elbow		
4	KM:Coarse Bolt:380508	5/16-18 x 1		
8	KM:Flat Washer:373905	5/16"		
4	KM:Coarse Nylock:348405	5/16-18"		
1	KM:Air Fitting:1469x6	3/8x1/4 Male Elbow		
2	KM:Air Fitting:1469x10x6	5/8x3/8 Male Elbow		
1	KM:Air Fitting:1468x12	Male Connector 3/4 Tube- 1/2 Pipe		
1	KM:NPT Plug:3152x6	3/8"		
4	KM:NPT Street L 90*:C3409x6	3/8" x 3/8"		
2	SC:Steel Adapter:9-5405-6-6	3/8" x 3/8"		
4	KM:Flat Washer:373910	5/8"		
3	Labor	Parking brake circuit works properly. Service brakes are leaking air from 1 side abs modulator valve. Air leaking from service relay valve also. Other side modulator valve is in same rusted condition as all other valves. Replace 2nd modulator valve also.		
2	Parts	ABS modulator valve		
1	Parts	Service relay valve		

QTY	ACTIVITY	DESCRIPTION	RATE	AMOUNT
2	Labor	Diagnose oil leak on drivers side of engine. Found dipstick tube with rust hole, flange broken at bottom of tube, & tube anchor tube that goes into block was loose from block. Replace dipstick tube parts (all except stick)		
1	Parts	Dipstick tube		
1	Parts	Tube bottom anchor block.		
1	Parts	Clamp		
1	Parts	Seal		
1	KM:Metric Flange Nut:465006	M6 x 1.0		
2	KM:Coarse Bolt:380516	5/16-18 x 2"		
4	KM:Coarse Bolt:380528	5/16-18 x 3-1/2"		
6	KM:Coarse Nut:343805	5/16-18"		
12	KM:Flat Washer:373905	5/16"		
2	KM:Air Fitting:1468x10	5/8x1/2 Male Connector		
2	KM:Air Fitting:1468x6	3/8x1/4 Male Connector		
2	KM:Air Fitting:1468x6x6	3/8x3/8 Male Connector		
1	KM:NPT 90° Street Elbow:3400x4	1/4"		
1	KM:NPT Nipple:3328x4	Long 1/4"x1-1/2"		
1	KM:NPT Coupling:3300x4	1/4"		
1	KM:NPT Plug:3152x6	3/8"		

SUBTOTAL

TAX (0%)

TOTAL

BALANCE DUE

\$2,872.93

INVOICE # 4857
DATE 08/16/2022

VIN#
8J632211

MAKE/MODEL
07 International 7400

QTY	ACTIVITY	DESCRIPTION	RATE	AMOUNT
8	Labor	Diagnose boost leak. Replace intake manifold & intake throttle valve.		
1	Parts	Intake manifold mount gasket		
1	Parts	Intake throttle valve assembly		
1	Shipping			
1	Parts	Intake manifold		
1	Parts	Intake manifold gasket		
1	Parts	Mount gasket		
1	Parts	Fuel fitting		
1	Parts	Fuel fitting		
1	Parts	Gasket		
1	Parts	Gasket		
2	Parts	Stud/bolt		
1	Parts	ICP sensor		
4	KM:Hydraulic O-rings:4629x8			
4	KM:Metric Flange Bolt:4510825		M8 x 1.25 x 25	
2	Viton Compression Tube Sleeve:3/8"			
1	KM:Metric Flange Bolt:4510616		M6 x 1.0 x 16	
1	KM:Metric Spinlock Nut:4625008		M8 x 1.25	
1	Parts	Crankshaft position sensor		
0	ADVISE	Fuel tank leaking (oem tank \$1961.52)		

Miles: 12,257

SUBTOTAL
TAX (0%)
TOTAL
BALANCE DUE

\$4,156.51

