

Invoice Number: SW200021938 Date: 10/27/11 Account No.: 6586500 Page: 1

Sold To

Ship To

#00

COPY

Invoice Information

WO Number: WZ15549
WO Date: 9/07/11
Store: COLUMBUS MN
Payment Terms: CHARGE
P/O Number:
Ship Via:
Invoice Type: 1H1H1H

Make: CATERPILLAR
Model: 3126B
Serial: 08YL40789
PIN:
Id No:
Cust Unit: #00 2000 Freightliner FL80
Meter: 181156.0

Invoice Summary

Parts:
Labor:
Misc:
Taxes:

Amount Due: \$20,201.79

Invoice Total: 20,201.79

DUE BY 10TH OF THE NEXT MONTH
A service charge of 1 1/2 % per month will be assessed on all past due accounts.

To ensure proper credit, please detach this portion, at the perforation, and return with remittance.

Account Number: 6586500
Invoice Number: SW200021938
Invoice Date: 10/27/11

Amount Due:

\$20,201.79

Amount Enclosed:

Invoice Number: SW200021938

Date: 10/27/11

Account No.: 6586500

Page: 2

Quantity	Item	NR	Description	Unit Price	Extended
----------	------	----	-------------	------------	----------

COMPLETE PRE-SAFETY CHECK
CUSTOMER COMPLAINT:
SAFETY CHECK
REPAIR PROCESS COMMENTS:
SAFETY CHECK

SEGMENT AA TOTAL

REPLACE WITH CAT REMAN ENGINE
REPLACE ENGINE WITH REMAN
REMAN ENGINE SERIAL NUMBER BES03862
CUSTOMER COMPLAINT:
REPLACE ENGINE WITH REMAN
REPAIR PROCESS COMMENTS:
STEAM CLEANED THE ENGINE AREA.DOWNLOADED AND SENT
A REPORT.COPIED THE CONFIGURATION.DRAINED THE
COOLANT AND OIL.REMOVED THE HOSES,WIRES,LINES AND
BRACKETS.TOOK OFF THE HOOD.REMOVED THE RADIATOR
AND THE FAN HUB.TOOK OFF ALL COMPONENTS TO REMOVE
THE ENGINE.PULLED OUT THE ENGINE.LEFT THE
TRANSMISSION IN THE CHASSIS.SWAPPED OVER
COMPONENTS TO THE REMAN ENGINE.INSTALLED THE
REMAN ENGINE.HOOKED UP ALL COMPONENTS.PUT IN THE
FAN HUB AND THE RADIATOR.PUT ON AND HOOKED UP ALL
WIRES,LINES ,HOSES AND TUBING.PUT IN NEW LONGLIFE
COOLANT.PUT IN 7 GALS OF 15W-40 OIL.RAN THE
ENGINE TIL OPERATING TEMPERATURE.FAN TURNS ON AT
205*F.OFF AT 195* F.PUT IN THE CUSTOMERS
CONFIGURATIONS.DROVE THE TRUCK AROUND.HAS NO
PROBLEMS OR FAULTS AT THIS TIME.

1	OR-4855	ENG ARR	S5
1		CORE CHARGE	S5
1-		CORE CREDIT	N5
1	2V-5956	HOSE A	S5
1	3B-6772	ELL	N5
1	3D-2824	SEAL O RING	S5
1	3E-3213	PIN-SPRING	S5
3	3K-0360	SEAL	S5
1	5D-1026	CLAMP	S5
40	5P-0743	CM-HOSE STK	S5
183	5P-0765	CM-HOSE STK	S5
113	5P-0767	CM-HOSE STK	S5
1	6L-1883	GASKET	S5
1	061-7538	O RING	S5
1	135-9819	SEAL	S5
1	230-9944	VALVE GP-MDL	S5
1	252-9685	GASKET	S5
1	350-0015	3116/3126/C7HEATERS	S5

TOTAL PARTS

SEG. 01

1.00

7.00

7.00

1.00-

SERP. BELT
CAT DE OIL 15W40
EXTEND LIFE COOL
MKT BASED PRICE

F/R LBR

TOTAL MISC CHGS

SEG. 01

SEGMENT 01 TOTAL

REPAIR EXHAUST PIPING

Invoice Number: SW200021938

Date: 10/27/11

Account No.: 6586500

Page: 3

Quantity	Item	N/R	Description	Unit Price	Extended
REPAIR EXHAUST PIPING. CUSTOMER COMPLAINT: REPLACE BROKEN EXHAUST REPAIR PROCESS COMMENTS: WHILE REMOVING EXHAUST TO TO GAIN ACCES TO THE REAR OF THE ENGINE.FOUND THE EXHAUST SYSTEM BROKEN AT A 45* PIPE.ALSO HAS A HOLES AT THE MUFFLER AND THE 90* ELBOW.THE FLANGE WAS ALSO BROKEN.TOOK APART THE SYSTEM.PUT ON A NEW FLANGE,90* AND 45* ELBOWS AND FLEX PIPES.INSTALLED THE SYSTEM IN CHASSIS WHEN THE ENGINE WAS INSTALLED.FOUND NO LEAKS WHEN THE ENGINE WAS RUNNING.					
2	5P-0598		CLAMP	S	
5	J009623		EXH CLAMP	S	
TOTAL PARTS			SEG. 02		*
			F/R LBR		*
1.00			90DEG ALUM ELBOW		
1.00			4" ALUM ELBOW		
1.00			ALUM ELBOW 60DEG		
1.00			LIP FLANGE		
4.00			4" CLAMP		
TOTAL MISC CHGS			SEG. 02		*
SEGMENT 02 TOTAL					T

EXTRAS					
CUSTOMER COMPLAINT: EXTRAS REPAIR PROCESS COMMENTS: STEAM CLEANED OUT THE RADIATOR/AIR TO AIR CORE.DRILLED OUT A BROKEN BOLT IN THE RADIATOR.REPLACED THE UPPER RADIATOR HOSE,SERPENTINE BELT,AIR COMPRESSOR COOLANT LINES AND OIL LINE.PUT ON A NEW AIR COMPRESSOR GOVENOR.					
1	253-4525		IDLER AS	S	
TOTAL PARTS			SEG. 03		*
1.00			UPPER RADI HOSE		
TOTAL MISC CHGS			SEG. 03		*
SEGMENT 03 TOTAL					T

REPLACE AIR COMPRESSOR CUSTOMER COMPLAINT: REPLACE AIR COMPRESSOR REPAIR PROCESS COMMENTS: WITH THE ENGINE OUT.SWAPPED OVER COMPONENTS TO A REMAN AIR COMPRESSOR.INSTALLED IT ON THE REMAN ENGINE.WITH THE ENGINE RUNNING.DO NOT SEE ANY LEAKS ON THE REPAIRS MADE.					
			F/R PTS		
1	0R-9756		AIR COMPRESS	N	
1			CORE CHARGE	N	
1-			CORE CREDIT	N	
1	4N-9679		GOVERNOR A	S	
1	118-0284		HOSE A	N	
1	142-0367		HOSE AS	N	

SEGMENT 04 TOTAL 850.00 T

 FLUSH TRANSMISSION
 FLUSH TRANS AND REPLACE FITLERS. JHB
 CUSTOMER COMPLAINT:
 FLUSH TRANSMISSION.REPLACE FILTERS
 REPAIR PROCESS COMMENTS:
 REMOVED ACCESS COVER TO THE FILTER.REMOVED THE OLD
 FILTER.INSTALLED A NEW FILTER.REINSTALLED THE
 ACCESS COVER.DRAINED OUT THE TRANSMISSION OIL.PUT
 IN NEW TRANSMISSION OIL.RAN THE ENGINE.DO NOT SEE
 ANY PROBLEMS OR LEAKS ON THE REPAIRS MADE.

1.00		F/R LBR	
6.00	TRANS FILTER		
1.00	TRANS OIL		
	FREIGHT CHG		

TOTAL MISC CHGS SEG. 05
 SEGMENT 05 TOTAL

 PURCHASE EXT. WARRANTY COVERAGE
 1.00 ADV USED TRK ESC
 TOTAL MISC CHGS SEG. 06
 SEGMENT 06 TOTAL

 PROMOTION
 3YR ESC WITH REMAN ENGINE
 NAT-ENG-203
 1.00- ADV USED TRK ESC
 TOTAL MISC CHGS SEG. 98
 SEGMENT 98 TOTAL

 SERVICE SUPPLIES AND
 ENVIRONMENTAL CHARGES
 MN SALES TAX-6.875%
 TRANSIT TAX 0.25%
 DUE BY 10TH OF THE NEXT MONTH
 INVOICE TOTAL 20,201.79