

Invoice

1994 Kenworth W900 Base

Inv Date: 10/09/2018

VIN: 1XKWDB9X7RS623373

Odom: 262660

Engine: L6 10.0L, 611cid, DIESEL, FI

Color: Green

Trans:

Mfg. Date:

Unit #

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Engine Miss

Labor Service - Diagnose engine miss/ poor performance. scan Ecm. Performed cylinder cut out test. Determined Cylinder #4 was dead. Noticed noise through exhaust. Suspected dropped valve. Remove cylinder head. Drained fluids. Removed coolant & fuel lines. Removed charge air piping. Removed exhaust, turbo, thermostat housing & associated components. Removed fan hub & drive bolts. Removed valve covers, jake brakes, valve rockers & fuel injectors. Removed head bolts & lifted cylinder head & intermediate plate. Found broken exhaust valve on #4 cylinder. Replaced cylinder head. Cleaned all parts & fasteners. Cleaned & prepped engine block. Installed new head & head bolts. Reinstalled jakes & ran over head to spec. Reinstalled valve covers. fuel & coolant lines. Charge air piping. fan hub & thermostat housing. Replaced turbo due to damage from valve pieces on turbine wheel. Set cam drive gear backlash. Tied up loose wiring & hoses. filled with new oil & changed oil filter. Steam cleaned & test drove. Drill out peanut cover bolt due to stripped threads. Replaced upper coolant hoses. Replaced batteries. Batteries were continually dead & failed load test. Head may not core due to head being an after market head. Customer will be responsible for core if head should not core. CDF, SLP

Sublet	SCAN	Scan ECM/PCM	1.00
New	1241854	Head Bolt 12pt	10.00
New	1241855	Head Bolt 12pt Bolt	16.00
New	20R2645	Cylinder head	1.00
Core	20R2645	Core Received	1.00
New	3478688	Head Gasket Kit	1.00
New	614421	Spacer Plate	1.00
Part	2481394 CAT	Injector O Ring Kit Cat	6.00
New	38657	Hi-Flex Locktite	1.00
New	3E6772	Seal - Head gasket	24.00
New	1304698	Sleeve	1.00
Part	1061793	Stud	1.00
Part	1061792	Stud	11.00
Part	2N2766	Lock Nut	12.00
New	2818261	Sleeve	6.00
Part	2477133	Thermostats	1.00
New	14969880000	Turbocharger	1.00
Part	50 PLS	Exhaust Clamp 5 "	1.00
New	5P5678	M-Seal STK Valve Cover Gasket	6.00
Part	5515-250C	Silicone Hose 2 1/2 inches	2.00
New	5521-5	Helicoil 5/16	1.00
New	523	Bg Super Cool Hd	1.00
Part	1R0716	Oil Filter	1.00
Part	15W40	Mobile Del 15W40 Q	43.00
New	32583	1/2x 3/8 Wire Bolt	1.00
Part	31-MHD	BATTERY 31-MHD	4.00
Core	31-MHD	Core Received	4.00
New	BRAKE C	Brake Clean	2.00

Invoice #**1994 Kenworth W900 Base**

License #

Inv Date:10/09/2018

Continued from previous page

<div data-bbox="77 1843 743 1885">X _____</div>	<div data-bbox="829 1436 1195 1501">Posted 10/16/18 10:11AM A/R Charge</div>	<div data-bbox="1195 1436 1541 1617">Invoice Summary Parts Labor Sublet Fluids Shop Supply/Haz</div>
<div data-bbox="620 1913 782 1948">Discard old parts</div>		<div data-bbox="1195 1837 1541 1900">Sub Total Sales Tax (NT)</div> <div data-bbox="1195 1913 1541 1955">Inv Total 12,008.30</div>

Invoice

1994 Kenworth W900 Base

License #

Inv Date: 8/24/2021

VIN: 1XKWDB9X7RS623373

Odom: 1472962

Engine: 1.6 10.0L, 611cid, DIESEL, FI

Color: Green

Trans:

Mfg. Date:

Driver:

Unit # 102

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Warr.	Ext
------------------	----------------------	--------------------	-----	-------	-------	-----

Customer states that: Remove and replace clutch

Labor Service - Install clutch-Lifted front of truck up. Removed driveline from trans, shift tower, airlines and unplugged wiring harness, PTO pump, transmission cooler lines and transmission from truck. Resurfaced flywheel and installed a new pilot bearing and customer supplied clutch. Installed a new clutch brake and reinstalled shift tower with a new gasket. Reattached airlines, cooler lines and wiring harness. Reinstalled PTO pump and driveline with a new strap kit. Lowered truck, checked clutch freeplay and test drove. JH

New	CF105C137	Fork-Clutch Release	1.00
Part	CPB63062RS2HT	Pilot Bearing	1.00
New	B201	Clutch Brake	1.00
New	4305294	Shift tower gasket	1.00
Part	4305230	Clutch Inspection Plate	1.00
Part	23551-1 BLACK TUBING	Black tubing heat shrink	1.00
New	6.5-70-18X	1810 strap	1.00
Sublet	FLYWHEEL	Resurface Flywheel	1.00

Customer states that: the Radiator is leaking and needs inspection to determine the cause.

Labor Service - Removed radiator, sent in for repairs. Noticed charge air cooler was damaged from bracket rubbing. Removed charge air cooler and installed new charge air cooler. Reinstalled radiator and filled with coolant. CB

New	222066	Charge Air Cooler	1.00
Sublet	FREIGHT	Freight	1.00
New	BW-45	fender washer 5/16	2.00
Part	5515-250C	Silicone Hose 2 1/2 inches	6.00
New	1168002	Radiator Rubber Mount	4.00
New	K134-356	Radiator Gasket	1.00
Part	EXTENDED LIFE FC 50/	AF Extended Life 50/50 Gallon	12.00
New	406	Clamp	2.00

Customer states that: Battery ground cable bad

Labor Service - Battery Cable- When removing transmission found bad ground battery cable. Unhooked batteries. Removed bad cable and built a new ground cable. Installed battery cable and hooked the batteries back up. Tested starting and everything was good. JH

Part	17065	2.0 gauge battery lug	1.00
New	17055	3/8 2/0 Gauge Lug Copper	1.00
Part	736112	BATTERY CABL Battery Cable	6.50

Customer states that: Locked up

Labor Service - Went to recover freon before radiator was removed. Only receiver 5 oz of freon. Decided to check compressor. Compressor was locked up. Removed condenser & receiver dryer. Removed both lines on compressor and expansion valve. Flushed out all of the ac lines. Removed compressor and installed new receiver dryer. Installed new compressor, reinstalled a/c lines. Installed new a/c clutch. Installed new belts and charged A/C with R134A. CB

New	273102	A/C Compressor	1.00
New	765-3135	A/C Flush	3.00
New	VH11600	HVAC O-ring Service Kit	1.00
New	25-9580	Belt	2.00

Invoice #**1994 Kenworth W900 Base**

License #

Inv Date: 8/24/2021

New	948441	A/C Clutch	1.00
New	JA11350	Reciever Dryer	1.00
Part	R134A	R134A	3.00
New	CQP100-8D	Pag Oil 100 w/UV Dye	2.00

Posted 10/22/21 2:13PM
A/R Charge

Invoice Summary

Parts
Labor
Sublet
Fluids
Shop Supply/Haz

Sub Total
Sales Tax (NT)

Invoice

1994 Kenworth W900 Base

License #

Inv Date:11/17/2020

VIN: 1XKWDB9X7RS623373

Odom: 444931

Engine:L6 10.0L, 611cid, DIESEL, FI

Color: Green

Trans:

Mfg. Date:

Driver:

Unit # 102

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Customer states that: Suspension

Labor Service - Removed bolts from side brackets and removed broken angel crossmember gussets by torching out the hucks. Removed aluminum frame support brackets and rubber bushings on sway bars. Installed new rubber bushings on sway bar and aluminum frame support brackets. Installed new side and angle crossmember gussets and tightened them. Aired up suspension and tightened up aluminum frame support brackets to the sway bars. Used all new bolts, washers and nuts in the installation process of new parts. JH

New	K197-5168	Frame Bracket Reinforcement	2.00
New	K071-304	Frame bracket cap	4.00
New	K066-449	Bushing-Swayba	4.00
New	HWC04384	M16 bolt	4.00
New	4586-84ZY	M20 Bolt	4.00
New	HWC04706	M16-2 Hex bolt	3.00
New	HWC05712	Washer - round 5	16.00
New	HWC05722	M20 Washer	8.00
New	K169-163-20AC	M20 Lock Nut	4.00
New	HWC12501	Nut-Hex SI	10.00
New	MK16913	Center Frame Bracket	2.00
New	D39457	Gr. 8HXCAPSCREW 5/8-18X4	8.00
New	36802	3/4"x16 nuts	8.00
New	C712213	GR. B All Metal Lock Nut 5/8-18	8.00
New	36708	Flat washer 3/4	16.00
New	36707	Flat Washer 5/8 SAE	20.00
New	K140-1662	Crossmember Angle Gusset	2.00
Sublet	FREIGHT	Freight	1.00
New	19M8486	Bolt	3.00
New	36705	Flat washer 1/2 sae	24.00
New	MPC712209	1/2 - 20 locking nut	12.00
New	D39472	3/4 x 2 Bolt	8.00
New	D39406	1/2 -20 x 1 Gr 8 Bolt	12.00

Invoice #

1994 Kenworth W900 Base

License #

Inv Date:11/17/2020

Continued from previous page

	Posted 12/31/20 10:57AM A/R Charge	Invoice Summary Parts Labor Sublet Shop Supply/Haz Sub Total Sales Tax (NT)
Page 2 of 2	Discard old parts Original Estimate:	Inv Total 4,783.69

Invoice

1994 Kenworth W900 Base

License #

Inv Date: 6/08/2020

VIN: 1XKWDB9X7RS623373

Odom: 424391

Color: Green

Engine: L6 10.0L, 611cid, DIESEL, FI

Mfg. Date:

Trans:

Unit # 102

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Customer states that: Suspension

Labor Service - Tag Axle. Removed upper & lower tag axle links. Had to cut out bolts on passenger side. Installed new bushings & bolts. Reinstalled links & new stabilizer shocks. Welded shock plate, reinforced & reinstalled. Reinstalled fenders. SLP

New	800A0133	Kit Bushing Link	1.00
Sublet	FREIGHT	Freight- Np	1.00
New	11418WAC	Shock Stabilizer	2.00
New	83000096	Plate Mount Shock	1.00

Labor Service - Removed sway bar. Inspected sway bars and mounting hardware. Had to heat bolts due to they were seized in brackets. Found them worn out. Replaced swaybars and bushings. Installed new bolts and nuts. Installed and test drove. JH

New	K066-449	Bushing-Swayba	4.00
New	197-660	Bolt 5/8 x 11 x 6	4.00
New	92440	bolt 5/8-11x6	4.00
New	34FW	Washer	8.00
New	4586-84ZY	M20 Bolt	4.00
New	58FW	Washer-Extra	8.00
New	HWC04384	M16 bolt	4.00
New	HWC04916	Nylon hex nut	4.00
New	HWC12501	Nut-Hex St	4.00
New	K071-304	Frame bracket cap	4.00
New	MK16960	Sway Bar	2.00
Sublet	FREIGHT	Freight-Sk	1.00

Customer states that: the Air Conditioning System isn't cooling properly.

Labor Service - Checked a/c system. No freon. Pressurized and located hole in condenser. Removed condenser and received dryer. Replaced orings. Installed new condenser and receiver dryer. Charged a/c with 4.8 oz of freon. Adjusted hood and made sure condenser wasn't rubbing on hood. Drove and checked a/c. Everything working good. JH

New	4541009	Condenser	1.00
New	JA11350	Reciever Dryer	1.00
Sublet	FREIGHT	Freight	1.00
Part	R134A	R134A	4.80
New	407019	O-ring	1.00
New	407132	O- Ring	1.00

Invoice #**1994 Kenworth W900 Base**

License #

Inv Date: 6/08/2020

Continued from previous page

	Posted 6/25/20 2:09PM A/R Charge	Invoice Summary Parts Labor Sublet Fluids Shop Supply/Haz Sub Total Sales Tax (NT)
Page 2 of 2	Discard old parts	Inv Total 8,073.82

Original Estimate:

Invoice

1994 Kenworth W900 Base

License #

Inv Date: 1/16/2020

VIN: 1XKWDB9X7RS623373

Odom: 391755

Color: Green

Engine: L6 10.0L, 611cid, DIESEL, FI

Mfg. Date:

Trans:

Driver:

Unit #

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Customer states that: Suspension

Labor Service - Jacked up truck. Removed left rear wheels and tires. Removed axle and hub. Removed bearings and seal from hub. Removed brake shoes, hardware and slack adjuster. Welded left rear s-cam tube and replaced bolts. Installed new bushings and seal. Installed new s cam and new slack adjuster. Installed new brakes and hardware. Cleaned up and inspected bearings. Installed bearing with new seal. Installed hub onto axle housing. Installed axle with new seal, drums, wheels and tires. Added 75w90. Repeat these steps for 3 remaining axle hubs. Removed left wheel and drum, hub from spindle, brake shoes, brake chamber and s cam assembly. Heated and pressed out king pin. Cleaned up spindle, brake chamber assembly and hub. Pressed out old bushings. Cleaned up bore and installed new bushing and seals. Installed new king pin and greased. Installed brake chamber assembly. Installed old brakes. Installed hub with new seal. Installed drum and wheel. Repeated these steps on opposite side. Filled hub and 75w90. Adjusted all brakes and test drove. Everything works good. JH

New	127808ETN	Kit-Camshaft Bushing	2.00
New	40010155M1D	Slack Adjuster	4.00
New	808290	SCam	2.00
New	808291	SCam	2.00
Sublet	FREIGHT	Freight	1.00
New	K374-29	Shock Absorber	4.00
New	BRAKE C	Brake Clean	4.00
Part	GREASE	Del Extreme Grease Tube	2.00
New	AX4709E2K	Brake Kit	4.00
Core	AX4709E2K	Core Received	4.00
New	HD1M	16.5x7 Brake Drum	4.00
Part	MER0273	Wheel Seal 0273	4.00
Part	N8092	Axle Gasket	4.00
New	450755	Hubcap Gasket	2.00
Part	MER0236	Meritor Wheel Seal	2.00
Sublet	FREIGHT	Freight	1.00
Part	75W90	Synthetic gear oil 75W90 quart	6.00
New	D39106	1/2 -13x1-1/2	5.00
New	84001934	King Pin Set	1.00
Sublet	FREIGHT	Freight	1.00

Invoice #**1994 Kenworth W900 Base**

License #

Inv Date: 1/16/2020

Continued from previous page

	Posted 1/27/20 11:25AM A/R Charge	Invoice Summary	
		Parts	
		Labor	
		Sublet	
		Fluids	
		Shop Supply/Haz	
		Sub Total	
		Sales Tax (NT)	
Page 2 of 2	Discard old parts	Original Estimate:	Inv Total 5,373.09

Invoice

1994 Kenworth W900 Base

License #

Inv Date: 11/12/2019

VIN: 1XKWDB9X7RS623373

Odom: 378625

Engine: L6 10.0L, 611cid, DIESEL, FI

Color: Green

Trans:

Mfg. Date:

Unit #

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Customer states that: Remove and replace clutch

Labor Service - Removed driveshaft from transmission. Unhooked wiring harness from transmission. Removed cooler lines, air lines and shift tower. Removed transmission, clutch, flywheel and pressure plate. Inspected input and cross shafts and bushings - found them worn. Replaced cross shafts and cross shafts bushings. Replaced flywheel and clutch pressure plate assembly. Removed rear main seal and replaced due to it leaking. Installed flywheel and new clutch assembly. Reinstalled transmission, reattached shift tower with new gasket. Reattached wiring harness and air lines. Install drive line. Inspected clutch linkage all ends are worn. Pivot points are worn out. Removed and replaced all pivot points and worn out pieces. Adjusted clutch. Drove and checked over. Found broken mount on a/c compressor. JH

New	12815	Bushing Clutch	4.00
New	CL108825-25	Clutch 2050 7 Spring 10 Spline	1.00
New	M-1655	Clutch Shaft	1.00
New	M-1984	Clutch Shaft	1.00
New	CF105C137	Fork-Clutch Release	1.00
Part	1425868	Rear Main Seal	1.00
New	B201	Clutch Brake	1.00
Part	CPB63062RS2HT	Pilot Bearing	1.00
New	4305294	Shift tower gasket	1.00
New	MP33833	16x1 Hex Washer head drill screw	4.00
New	G31400-2525	Fitting 5/32 x 5/32	1.00
New	BRAKE C	Brake Clean	2.00
New	6.5-70-18X	1810 strap	1.00
New	ME5/32X1/8	Fitting	1.00
New	E80-1012-008	Spacer Round 7.2x50x8	2.00
Sublet	FREIGHT	Freight	1.00
Part	K202-2503-0498 ROD A	Rod Assy Clutch 0498	1.00
New	K223-974	Spring Transmission Support	1.00
New	SPF6S	End-Rod 3/8	2.00
New	4P4797	Fly wheel	1.00
New	E21-1003	Clutch Control Bell Crank	1.00
New	E55-1116	Lever Clutch Control	1.00

Labor Service - Removed alternator and belts. Removed mount and compressor from mount. Drilled out broken bolt from head. Installed new mount to compressor and mount to block. Installed alternator and belts. Tightened and checked over. JH

New	K269-261	Bracket - mount	1.00
-----	----------	-----------------	------

Invoice #**1994 Kenworth W900 Base**

License #

Inv Date:11/12/2019

Continued from previous page

Posted 11/30/19 9:39AM
A/R Charge**Invoice Summary**Parts
Labor
Sublet
Shop Supply/HazSub Total
Sales Tax (NT)

Invoice

1994 Kenworth W900 Base

VIN: 1XKWDB9X7RS623373

Engine: L6 10.0L, 611cid, DIESEL, FI

Trans:

License #

Odom: 286266

Color: Green

Mfg. Date:

Unit #

Inv Date: 10/22/2018

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Customer states that: Oil Cooler

Labor Service - Diagnose engine oil in cooling system. Drained coolant out of radiator. Had to remove bottom hose to get oil to come out of radiator. Flushed radiator out & removed oil cooler. Cleaned mounting surface. Installed new oil cooler & block heater. Old block heater was burned at connector. Filled system with soap & water. Let run to operating temperature. Drained thru bottom hose. Repeated procedure several times to get oil out of cooling system. Customer needed truck. Filled with soap & water & let customer take. Customer brought truck back the next day. Flushed several more times & filled with coolant. SLP

Part	1891814	Gasket Kit - Oil Cooler	1.00
New	BRAKE C	Brake Clean	1.00
New	0R5511	Oil Cooler	1.00
Core	0R5511	Core Received	1.00
Part	250WOG	250WOG valve 1/2	2.00
New	4320P	Degreaser	4.00
Part	EXTENDED LIFE FC 50/	AF Extended Life 50/50 Gallon	14.00
Part	8605556	Block heater	1.00
New	5526-100	1" Silicone Heater Hose	3.00
Part	24112	hose clamp #10	2.00
New	24147	hose Clamp 16 protective liner	2.00

Posted 11/06/18 2:31PM

A/R Charge

Invoice Summary

Parts
Labor
Fluids
Shop Supply/Haz

Sub Total
Sales Tax (NT)

Inv Total 2,529.46

Invoice

1994 Kenworth W900 Base

License #

Inv Date: 2/19/2020

VIN: 1XKWB89X7RS623373

Odom: 397886

Color: Green

Engine: L6 10.0L, 611cid, DIESEL, FI

Mfg. Date:

Trans:

Unit # 102

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Customer states that: Remove and replace wheel seal.

Labor Service - R&R Wheel seal: Removed left front wheel, brake drum and brake shoes. Removed wheel hub, checked bearings. Outer bearings pitting inner bearing is showing signs of wear. Removed races and replaced. Installed new bearings and new wheel seal. Installed hub. Cleaned up brake shoes and re-installed. Cleaned up drum and installed. Installed wheel. Filled hub with 75W90. JH

New	450755	Hubcap Gasket	1.00
Part	MER0236	Meritor Wheel Seal	1.00
New	3720-N	Tapered Cup 3.6718" OD	1.00
New	3782-N	Tapered Cone 1.7500" Bore	1.00
New	HM212011-N	NTN Tapered Cup 4.8125" OD	1.00
New	HM212049	Bearing	1.00
Part	75W90	Synthetic gear oil 75W90 quart	4.00

Customer states that: R&R engine

Labor Service - Checked back pressure in motor. Installed new fill plug. Pressure washed and test drove. New plug did not pop out. No leaks from plug. JH

New	44165-201	Cop -Filler	1.00
Sublet	FREIGHT	Freight	1.00

Customer states that: Sensor

Labor Service - Sensor Replacement. engine oil temp, trans temp & rear diff temp sensors. Customer left sensors on passenger seat as well as fuel tank harness for sending unit.

Checked wiring for transmission temp send. Good. Installed new sender customer supplied. Checked wiring for oil temp send. Good. Installed new temp sender. Checked wiring for rear diff temp sender. No power on ground. Traced wires and found bad spots. Removed spliced wires and installed into wire loom. Checked sender canter post found loose not working. Replaced with new sender. Traced wires for fuel gauge. Built wiring harness to hook into existing wiring harness and connect to left side fuel tank. JH

New	LOOM	Loom 3/8	6.00
New	23846	14 gauge butt connector	16.00
New	35817	Scr 10-32x1/2	1.00
New	31255	Hex Nut 10-32	5.00
New	23845	18 gauge butt connector	2.00

Customer states that: Power steering leak

Labor Service - Removed power steering pump and cleaned up. Installed new gasket customer supplied. Run and checked for leaks. JH

Invoice #**1994 Kenworth W900 Base**

License #

Inv Date: 2/19/2020

Continued from previous page

	Posted 2/28/20 1:25PM A/R Charge	Invoice Summary Parts Labor Sublet Fluids Shop Supply/Haz		
		Sub Total Sales Tax (NT)		
Page 2 of 2	Discard old parts	Original Estimate:	Inv Total	1,123.58

Invoice

1994 Kenworth W900 Base

VIN: 1XKWDB9X7RS623373

Engine: L6 10.0L, 611cid, DIESEL, FI

Trans:

License #

Odom: 1461463

Color: Green

Mfg. Date:

Unit # 102

Inv Date: 5/12/2021

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Customer states that: the Air Conditioning System needs to be inspected

Labor Service - Diagnose A/C Leak-Pressurized A/C system, found compressor seal leaking and lower hose on condensor leaking. Removed pulley from compressor and removed front seal and found metal in seal, compressor is no good. Removed lines from compressor, evaporator and condensor. Flushed evaporator, condensor, and all the lines. Removed old compressor, pulley and clutch. Installed the pulley and clutch onto the new compressor. Installed the new compressor, new receiver dryer, new o rings on condensor and reattached all the hoses. Pressurized system and checked for leaks, none found, pulled vacuum and charged system. JH

New	273102	A/C Compressor	1.00
New	419955	AC Flush Solvent	1.00
Part	R134A	R134A	3.80
New	407008	O Ring	1.00
New	407183	O Ring	1.00
New	407019	O-ring	2.00
New	BT3S-CO	Cable Tie 12.0"x185	4.00
New	JA11350	Reciever Dryer	1.00
New	CQP150-8	Pag 150	1.00

Customer states that: Coolant leak

Labor Service - Coolant Leak-Found coolant leaking from upper radiator tank after pressurizing the coolant system. Drained coolant, removed condensor and set off to side as well as trans cooler. Removed upper radiator hose and charge air tubes. Removed hood spring from driver side. Passenger side was missing. Removed radiator supports and radiator. Removed charge air cooler from radiator. Sent radiator to be repaired. Install charge air cooler with new mounts. Install radiator, reattached radiator supports. Installed trans cooler and condenser to radiator. Install lower radiator inlet with new gasket. Installed upper radiator hose and charge air tubes. Refilled radiator with coolant. Test drove and checked for leaks. JH

New	K134-356	Radiator Gasket	1.00
New	LOR-CB1120-3	Air isolator	4.00
Sublet	BILLED OUT LABOR	Labor to Regasket Radiator	1.00
Sublet	SHOPSUPPLIES	Shop Supplies, Nuts, Bolts, Gaskets for Radiator	1.00
Sublet	FREIGHT	Freight	1.00

Customer states that: Hood Spring Missing

Labor Service - Installed hood spring on driver side and installed new hood spring on passenger side. JH

New	HS7102	Hood Spring (White)	1.00
-----	--------	---------------------	------

Invoice #**1994 Kenworth W900 Base**

License #

Inv Date: 5/12/2021

Continued from previous page

	Posted 5/31/21 2:50PM A/R Charge	Invoice Summary Parts Labor Sublet Fluids Shop Supply/Haz
		Sub Total Sales Tax (NT)
Page 2 of 2	Discard old parts	Original Estimate: Inv Total 1,754.23