3

SERVICE INVOICE: RA126004151:01

REFERENCE: 16598710

DAT	EARRIVED						
	ENRIVED	DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER POW	
1/17/2023		1/23/2023	SRM		CB	33	
YEAR	MAKE	MODEL	VIN	ENGINE HOURS	IN SERVICE		
2013	MACK	600		ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
	mick	000	1M1AW07YXDM029034	0	6/26/2012		768689

Sold Operations

JOB #1 100

SERVICE - GENERAL REPAIR

COMPLAINT CAUSE CORRECTION

REPLACE ENGINE WIRING HARNESS WITH NEW - NOTE CUSTOMER SUPPLIED PART -

DROVE OUT TO GROW TRUCKING AND BEGAN THE JOB. COMPLAINT WAS INJECTOR CYLINDER I NOT WORKING /READING. HOOKED TRUCK UP TO TECH TOOL AND SAVED ALL ACTIVE CODES FOR THE TRUCK. THEN I PROCEEDED TO REMOVE THE DOG HOUSE TO BE ABLE TO ACCESS THE ENGINE HARNESS. BEGAN CUTTING ALL THE ZIP TIES HOLDING THE ENGINE HARNESS ONTO TRUCK. ONCE ALL THE ZIP TIES WERE CUT I THEN MARKED EACH CONNECTOR WITH COLOR COATED WIRE TO ENSURE WHEN INSTALLING THE NEW HARNESS NO PLUGS WOULD BE WRONG. ONCE EVERYTHING WAS COLOR COATED I THEN REMOVED ALL THE PLUGS AND REMOVED THE HARNESS OFF OF THE TRUCK. CLEANED OFF ALL THE CONNECTORS THAT WERE STILL ON TRUCK AND THEN PROCEEDED IN INSTALLING NEW ENGINE HARNESS. ONCE THE HARNESS WAS RAN THE CORRECT WAY I THEN PROCEEDED IN CONNECTING ALL THE CONNECTORS AND ZIP TYING EVERYTHING. ENSURED EVERYTHING WAS SECURED AND THEN PROCEEDED IN REINSTALLING THE VALVE COVER AND THE CROSS OVER TUBE. THEN REINSTALLED THE AIR CLEANER ELEMENT. ONCE EVERYTHING WAS SECURED AND TORQUED TO SPEC I THEN PROCEEDED IN STARTING THE TRUCK TO ENSURE IT WOULD START AND BACKED IT OUT OF THE SHOP ONCE IT BUILT UP THE CORRECT AMOUNT AIR IN THE SYSTEM. ONCE BACKED OUT I THEN HOOKED THE TRUCK BACK UP TO TECH TOOL AND CHECKED IF NEW FAULTS WERE ACTIVE AND NO NEW ONES WERE. STILL HAD THE SAME ACTIVE FAULTS. DID A COMPRESSION TEST AND FOUND THAT CYLINDER ONE IS NOT WORKING AT ALL CYLINDER 2-3 ARE BELOW THE RECOMMENDED TEST. I ALSO PERFORMED A CYLINDER BALANCE TEST AND A CYLINDER CUT OUT TEST, ALL RESULTS SHOW INJECTOR/ CYLINDER #1 TO BE AT FAULT, INFORMED CUSTOMER OF THESE FINDINGS AND HE TOLD US THAT HE WILL BRING TRUCK UP TO THE SHOP FOR US TO WORK ON, PRINTED OFF ALL RESULTS FOR REVIEW

OTY ITEM DESCRIPTION UNIT PRICE EXTD PRICE LABOR 100 GENERAL REPAIR 126M/20538793 SEALING STRIP 126M/21532258 SEALING RING 2 126M/4710-05089 CRC RED BRAKE CLEAN 126M/4710-05103 2 CRC QD ELECTRONIC CLEANER 100 126M/5396-BE29557 TIE STRAP 100 126M/5396-BE29558 TIE STRAP 126M/8131393 5 RETAINER 126M/967343 O-RING

SERVICE INVOICE: RA126004151:01

REFERENCE: 16598710

7	DESCRIPTION CABLE TIE		UNIT PRICE	EXTO PRICE
	CABLE TIE		UNIT PRICE	EXTD PRICE
r	The same of the sa			
	REPLACE ENGINE WIRI	NG HARNESS WITH NEW - NOT		
		ILLI LACE ENGINE WIKI	INC. LACE ENGINE WIRING HARNESS WITH NEW - NOT	REFEACE ENGINE WIRING HARNESS WITH NEW - NOT

LABOR
PARTS
MISC
SUBLET
Prepay
SUBTOTAL
SHOP SUPPLIES
MISC SUPPLIES
TAX
TOTAL
\$1,843.05