

Service Invoice

CUSTOMER-PO Order No. NAIN-MUMBER CUSTOMER-ADVISOR SALKS REP Cust Unit # License # Phone # Contact # COMPLETION DATE: RTL UNIT: YEAR: 2002 MAKE/MODEL: INTERNATIONAL/4900:IH SERIAL: 1HTSHAAR12H537200 MILEAGE: 109,712 MI Date in Service...: Pront Diff Model...: Engine Make/Model..: INTERNATIONAL/DT466 Front Diff Serial ..: Engine Serial No...: Rear Diff Model ...: Trans Model..... / Rear Diff Serial ...: Job 1 PERFORM STAGE 1 XPRESS CHECK took on a long test with lap top still cant duplicate problem put \$75.00 of fuel in truck , test drove 45 minuets to get to act up , found codes for the cam sensor and damage at pigtail. quoted a CAM sensor and pigtail, found left steer axle wheel seal leaking, customer declined repairs. Sales Oty UOM Item number Item description COR Unit rate Per Extension LABOR SUBTOTAL: PARTS SUBTOTAL: MISC SUBTOTAL .: COUPON SUBTOTAL :: EPA FEE SUBTOTAL .: SHOP SUPPLIES FEE . . : MACHINE CHARGE ..: JOB SUBTOTAL . . : Job 2 camshaft position sensor

changed sensor and connector Sales Oty UOM Item number Item description COR Unit rate Per Extension 1.000 EA CAM POSITION SENSOR, T444E 1.000 EA CONNECTR, CONNECTOR CAMP SENSOR 1.000 RA SHIPPING AND HANDLING 6.000 EA CABLE TI SUBTOTAL

TAX STATUS/STATE

PLEASE PAY (USD) SALES TAX

CONTINUED

TERMS Due on Receipt

INVOICE DATE 10/24/2022 PAGE: 2 of 05 Service Invoice ANY WARRANTIES ON THE PRODUCTS PROVIDED BY RUSH ARE SOLE.Y THOSE MADE BY THE PRODUCT MANUFACTURER, EXCEPT FOR THE LIMITED SERVICES WARRANTY SET FORTH IN THE RUSH TERMS AND CONDITIONS OF PARTS MUST BE RETURNED IN THEIR ORIGINAL BOX, PART RETURNS MAY BE SUBJECT TO A RESTOCKING FEE. USTOMER-PO Order No. MAIN NUMBER CUSTOMER-ADVISOR SALES REP LABOR SUBTOTAL: PARTS SUBTOTAL: MISC SUBTOTAL .: COUPON SUBTOTAL .: EPA FEE SUBTOTAL .: SHOP SUPPLIES FEE . . : MACHINE CHARGE. .: JOB SUBTOTAL . . : Job 3 21 Point Inspection found left front wheel seal leaking (Tech 13776 on 2022-10-11 at 09:51:01) they did not want to fix it (Tech 13776 on 2022-10-11 at 10:10:09) Sales Qty UOM Item number Item description COR Unit rate Per Extension LABOR SUBTOTAL: PARTS SUBTOTAL: MISC SUBTOTAL .: COUPON SUBTOTAL .: EPA FEE SUBTOTAL .: SHOP SUPPLIES FEE . . : MACHINE CHARGE . . : JOB SUBTOTAL . : Job 4 R&R INJECTORS truck has a slight engine miss, performed fuel injector cut out test recommended replacing all injectores.

disconnect batteries remove a/c compressor, turbo pipes, air box, ecm, ecm mount, and wire harness pull dog house remove valve cover wire loom and injectors vac oil out of cylinders and clean fuel spill install torque all 6 injectors install injector harness install valve cover/intake, a/c compressor and a/c mount, ecm mount and ecm wiring harness, air line, air box, turbo pipe belt tensioner and belt install doghouse zip tie engine harness and replace clamp nuts and bolts in engine bay that snapped off from rust during repair showed icp low pressure code had to clean connector pulled outside and ran PLEASE PAY (USD) SALES TAX SUBTOTAL TAX STATUS/STATE CONTINUED TERMS Due on Receipt

INVOICE DATE 10/24/2022 PAGE:3 of on

Service Invoice

CUSTOMER-PO

Order No.

MAIN-NUMBER

CUSTOMER-ADVISOR

SALES REP

till up to temp for test drive picked up hay tagged and took cores to parts oil leak on test drive pull valve cover check gasket oil leak pull ecm start and check for leaks pull valve cover check gasket found oil pressure sensor broken during reassembly replaced started and ran no leaks found park in spot 19

Sales Qty UOM Item number

6.000 EA

Item description

REMANUFACTURED HEUI BI INJECTOR

COR Unit rate Per Extension

6.000 EA

1.000 EA 1.000 EA

1.000 EA

REMANUFACTURED HEUI BI INJECTOR-CORE CHG

SEAL, RING O #214

RING O SIZE 124 RGT NON-CHLORINATED BRAKE CLEANER

> LABOR SUBTOTAL: PARTS SUBTOTAL: MISC SUBTOTAL .: COUPON SUBTOTAL : EPA PEE SUBTOTAL .: SHOP SUPPLIES FEE . . : MACHINE CHARGE . . : JOB SUBTOTAL . . :

Job 5 ROADTEST TO VERIFY COMPLAINT

Sales Qty UOM Item number

Item description

LABOR SUBTOTAL: PARTS SUBTOTAL: MISC SUBTOTAL .: COUPON SUBTOTAL : EPA FEE SUBTOTAL .: SHOP SUPPLIES FEE . . : MACHINE CHARGE . . : JOB SUBTOTAL . . :

COR Unit rate Per Extension

Job 43 CORES

CORES

SUBTOTAL

TAX STATUS/STATE

SALES TAX

PLEASE PAY (USD)

CONTINUED

TERMS Due on Receipt

INVOICE DATE 10/24/2022 09:18:45CST PAGE:4 of 05 Service Invoice ANY WARRANTIES ON THE PRODUCTS PROVIDED BY RUSH ARE SOLELY THOSE MADE BY THE PRODUCT MANUFACTURER, EXCEPT FOR THE LIMITED SERVICES WARRANTY SET FORTH IN THE RUSH TERMS AND CONDITIONS OF PARTS MUST BE RETURNED IN THEIR ORIGINAL BOX. PART RETURNS MAY BE SUBJECT TO A RESTOCKING FEE SUSTOMER-PO Order No. MAIN-NUMBER CUSTOMER-ADVISOR SALES REP Sales Qty UOM Item number Item description COR Unit rate Per Extension - 6.000 EA REMANUFACTURED HEUI BI INJECTOR-CORE RET LABOR SUBTOTAL: PARTS SUBTOTAL: MISC SUBTOTAL .: COUPON SUBTOTAL .: BPA FEE SUBTOTAL .: SHOP SUPPLIES FEE . . : MACHINE CHARGE ..: JOB SUBTOTAL . . : Employee(s) on above job : *TOTAL LABOR: *TOTAL PARTS: *TOTAL MISC.: *TOTAL COUPON .: *TOTAL EPA ..: *TOTAL SHOP .: *TOTAL MACHINE: SALES TAX PLEASE PAY (USD) TAX STATUS/STATE SUBTOTAL CONTINUED TERMS Due on Receipt

Service Invoice

Service Invoice

Service Invoice

Service Invoice

S	SUBTOTAL TAX	K STATUS/STATE	SALES TAX	PLEASE PAY (US	(D)
					100
				3385.13	200