

Invoice: 1223

Date: 1/18/2022

Bill To
Panther Transport Logistics

P: (614) 5048085

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
2253	Net 30	2/17/2022	Mike		FAULKNER, MIKE	431

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: Need second Mattress for second driver

Cause: Customer request

Labor Correction:

Chassis / Cab Hardware / Put a second mattress in the bunk for the second driver. - 1/18/2022

Parts	Mattress	1.00000		
-------	----------	---------	--	--

Complaint: Dim lights not working on left side

Cause: Customer request

Labor Correction:

Chassis / Lighting & Electrical / Replaced the blown bulb and inspected and found that the connecting ring was broken. Customer needed the unit before the part could come in so will replace the ring at a later time. - 1/18/2022

Parts	Lamp	1.00000		
-------	------	---------	--	--

Complaint: Right rear air bag leaking

Cause: Customer request

Labor Correction:

Chassis / Air Brake / Removed and replaced the air bag with a new stud and new fitting. Suspension is leveling now and has no leaks at this time. - 1/18/2022

Parts	Stud-Air Spring	1.00000		
-------	-----------------	---------	--	--

Parts	Spring Assy	1.00000		
-------	-------------	---------	--	--

Parts	Standpipe Tee Fitting 1/2"X1	1.00000		
-------	------------------------------	---------	--	--

Parts	Nylon Push-Lock Fitting-Male	1.00000		
-------	------------------------------	---------	--	--

Complaint: Right rear brake chamber leaking

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Cause: Customer request

Labor Correction:

Chassis / Air Brake / Removed the brake chamber and replaced it with a new one. Verified that the brakes are setting and releasing as they should and that there are no leaks. - 1/18/2022

Parts	3030 Long Stroke Welded Clevis	1.00000		
-------	--------------------------------	---------	--	--

Complaint: Left Wheel Seal Leaking

Cause: Customer request

Labor Correction:

Chassis / Suspension / Removed the wheels, brakes and the hub. Replaced the wheel seal in the hub and reinstalled the hub, reinstalled the axle with a new axle gasket, replaced the brake shoes, hardware and drum since the brakes were all soaked in oil. - 1/18/2022

Parts	Kit-Seal Service	1.00000		
Parts	Gasket-Axle Shaft	1.00000		
Parts	Q+ Brake Shoe	2.00000		
Parts	Brake Kit 16.5 R/W Q Shoe	1.00000		
Parts	Unimount Brake Drum	1.00000		

Complaint: Replace the Brake Pressure valve and air pressure sensors

Cause: Customer request

Labor Correction:

Chassis / Air Brake / Replaced the pressure valve and then replaced the 3 pressure sensors behind the ignition switch. - 1/18/2022

Parts	Valve-Pressure Protection	1.00000		
Parts	Freight	1.00000		
Parts	Air Brake Pressure Sensor	3.00000		

Complaint: Check Fluids

Cause: Customer request

Labor Correction:

Engine / Cooling / Checked the fluid levels and found that the coolant level was low. Topped off the coolant level. - 1/18/2022

Parts	MAC HEAVY DUTY ANTIFREEZE 50/50	2.00000		
-------	---------------------------------	---------	--	--

Complaint: Computer Diagnostic

Cause: Customer request

Item	Description	Quantity	Rate	Amount
Labor	Correction: Computer Diagnostic / Computer Diagnostic / Connected the diagnostic computer and read a trouble code for pressure sensor not calibrated. Went through the trouble shooting procedures and was instructed to change the pressure valve. Replaced the pressure valve and still had the same issues so replaced the pressure sensors and the codes went away. - 1/18/2022			

Diagnostic Computer Connect

Unit: 431 (Peterbilt) **VIN:** 1XP4DP9X6GD224289

2016 Peterbilt 587

Chassis: 606,906 Miles

Total \$2,717.74

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that US Diesel & Fab Inc makes no warranties of any kind unless expressed in writing.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that US Diesel & Fab Inc is not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you/or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

Item	Description	Quantity	Rate	Amount
Labor	Correction: Engine / Exhaust / Inspected and found a broken clamp. Replaced the clamp and verified that the exhaust isn't leaking. - 2/15/2022			
Parts	Clamp	1.00000		
			Subtotal	\$66.03

Complaint: Right 1/4 fender missing

Cause: Customer request

Labor **Correction:**
Chassis / Cab Hardware / Installed the new 1/4 fender on the right side. - 2/15/2022

Parts	1/4 Fender Right	1.00000		
			Subtotal	\$69.49

Complaint: Shocks leaking oil

Cause: Customer request

Labor **Correction:**
Chassis / Suspension / Removed the rear shocks on the unit and replaced them with new ones. - 2/15/2022

Parts	Meritor Shocks	2.00000		
			Subtotal	\$265.50

Complaint: MV-3 Valve not setting

Cause: Customer request

Labor **Correction:**
Chassis / Air Brake / Removed the valve and replaced it with a new one. Verified that the brakes release when knob is pushed in and the knob pops out when the air pressure is below 60 psi. - 2/15/2022

Parts	Bendix MV-3 Dash Control Valve	1.00000		
Parts	Connector Push Style 3/8" x 3/8NPT	4.00000		
Parts	Connector - Push In Style 1/2"	1.00000		
			Subtotal	\$373.15

Unit: 431 (Peterbilt) **VIN:** 1XP4DP9X6GD224289
2016 Peterbilt 587
Chassis: 613,724 Miles

Total \$1,775.19

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that US Diesel & Fab Inc makes no warranties of any kind unless expressed in writing.

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
BLACK CHER	16	PETERBILT 587	1XP4DP9X6GD224289		617246/617246	224289	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
16AUG19 DD			23:00 28FEB22			CASH	28FEB22
R.O. OPENED		READY		OPTIONS: SOLD-STK:6GD224289 ENG:Paccar TRN:FULLER			
28FEB22		28FEB22		AXL:10			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CEL-DERATE

SPF-00-000-1198 CEL-DERATE

40103 CSVM

210.00

TECH TECHNOLOGY

50.00

PARTS: 0.00 LABOR: 210.00 OTHER: 50.00 TOTAL LINE A:

617246

INSPECTED UNIT FOR DERATE, CUSTOMER STATED THEY STOPPED TO UNLOAD THEN WHEN LEAVING TRUCK WAS WENT INTO LIMP MODE, CONNECTED TO UNIT, PRINTED FAULTS TO PDF AND UPLOADED TO CASE, WAS UNABLE TO COMMUNICATE WITH EAS-3, UNIT HAD 4 ACTIVE FAULTS FOR CAN COMMUNICATION TIME OUT FROM BRAKE SYSTEM, NO AFTER-TREATMENT FAULTS. FOUND OUT AFTER-TREATMENT SYSTEM HAS BEEN DELETED. CAN NOT UPDATE SOFTWARE DUE TO AFTERTREATMENT DELETE. CUSTOMER WILL NEED TO TAKE TRUCK TO A SHOP FOR FURTHER DIAG. INSPECTED UNIT FOR DERATE, CUSTOMER STATED THEY STOPPED TO UNLOAD THEN WHEN LEAVING TRUCK WAS WENT INTO LIMP MODE, CONNECTED TO UNIT, PRINTED FAULTS TO PDF AND UPLOADED TO CASE, WAS UNABLE TO COMMUNICATE WITH EAS-3, UNIT HAD 4 ACTIVE FAULTS FOR CAN COMMUNICATION TIME OUT FROM BRAKE SYSTEM, NO AFTER-TREATMENT FAULTS. FOUND OUT AFTER-TREATMENT SYSTEM HAS BEEN DELETED. CAN NOT UPDATE SOFTWARE DUE TO AFTER-TREATMENT DELETE. CUSTOMER WILL NEED TO TAKE TRUCK TO A SHOP FOR FURTHER DIAG.

B MOBILE TRAVEL

SPF-00-000-1198 MOBILE TRAVEL

40103 CSVM

84.00

MBLSVC MOBILE SERVICE

150.00

PARTS: 0.00 LABOR: 84.00 OTHER: 150.00 TOTAL LINE B:

617246 TRAVELLED TO CUSTOMER'S LOCATION

EST: 0.00 28FEB22 09:33 SA: 40103

CONTACT:

CUSTOMER PAY SHOP SUPPLIES FOR REPAIR ORDER

DESCRIPTION	
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
BLACK CHER	16	PETERBILT 587	1XP4DP9X6GD224289		617246/617246	224289	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
16AUG19 DD			23:00 28FEB22			CASH	28FEB22
R.O. OPENED		READY	OPTIONS: SOLD-STK:6GD224289 ENG:Paccar TRN:FULLER				
28FEB22		28FEB22	AXL:10				

Thanks for your business!
Prefer emailed invoices/statements?
Contact ar@tlgtrucks.com for details

DESCRIPTION
LABOR AMOUNT
PARTS AMOUNT
GAS, OIL, LUBE
SUBLET AMOUNT
MISC. CHARGES
TOTAL CHARGES
LESS INSURANCE
SALES TAX
PLEASE PAY THIS AMOUNT

Invoice: 1317

Date: 2/28/2022

Bill To
Panther Transport Logistics

P: (614) 5048085

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
2346	Net 30	3/30/2022	Mike		FAULKNER, MIKE	431

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: Trailer Brakes Locking up and not Releasing

Cause: Customer request

Labor Correction:

Chassis / Air Brake / Came in and found that the tractor protection valve on the firewall was bypassing sometimes and sending pressure through the service line to the trailer brakes. Replaced the Valve and verified that the trailer brakes were releasing and the unit was able to move freely. - 2/28/2022

Parts Valve-Brake

1.00000 \$

Subtotal \$692.50

Unit: 431 (Peterbilt) **VIN:** 1XP4DP9X6GD224289

2016 Peterbilt 587

Chassis: 616,856 Miles

Total \$707.59

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that US Diesel & Fab Inc makes no warranties of any kind unless expressed in writing.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that US Diesel & Fab Inc is not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you/or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

Invoice: 1311

Date: 2/24/2022

Bill To

Panther Transport Logistics

P: (614) 5048085

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
2335	Net 30	3/26/2022	Mike		FAULKNER, MIKE	431

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: Trailer brakes locking up**Cause:** Customer request**Labor Correction:**

Chassis / Air Brake / Removed the air brake foot valve and replaced it with a new one. Verified that the brakes are working correctly and none of the fittings are leaking. Verified that the trailer brakes are releasing.
- 2/24/2022

Parts Valve-Brake

1.00000

Subtotal \$752.16**Unit:** 431 (Peterbilt) **VIN:** 1XP4DP9X6GD224289

2016 Peterbilt 587

Chassis: 615,168 Miles**Total** \$788.91

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that US Diesel & Fab Inc makes no warranties of any kind unless expressed in writing.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that US Diesel & Fab Inc is not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you/or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

Invoice: 1426

Date: 4/11/2022

Bill To
Panther Transport Logistics

P: (614) 5048085

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
2452	Net 30	5/11/2022	Mike		FAULKNER, MIKE	431

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: Left Headlight not working

Cause: Customer request

Labor Correction:

Chassis / Lighting & Electrical / Checked the headlight and it is getting water inside and burning up the ballast. Removed the head light and replaced with a new one. Verified that the lights are all working. - 4/11/2022

Parts Headlamp Assy 1.00000

Subtotal \$1,259.14

Complaint: Wipers Need Replaced

Cause: Customer request

Labor Correction:

Chassis / Cab Hardware / Removed old blades and installed new ones. - 4/11/2022

Parts ANCO Kwik-Connect Wiper Blade 20" 1.00000

Parts 22" Winter Blade 1.00000

Subtotal \$48.01

Complaint: Truck Will not Turn Off

Cause: Customer request

Labor Correction:

Chassis / Lighting & Electrical / Found no power going to the fuel shut off solenoid. Removed the fuel cut out fuse and replaced it. And the engine shuts off, starts and shuts off like it should. - 4/11/2022

Subtotal \$105.00

Complaint: 'B' Full Wet Service (Lube, Oil & Filters)

Cause: Customer request

Item	Description	Quantity	Rate	Amount
Labor	Correction: Engine / Lubrication / Changed the engine oil, oil filters, fuel filters and the air filter. Checked all fluids, greased all grease points, checked the tires, checked and adjusted the brakes. - 4/11/2022			
Parts	T3 CONVENTIONAL OIL	11.00000		
Parts	Oil Filter	1.00000		
Parts	Oil Filter	1.00000		
Parts	Fuel Filter	1.00000		
Parts	Fuel Filter	1.00000		
Parts	Air Filter	1.00000		

Complaint: Fuel Primer Needs Replaced.

Cause: Customer request

(Inspection)

Labor Correction:

Engine / Fuel / During the PM found that the primer was not working and needed to be replaced. Removed the primer and replaced it with a new one. Primed the fuel system and verified no leaks. - 4/11/2022

Parts Pump-Manual

1.00000

Unit: 431 (Peterbilt) **VIN:** 1XP4DP9X6GD224289

2016 Peterbilt 587

Chassis: 621,703 Miles

Total \$2,174.38

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that US Diesel & Fab Inc makes no warranties of any kind unless expressed in writing.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that US Diesel & Fab Inc is not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you/or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

431

Parts: \$1,041.83
 Labor: \$4,032.00
 Core: \$0.00
 Waste: \$150.38
 Shop: \$2880.00
 Tax: \$2100.00
 Total: \$12,284.21

ESTI - Unit was checked
 and OK in the
 shop.
 ESTI - Approval for
 repair - A/C UNIT
 TEST SENT FOR
 A/C UNIT

Panther Transport Logistics Inc.	Unit #: 760136
Address: 3600 ENTERPRISE AVENUE COLUMBUS, OH 43228	Asset: 2016 Peterbilt 587 Serial #: GD224289 VIN: 1XP4DP9X6GD224289 Engine: MX-13 Engine Hours: 19047
Phone: (614) 504-8085 Fax: Cust #: 234964	Miles: 617,246 Warranty Start: 11/18/2015 In Service: 6 Years 4 Months



Complaint:
 REMOVE AND REPLACE MAIN POWER RELAY , ROAD TEST , VERIFY REPAIR , REMOUNT AND RECALIBRATE RADAR ,
 CLEAR FAULTS ROAD TEST VERIFY REPAIR REMOVE AND REPLACE A/C COMPRESSOR AND DRYER CORRECT WIRING ,
 DIAG WHY A/C IS NOT WORKING PROPERLY , REPLACED FREEZE SWITCH RAN A/C BLOWING HOT FOUND BLEND DOOR
 BROKEN , REMOVE AND REPLACE BLEND DOOR AND ACTUATOR RIPPED O RING ON OIL FILTER CAP REMOVED AND
 REPLACE O RING AND FILTER RAN UNIT-VERIFIED NO LEAKS AT THIS TIME

Operation	Operation	Labor	Parts	Core Charge	Total
1	DIAG. CHECK ENGINE LIGHT ON-TRUCK WILL NOT GO OVER 1200 RPMS Parts: (1.0) RELAY 70AMP, (1.0) SWITCH-TEMP EVAPORATOR, (1.0) TECH FEE, (20.0) WIRE TIE BLK .19 X 14.5", (3.0) KIT-ANCHOR WINGMAN Complaint: DIAG CEL ON Cause: FAILED MAIN POWER RELAY Correction: REMOVE AND REPLACE MAIN POWER RELAY , ROAD TEST , VERIFY REPAIR , REMOUNT AND RECALIBRATE RADAR , CLEAR FAULTS ROAD TEST VERIFY REPAIR	\$840.00	\$218.58	\$0.00	
2	C/A CAB A/C-NOT WORKING Parts: (1.0) ACTUATOR MODE, (1.0) COMPRESSOR-HVAC SLIMLINE, (1.0) DOOR ASSY- AIR- BLEND- HVAC, (1.0) DRYER-RECEIVER W/DYE W/SLPR Correction: REMOVE AND REPLACE A/C COMPRESSOR AND DRYER CORRECT WIRING , DIAG WHY A/C IS NOT WORKING PROPERLY , REPLACED FREEZE SWITCH RAN A/C BLOWING HOT FOUND BLEND DOOR BROKEN , REMOVE AND REPLACE BLEND DOOR AND ACTUATOR	\$3,024.00	\$781.21	\$0.00	
3	C/A OIL LEAK Parts: (1.0) PACCAR OIL ELEMENT Correction: RIPPED O RING ON OIL FILTER CAP	\$168.00	\$42.04	\$0.00	

Notes: [3/7/2022 at 09:44 pm EST] - Unit was checked in at TLG - Peterbilt of Raleigh, arrival time: . NOTE: UNIT CHECKED IN , THANK YOU CONNOR
Repair status set to Checked-in.

[3/7/2022 at 10:33 pm EST] - Approval Requested for the estimate version 1, total \$459.76. View the estimate. NOTE: UNIT HAS FAILED MAIN POWER RELAY , PARTS REQUEST SENT FOR NEW RELAY , NEED TO ROAD TEST AFTER RELAY REPLACED , THANK YOU CONNOR
Repair status set to Hold (auth).

[3/9/2022 at 07:24 am EST] - Approval Requested for the estimate version 2, total \$4,434.06. View the estimate. NOTE: quote for a/c with parts and freight at this time
Repair status set to Hold (auth).

[3/15/2022 at 01:01 pm EDT] - BEN IS THE DIRECT CONTACT TO THESE REPAIRS. UPDATING INFORMATION (NOTE- THESE REPAIRS WERE APPROVED) PLEASE LET BEN KNOW IF YOU NEED ANYTHING

[3/17/2022 at 09:45 pm EDT] - Approval Requested for the estimate version 3, total \$5,840.28. View the estimate. NOTE: A/C COMPRESSOR RELAY PIN 86 IS GETTING POWER AND IS SUPPOSED TO BE GROUND POSSIBLE WIRING ISSUE IN CAB NEAR RELAY , NEEDS MORE DIAG , THANK YOU CONNOR
Repair status set to Hold (auth).

[3/23/2022 at 05:17 pm EDT] - Asset is Ready. NOTE: UNIT IS COMPLETE , PAPER WORK NEEDS TO BE COMPLETED , THANK YOU CONNOR
Repair status set to Complete (here).

Parts:
Labor:
Core:
Haz. Waste:
Shop:
Freight:
Tax:

TOTAL: \$5,925.93

BUS:		CELL:		SERVICE ADVISOR:		DATE:	
COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
BLACK CHER	16	PETERBILT 587	1XP4DP9X6GD224289		617246/617246	TB777	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
16AUG19 DD			23:00 08MAR22			CASH	29MAR22
R.O. OPENED		READY		OPTIONS: SOLD-STK:6GD224289 ENG:Paccar TRN:FULLER			
04MAR22		29MAR22		AXL:10			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	F69-1018	COMPRESSOR-HVAC	SLIMLINE				
1	F37-1022-100	DRYER-RECEIVER W/DYE W/SLPR					
1	530081BSM	DOOR ASSY- AIR- BLEND- HVAC					
1	SR2000017	ACTUATOR MODE					

PARTS: 781.21 LABOR: 3024.00 OTHER: 224.80 TOTAL LINE B: 617246 UNIT CAME IN FOR A/C NOT WORKING , INSPECTED A.C SYSTEM FOUND CUSTOMER HAD TAMPERED WITH WIRING ON A/C SYSTEM TO TURN COMPRESSOR ON YOU HAVE TO TURN A SWITCH ON INSIDE THE CAB , PRESSURE SWITCH WRING AS HAS BEEN SPLICED TOGETHER , NEED TO CORRECT WIRING AND REPLACE ALL A/C PARTS. RECOVERED FREON, REMOVED BELT, ALTERNATOR AND A/C COMPRESSOR. REPLACED A/C COMPRESSOR AND REINSTALLED ALTERNATOR AND FILLED UNIT BACK UP WITH FREON AND OIL. AFTERWARDS WHEN THE UNIT IS RUNNING THE COMPRESSOR WILL STILL NOT CLICK ON. CHECKED VOLTAGE AT THE COMPRESSOR AND HAD 0 VOLTS. CHECKED PRESSURE SENSOR NEAR THE COMPRESSOR AND HAD 12 VOLTS . CHECKED THE 2 SENSORS ON THE TXV AND HAD 12VOLTS ON THE 1 TOWARDS THE D/S AND .25 VOLTS ON THE OTHER. CHECKED FUSES AND FOUND NONE WERE BLEW. THERE ARE 2 HVAC RELAYS SO SWITCHED THE 2 HVAC ONES WITH 2 OTHERS. AFTERWARDS NO CHANGE HAPPENED TO THE TRUCK. THEN FOUND THE HVAC SYSTEM RELAY HAD A MESSED UP TERMINAL. TRACED COMPRESSOR POWER WIRE TO PIN 4 ON THE CAB HARNESS USING SCHEMATIC. HAD NO VOLTS COMING OUT OF PIN 4 BUT HAD CONTINUITY BETWEEN PIN 4 AND COMPRESSOR CONNECTOR. THEN TRACED PIN 4 TO THE AC COMPRESSOR THEN THE THE HVAC CONTROL MODULE. ON PIN 86 OF THE AC COMPRESSOR RELAY THERE IS VOLTAGE WHEN IT IS SUPPOSED TO BE THE GROUND PIN. THE PROBLEM IS SOMEWHERE IN THE CAB NEAR THE RELAY. CHECKED OUT FOR THE COMPRESSOR NOT COMING ON. THERE WAS POWER TO THE PRESSURE SWITCHES BUT NO POWER TO THE COMPRESSOR. REMOVED THE COVER TO THE BLOWER MOTOR ON THE FIRE WALL. TESTED THE FREEZE SWITCH AND THERE WAS POWER ON ONLY ONE SIDE. JUMPED THE SWITCH AND THE COMPRESSOR CAME ON. NEED TO REPLACE THE FREEZE SWITCH. REPLACED FREEZE SWITCH. RAN UNIT AND IT WASNT BLOWING OUT AS COLD AS IT SHOULD. REMOVED HEATER CORE AND FOUND THE BLEND DOOR WAS BROKEN. PULLED A/C BOX OUT AND SPLIT IT WIDE ENOUGH TO REMOVE AND REPLACE BLEND DOOR. ALSO REMOVED AND REPLACED TEMP ACTUATOR. REINSTALLED A/C BOX AND HEATER CORE. RAN ENGINE AND IT IS BLOWING COLD

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER SIGNATURE



BUS:		CELL:		SERVICE ADVISOR: 142804 BRANDON SLEDGE	
COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT
BLACK CHER	16	PETERBILT 587	1XP4DP9X6GD224289		617246/617246
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	INV. DATE
16AUG19 DD			23:00 08MAR22		29MAR22
R.O. OPENED	READY	OPTIONS: SOLD-STK:6GD224289 ENG:Paccar TRN:FULLER			
04MAR22	29MAR22	AXL:10			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A/C NOW.							

C** C/A OIL LEAK
 SPF-00-000-1198 C/A OIL LEAK
 99 CSV 184.80
 1 1948921PE PACCAR OIL ELEMENT
 PARTS: 42.04 LABOR: 184.80 OTHER: 0.00 TOTAL LINE C:
 617246 UNIT CAME IN FOR OIL LEAK , WHILE RUNNING UNIT FOUND OIL
 LEAK COMING FROM OIL FILTER , REMOVED AND INSPECTED OIL FILTER CAP O
 RING FOUND DAMAGE , REMOVED AND REPLACE O RING AND FILTER RAN UNIT
 VERIFIED NO LEAKS AT THIS TIME

EST: 0.00 08MAR22 07:49 SA: 142804
 CONTACT:

CUSTOMER PAY SHOP SUPPLIES FOR REPAIR ORDER
 sfp kh 3/24

 Thanks for your business!
 Prefer emailed invoices/statements?
 Contact ar@tlgtrucks.com for details

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	5925.93



Sales Receipt

Invoice #514904RA_RAL-S_2022-03-04

Clerk ID :kh40082

CASH SALE - APPROVED

DATE:3/29/2022, 10:02:51 AM

TRANS TYPE:SALE

TRANS ID: 000001420039

REFID:PAYAPI-8B8CBBBC-2C27-4341-8-CASH-BB9C-C931

Amount Paid

\$5,925.93

Invoice:

1432

Date:

4/12/2022

Bill To

Panther Transport Logistics

P: (614) 5048085

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
2457	Net 30	5/12/2022	Mike		FAULKNER, MIKE	431

Item	Description	Quantity
------	-------------	----------

Complaint: Replace the LR and RF drive Axle Shocks**Cause:** Customer request**Labor Correction:**

Chassis / Suspension / Removed the LR shock and the RF shock from the drive axles and replaced with new shocks and secured them in place. - 4/12/2022

Parts	Meritor Shocks	2.00000
-------	----------------	---------

Complaint: Left Steer Shock needs Replaced**Cause:** Customer request**Labor Correction:**

Chassis / Suspension / Removed the left steer shock and replaced with a new one and secured it in place. - 4/12/2022

Parts	Shock Absorber	1.00000
-------	----------------	---------

Complaint: Left Cab Shock Leaking**Cause:** Customer request**Labor Correction:**

Chassis / Cab Hardware / Found that the left shock was leaking and after talking with the dealer learned that the cab shocks have been updated so need to be replaced in pairs. Removed both cab shocks and replaced with the updated shock and new top bolts and nuts. - 4/12/2022

Parts	Shock Absorber	2.00000
-------	----------------	---------

Parts	Bolt-Hex M16	2.00000
-------	--------------	---------

Parts	Nut-Hex	2.00000
-------	---------	---------

Total \$721.02

Unit: 431 (Peterbilt) VIN: 1XP4DP9X6GD224289

Invoice: 1537

Date: 5/26/2022

Bill To
Panther Transport Logistics

P: (614) 5048085

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
2545	Net 30	6/25/2022	Mike		Strode, Ben	431

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: Tires on front and back need rotated or readjusted

Cause: Customer request

Labor Correction:

Chassis / Tire & Wheels / Took the truck to have the steer tires balanced and checked for out of round. Found that the steer tire on the right side had irregular wear from prior suspension issues. Replaced the two steer tires on the truck and are using the good tire from the left on another unit for the customer, found that the other one will work as a good used tire for a trailer. Jacked the rear axles up and rotated the drive tires to get even wear and longer life. Lug nut torque needs checked in 50 miles. - 5/26/2022

Parts	FS 295/75R22.5/G FS591 A/P	2.00000		
Parts	295/75R22.5 M726 Cap	2.00000		
Parts	Tire disposal	1.00000		

Complaint: Running lights are not working

Cause: Customer request

(Inspection)

Labor Correction:

Chassis / Lighting & Electrical / Installed the old running lights that had been removed prior to electrical issues being corrected and verified that they are working. - 5/26/2022

Complaint: Brakes need adjusted or replaced

Cause: Customer request

(Inspection)

Labor Correction:

Chassis / Air Brake / Checked the brakes and adjusted them. - 5/26/2022

Complaint: Losing Coolant

Cause: Customer request

(Inspection)

Item	Description	Quantity	Rate	Amount
Labor	Correction: Engine / Cooling / Removed the reservoir cap and found that the gasket was missing. Pressure tested the coolant system and found no leaks anywhere. Topped off the coolant reservoir - 5/26/2022			
Parts	Radiator Cap	1.00000		
Parts	Antifreeze Powergard ELC HD 50-50	1.00000		

USED295 x2

Unit: 431 (Peterbilt) **VIN:** 1XP4DP9X6GD224289
2016 Peterbilt 587
Chassis: 630,470 Miles

Total \$2,089.12

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that US Diesel & Fab Inc makes no warranties of any kind unless expressed in writing.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that US Diesel & Fab Inc is not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you/or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

Company Name Panther Logistics Inc			Driver's Name			ID	License		# 214 163858	
Address			CHK	Pymt. Type	Card # 1706187564	607.14	PO #	Authorized by 158654		
			Tax Exempt #			Written by jmc	Work Performed by sew			
City Columbus	State OH	Zip 43207	Written 06/01/22	09:39	Begun 06/01/22	10:00	Completed 06/01/22	13:06	Paid 06/01/22	13:13
Tractor # 431	Year 16	Make/Model PB PB	License # TEMP OH		Odometer 662683	VIN # 224289	Engine Make/Model OTHER			
Trailer #	Year 00	Make/Model	License #		Hubodometer					

Work Requested 051 - GENERAL ACCESSORIES : 000 - GENERAL ACCESSORIES : 000 - GENERAL ACCESSORIES : POSITION
UNIT SVCD: TRACTOR - : REASON FOR REPAIR - : COMMENT - C/A WATER PUMP BELT - TENSIONER/PULLEY STILL SPINNING NOT LOCKED
UP - DOESN'T HAVE PARTS NUMBER ON IT - PACCAR ENGINE - VIN GD224289 : GENERIC COMMENTS - ;
BREAKDOWN NOTES - --API

SERVICE	PLU #	PART NUMBER	DESCRIPTION	UOM	REG. PRICE	PRICE	QTY	EXTENDED AMOUNT
ROAD	997 001		TA ROAD SERVICE MILEAGE	ML			78.00	
SL	531 999	D84-1003-082078	BELT	EA			1.00	
SL	997 002		SHOP SUPPLY/ENVIRONMENTAL FEE	EA			1.00	
SL	998 006		ROAD SERVICE LABOR	HR			3.10	
		CHECK NUT TORQUE SPEC BETWEEN	50-100 MILES OF OPERATION AFTER WHEEL					
		SERVICE AS RECOMMENDED BY ATA-TMC, NWRA, AND TRUCK OE MANUFACTURERS.						
		Your feedback matters. Tell us about your visit for a chance to win a \$250 gift card at www.tafeedback.com .						
AMOUNT TENDERED:								607.14
Parts :	69.17	New Tires :	0.00	Total :	622.77	Non-taxable :	0.00	ENV/WST Tax: 0.00
Labor :	553.60	Used Tires :	0.00	Discount :	50.00	Taxable :	572.77	TOTAL ► \$ 607.14
Oil :	0.00	Trade-In :	0.00	Net :	572.77	Tax :	34.37	CHANGE RETURNED: 0.00

Technician Comments WENT TO HUNTERS CLEARFIELD TO GET BELT REPLACED BE LT AND TRUCK IS RUNNING THANK YOU SEW

Remarks

Invoice: 1943

Date: 12/19/2022

614-639-6399

Bill To
Panther Transport Logistics

P: (614) 5048085

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
2975	Net 30	1/18/2023	Mike		Wessa, Mike	431

Item	Description	Quantity
------	-------------	----------

Complaint: Crossmember needs replaced**Cause:** Crossmember replaced **Type:** Other

Labor **Correction:**
Chassis / Frame / replace crossmember - Completed: 12/19/2022

Parts	Crossmember - E	1.00000
-------	-----------------	---------

Complaint: 7-way not getting power to trailer to operate lights**Cause:** Customer request

(Inspection)

Labor **Correction:**
Chassis / Lighting & Electrical / Installed connector plug - Completed: 12/19/2022

Parts	Clamp-V Band 5"	2.00000
-------	-----------------	---------

Parts	7-way Plug w/cable guard	1.00000
-------	--------------------------	---------

Parts	Push in style-5/3	1.00000
-------	-------------------	---------

Unit: 431 (Peterbilt) **VIN:** 1XP4DP9X6GD224289
2016 Peterbilt 587
Chassis: 657,958 Miles

Total \$744.49

Payment Information

Date	Payment #	Method	Reference #	Amount
12/19/2022	3686069	ACH	12192022	\$744.49

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that US Diesel & Fab Inc makes no warranties of any kind unless expressed in writing.

Invoice: 1959

Date: 12/30/2022

Bill To
Panther Transport Logistics

P: (614) 5048085

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
2989	Net 30	1/29/2023	Mike		Wessa, Mike	431

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: Won't go over 63 mph, No heat when driving, red airline has a hole in it, brakes are sticking

Cause: truck wont go over 63 because the pedal needs to be replaced. replace coolant sensor. relace redline. and clean the brakes

Labor **Correction:**
Engine / Electrical / Replace pedal, rewd airline, and coolant sensor, clean up the brakes - Completed: 12/30/2022

Parts Pedal - Throttle Assy

Unit: 431 (Peterbilt) VIN: 1XP4DP9X6GD224289
2016 Peterbilt 587
Chassis: 657,987 Miles

Total \$999.82

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that US Diesel & Fab Inc makes no warranties of any kind unless expressed in writing.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that US Diesel & Fab Inc is not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you/or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

Invoice: 2040
Date: 2/21/2023

Bill To
Panther Transport Logistics

P: (614) 5048085

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
3038	Net 30	3/23/2023	Mike		Dietrich, Alicia	431

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: Left brake gets hot when going down hill

Cause: Customer request

Labor **Correction:**
Chassis / Air Brake / air chamber replaced - Completed: 2/21/2023

Parts	SLACK ADJUSTER	1.00000		
-------	----------------	---------	--	--

Parts	TYPE 24 CHAMBER CLEVIS WELDED	1.00000		
-------	-------------------------------	---------	--	--

Complaint: Loosing Coolant

Cause: Customer request

Labor **Correction:**
Engine / Cooling / coolant leak is fixed - Completed: 2/21/2023

Parts	1/2 Ball Valve	1.00000		
-------	----------------	---------	--	--

Complaint: Inside fan doesn't work

Cause: Customer request

Labor **Correction:**
Chassis / Air Conditioning & Heating / fan is working after the coolant leak is fixed - Completed: 2/21/2023

Parts	HVAC Blower Motor Assembly	1.00000	\$	
-------	----------------------------	---------	----	--

Parts	KNOB	1.00000		
-------	------	---------	--	--

Parts	12V RESISTOR	1.00000		
-------	--------------	---------	--	--

Complaint: Oil Leak

Cause: Customer request

Labor **Correction:**
Engine / Lubrication / oil leak is fixed - Completed: 2/21/2023

Complaint: Left side seems to be leaning

Cause: Customer request

Item	Description	Quantity	Rate	Amount
Labor	Correction: Chassis / Suspension / replaced shocks - Completed: 2/21/2023			
Complaint: Thermostat				
Cause: Customer request				
Labor	Correction: Engine / Cooling / replaced theromstate - Completed: 2/21/2023			
Complaint: Carrier Bearing & Torsion bars				
Cause: Customer request				
(Inspection)				
Labor	Correction: Chassis / Suspension / replace carrier bearing - Completed: 2/21/2023			
Parts	DRIVESHAFT HARDWARE	1.00000		
Parts	YOKE	1.00000		
Parts	CARRIER BEARING	1.00000		
Parts	SYNTHETIC SAE 75W-90 OIL	1.00000		
Parts	FLEX AIR TRACKING ROD	2.00000		
Parts	REAR INPUT SEAL	2.00000		
Parts	TRIPLE LIP SEAL	1.00000		
Parts	EQUAL WHEEL BALANCE	1.00000		
Parts	HEAVY DUTY FRONT ALIGNMENT	1.00000		

Unit: 431 (Peterbilt) **VIN:** 1XP4DP9X6GD224289
 2016 Peterbilt 587
Chassis: 665,589 Miles

Total \$3,548.69

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that US Diesel & Fab Inc makes no warranties of any kind unless expressed in writing.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that US Diesel & Fab Inc is not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you/or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

Invoice

Work Order #091 279632

Company Name PANTHER TRANSPORTATION LLC			Driver's License # 091 279632			ID			License		
Address			VIS Pymt. Type			Card # XXXXXXXXXXXX9883			886.07 PO #		
									Authorized by 07523G		
			Tax Exempt #			Written by			Work Performed by		
						cve			kp dii		
City Columbus			State OH			Zip 43085			Written 02/22/23		
						16:33			Begun 02/22/23		
						17:42			Completed 02/22/23		
						21:54			Paid 02/22/23		
						22:43					
Tractor # 431			Year 15			Make/Model PB			License # PWL8928		
						OH			Odometer 677580		
									VIN # GD224289		
									Engine Make/Model OTHER		
Trailer #			Year 00			Make/Model			License #		
									Hubodometer		

Work Requested: **DARRELL BROWER REQUESTS: ROAD CALL - PILOT IN COLBY, BROWN PETERBILT**
UNIT SVCD: TRACTOR ABS SYSTEM ON TRUCK IS MESSED UP AND CAUSING THE BRAKES TO LOCK ON THE TRUCK.

SERVICE	PLU #	PART NUMBER	DESCRIPTION	UOM	REG. PRICE	PRICE	QTY	EXTENDED AMOUNT
ROAD	997 001		TA ROAD SERVICE MILEAGE	ML			42.00	
RRCF			R&R COMPLETE / FULL CHAMBER				1.00	
RRCF			R&R COMPLETE / FULL CHAMBER LABOR ONLY					
RRCF	998 002	777777	STANDARD SERVICE LABOR	HR			1.00	
SL	511 470	HDX GC3030LCW	BRAKE CHAMBER 3030 LS W/CLEVIS	EA			1.00	
SL	565 723	90681-2	1/4 X 1/4 AIR BRAKE CONNECTOR	EA			2.00	
SL	565 161	90686-2	A/B ML CON 1468X8	EA			2.00	
SL	566 135	90556	PIPE ADAPTER 3200X6X4	EA			1.00	
SL	564 352	90321-2	PIPE BUSHING 3220X6X4	EA			2.00	
SL	413 701		TIE STRAP 8 INCH	EA			2.00	
SL	413 713		18108-X HEAVY DUTY TY STRAP	EA			4.00	
SL	529 814		1/2T X 1/2P MALE CONN A/B	EA			1.00	
BA1A			BRAKE ADJ MANUAL SLACK EACH AX				1.00	
BA1A			ONLY FOR MANUAL SLACK ADJUSTER					
BA1A	998 002	777777	STANDARD SERVICE LABOR	HR			.20	
SL	997 002		SHOP SUPPLY/ENVIRONMENTAL FEE	EA			1.00	
SL	998 006		ROAD SERVICE LABOR	HR			1.50	
			CHECK NUT TORQUE SPEC BETWEEN 50-100 MILES OF OPERATION AFTER WHEEL					
			SERVICE AS RECOMMENDED BY ATA-TMC, NWRA, AND TRUCK OE MANUFACTURERS.					
SL	998 004		MECHANICAL HOURLY LABOR	HR			.90	

AMOUNT RENDERED									
Parts :	197.80	New Tires :	0.00	Total :	814.97	Non-taxable :	25.00	ENV/WST Tax:	
Labor :	617.17	Used Tires :	0.00	Discount :	0.00	Taxable :	789.97	TOTAL ► \$	886.07
Oil :	0.00	Trade-In :	0.00	Net :	814.97	Tax :	71.10	CHANGE RETURNED:	0.00