

CUSTOMER #

776276

INVOICE

PAGE 1

SERVICE ADVISOR:

15		CHEVROLET SILVERADO		3GCUKREC7FG342262	101956/101973	T2450
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PG NO.	RATE	PAYMENT
01JAN15	DD		15:30 22MAY20			CASH
R.O. OPENED	READY	OPTIONS: DLR:111590				02JUN20
10:36 22MAY20	13:40 02JUN20					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CUSTOMER STATES LOST COMPRESSION ON CYLINDER, REPLACE ENGINE.

ENGR CUSTOMER STATES LOST COMPRESSION ON CYLINDER, REPLACE ENGINE.

2737 CUUG

- 1 12700202 ENGINE
- 8 12626354 (S) GASKET
- 2 12657430 (S) GASKET
- 2 12657093 (S) GASKET
- 10 11546600 BOLT
- 1 15035747 (S) SEAL
- 1 15077362 (S) SEAL
- 1 12677002 (S) PIPE
- 1 12677004 (S) PIPE
- 1 12623308 (S) GASKET
- 8 88865700 0W20 OIL
- 1 12690385 (S) FILTER
- 1 12643517 (S) BELT
- 1 12639010 (S) GASKET
- 1 84424416 (S) HOSE
- 1 12346290 COOLANT
- 1 12619982 (S) TUBE
- 1 12685360 (S) RAIL
- 1 12677004 (S) PIPE
- 1 12677002 (S) PIPE

PARTS:

101973 INTERNALLY DAMAGED BLOWN BY SET IN THE ECM FOR ENGINE MISFIRE ON CYLINDER 7. FOND THE #7 INTAKE LIFTER HAS COLLAPSED. THE PUSH ROD BENT AND CAUSED DAMAGE TO THE CAMSHAFT. REMOVED ENGINE FROM VEHICLE. SWAPPED OVER ALL NECESSARY PARTS OVER TO THE NEW ENGINE. HAD TO REPLACE THE RIGHT SIDE FUEL RAIL AS THE INJECTORS WERE SEIZED INTO THE BORES AND IT BENT WHEN TRYING TO REMOVE IT. INSTALLED NEW ENGINE INTO VEHICLE. INSTALLED A NEW SET OF OIL COOLER LINES AS THEY WERE LEAKING. FILLED FLUIDS. TEST DRIVE. FOUND

STATEMENT OF DISCLAIMER

The factory warranty constitutes all of the warranties with respect to the sale of this item. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item.

*Remanufactured parts meet GM approved service part requirements and are made from previously used components in a process that involves disassembly, inspection, cleaning, update of software and replacement of parts as appropriate, testing, and reassembly.

Refurbished parts meet GM approved service part requirements and are previously used parts that are inspected, cleaned, tested, and repackaged. By leaving your car for servicing, you are expressly consenting to the installation of either new, remanufactured, or refurbished parts at the discretion of the service.

Non-GM Parts/Accessories installed by the Dealer.

Non-GM parts and accessories are not covered under the GM New Vehicle Limited Warranty. They also may damage the vehicle, compromise its compliance with safety standards or void the GM Warranty on the vehicle itself. GM is not responsible for the consequences of installing any non-GM equipment, parts or accessories on the vehicle. A list of non-GM parts is available to you upon request.

X

CUSTOMER SIGNATURE

CUSTOMER COPY

Page 1 of 1

ER #: 123395

776276

INVOICE

PAGE 2

SERVICE ADVISOR:

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	15	CHEVROLET SILVERADO	3GCUKREC7FG342262		101956/101973	T2450
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
01JAN15 DD			15:30 22MAY20			CASH
R.O. OPENED	READY	OPTIONS: DLR:111590				

10:36 22MAY20 13:40 02JUN20

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

ON TEST DRIVE THAT CYLINDER #5 HAD A MISFIRE. CHECKED ALL SPARK RELATED COMPONENTS AND FOUND NO ISSUES. SUSPECTED A BAD #5 FUEL INJECTOR. REMOVED THE LEFT SIDE FUEL RAIL AND SWAPPED THE #5 INJECTOR OUT WITH THE #1 INJECTOR AND REPLACED THE #1 INJECTOR WITH AN AFTERMARKET ONE DUE TO OEM INJECTORS BEING ON BACK ORDERED FOR MONTHS. TEST DRIVE AGAIN AND NO MISFIRES PRESENT AT THIS TIME. OLD ENGINE SERIAL NUMBER A1150965DH5X0290>>><<<NEW ENGINE SERIAL NUMBER K2200790M25X3814>>>

B Rear Window Defroster Thermal Events - US Only - Exp. 2/28/2022
CAUSE:

9104757 N192265660 REAR WINDOW DEFROSTER THERMAL
EVENT

2737 W
1 84819605 WINDOW
1 84819606 F-WINDOW

0.00 OTHER: 0.00 TOTAL LINE B:

PARTS:

101973 RECALL INSPECTED THE REAR WINDOW
NONE. INSTALLED THE NEW BUSS BAR COVERS PER RECALL

C Increased Brake Pedal Effort
CAUSE:

9104605 RECALL #N192268490

0.00 TOTAL LINE C:

PARTS:

101973 RECALL REPROGRAMMED THE BRAKE
PROGRAM CODE 28YN42366616

D PERFORM 27 MULTI POINT VEHICLE INSPECTION.
MPVI PERFORM 27 MULTI POINT VEHICLE INSPECTION

PARTS:

10R REPAIR - 10% OFF PARTS AND LABOR DISCOUNT

STATEMENT OF DISCLAIMER
The factory warranty constitutes all of the warranties with respect to the sale of this item. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item.
"Remanufactured parts meet GM approved service part requirements and are made from previously used components in a process that involves disassembly, inspection, cleaning, update of software and replacement of parts as appropriate, testing, and reassembly.
Refurbished parts meet GM approved service part requirements and are previously used parts that are inspected, cleaned, tested, and repackaged. By leaving your car for servicing, you are expressly consenting to the installation of either new, remanufactured, or refurbished parts at the discretion of the service center.
Non-GM Parts/Accessories installed by the Dealer.
Non-GM parts and accessories are not covered under the GM New Vehicle Limited Warranty. They also may damage the vehicle, compromise its compliance with safety standards or void the GM Warranty on the vehicle itself. GM is not responsible for the consequences of installing any non-GM equipment, parts or accessories on the vehicle. A list of non-GM parts is available to you upon request.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

X CUSTOMER SIGNATURE

CUSTOMER COPY

123395

776276

INVOICE

PAGE 3

SERVICE ADVISOR:

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	15	CHEVROLET SILVERADO	3GCUKREC7FG342262		101956/101973	T2450
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
01JAN15 DD			15:30 22MAY20			CASH
R.O. OPENED	READY	OPTIONS: DLR:111590				
10:36 22MAY20	13:40 02JUN20					
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET TOTAL

EST: 0.00

22MAY20 10:36 SA: 2669

CONTACT:

[] CASH RECEIPTED BY _____
[] VISA/MC
[] DISCOVER
[] AMERICAN EXPRESS
[] CHECK # _____ DATE _____
[] OTHER _____

 
STATEMENT OF DISCLAIMER
The factory warranty constitutes all of the warranties with respect to the sale of this item. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item.
*Remanufactured parts meet GM approved service part requirements and are made from previously used components in a process that involves disassembly, inspection, cleaning, update of software and replacement of parts as appropriate, testing, and reassembly.
Refurbished parts meet GM approved service part requirements and are previously used parts that are inspected, cleaned, tested, and repackaged. By leaving your car for servicing, you are expressly consenting to the installation of either new, remanufactured, or refurbished parts at the discretion of the service center.

Non-GM Parts/Accessories Installed by the Dealer.
Non-GM parts and accessories are not covered under the GM New Vehicle Limited Warranty. They also may damage the vehicle, compromise its compliance with safety standards or void the GM Warranty on the vehicle itself. GM is not responsible for the consequences of installing any non-GM equipment, parts or accessories on the vehicle. A list of non-GM parts is available to you upon request.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	8446.51

X
CUSTOMER SIGNATURE

CUSTOMER COPY



John Hangel (HAN015)

Repair Order J074067

Service Advisor: Ricky

Technician: Neil

Date: 01-25-2022 1:20 PM

2015 Chevrolet Silverado 1500 LT
5.3 FLEX
3GCUKREC7FG342262

License Plate: CNH422 MN

Miles In: 148,345

Miles Out: 148,345

CUSTOMER ISSUES AND ADVISORIES

Work Description

REPLACED COMPLETE TRANSMISSION ASSEMBLY
FILLED WITH FLUID (FULLY SYNTH ATF)

WORK TO BE PERFORMED

Labor

Labor

SHOP LABOR

Tech	Hrs	Price	Total
	9.20	90.00	

SubTotal: Labor

Parts

Parts

COMPLETE TRANSMISSION ASSEMBLY 3/100 WARRANTY
MOB 1 FULLY SYNTH ATF

Part No	Qty	Price
ALLTRANASSEMB	1.00	
CQ2ATF 9281	1.00	

SubTotal: Parts

Labor
Parts
Hazmat*
Supplies*
Taxes

Repair Order Total

\$4,728.78

* Shop Supply & Hazmat Fees: This charge represents costs and profits (where applicable) to this repair facility for miscellaneous shop supplies, and/or waste removal

AUTHORIZATION

Date/Time:	Authorizer	Method	Contact Details	Original Estimate Total
				0.00

X

Customer Signature

03-08-2022 5:00 PM

Proposed Completion Date

Save replacement parts for inspection or return? (Core may apply)

☐ Yes

☐ No