

Ship To: IN STORE PICKUP

Invoice To:

Branch		
REPRINT		
Date	Time	Page
07/17/23	22:05:51 (B)	01
Account No	Phone No	Inv No
AW BR001		
Ship Via	Purchase Order	
Tax ID No		
		Salesperson
		389

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
1049462	VERMEER RTX750	1413	1VR9112M691000134		
	RTX750		MXCSGN		

SEGMENT# 1 C 3841 4L00V 06/28/23 06/29/23 07/07/23

4L00 - Hydraulic Labor

CAUSE:

both rear steer hyd lines where found to have been blown
and need to be replaced with new and top off fluid

CORRECTION:

replace both rear steer hyd lines with new

ADDITIONAL DESCRIPTION:

REAR STEER HOSE LEAKING

1. 4L00 - Hydraulic Labor (4L00V)
4L00 - Hydraulic Labor

Quantity

FI	FREIGHT-IN AND
101519005AG	ISO 100 BULK
261471001Z	HOSE
296295828	HOSE-HYD-.25X4:

10200014

LABOR
CONTINUED ON PAGE 02

345.25

Ship To: IN STORE PICKUP

Invoice To:

Branch		
Date 07/17/23	Time 22:05:51 (B)	Page 02
Account No AW BR001	Phone No -----	Inv No -----
Ship Via		Purchase Order
Tax ID No		
		Salesperson 389

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
1049462	VERMEER RTX750	1413	1VR9112M691000134		
	RTX750		MXCSGN		

ENVIRO CHARGE
SHOP SUPPLIES
SUB TOTAL==>
: DISTRICT NO 1
TX STATE TAX
CUSTOMER TOTAL

775.37

Ship To: IN STORE PICKUP

Invoice To:

Branch		
Date	Time	Page
06/28/22	22:09:03 (B)	02
Account No	Phone No	Inv No
-----	-----	-----
Ship Via	Purchase Order	
Tax ID No		
		Salesperson
		389

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
1049462	VERMEER RTX750	1181	1VR9112M691000134		
	RTX750		MXCSGN		

SEGMENT# 2 C 7003 0000V 02/02/22 02/03/22 03/29/22
0000 - Diagnostic

CORRECTION:

The return line for the injectors was leaking fuel all down the front of the engine. Replaced the rubber return lines and tested. This also was contributing to the over heating issue.

ADDITIONAL DESCRIPTION:

Fuel Leak

- 1. 0000 - Diagnostic (0000V)
- 0000 - Diagnostic

Quantity

HRS
2.00

x1

0.00

10200014

LABOR 548.10
GMENT TOTAL==> 548.10

SEGMENT# 3 C 2013 4033V 02/02/22 02/03/22 03/29/22
4033 - PUMPS-HYDROSTATIC R&R INCLUDE FLUSHING CMP*****

CAUSE:

Low hydraulic pressure on trencher attachment

CORRECTION:

Customer brought machine in with low hydraulic pressure. Flow tested the trencher attachment and it had low flow and no pressure. Checked the EDC on the pump and found no issues. Removed the EDC from the pump and found that the swash plate had failed. Removed the gear pump from the pump stack and found that it had failed and sent metal

CONTINUED ON PAGE 03

Ship To: IN STORE PICKUP

Invoice To:

Branch		
Date 06/28/22	Time 22:09:03 (B)	Page 04
Account No	Phone No	Inv No
Ship Via	Purchase Order	
Tax ID No		
		Salesperson 389

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
1049462	VERMEER RTX750	1181	1VR9112M691000134		
	RTX750		MXCSGN		
296387479			FILTER ELEMENT		
	FILTER ELEMENT - HYD				
6988096			ANTIFREEZE/COOL		
787-4			HYD HOSE		
				LABOR	2147.45
10200014				SERVICE TOTAL==>	

Ship To: IN STORE PICKUP

Invoice To:

Branch		
Date 10/21/22	Time 22:07:42 (B)	Page 03
Account No	Phone No	Inv No
Ship Via		Purchase Order
Tax ID No		
		Salesperson 389

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
1049462	VERMEER RTX750	1283	1VR9112M691000134		
	RTX750		MXCSGN		

greased the machine. All good at this time.

ADDITIONAL DESCRIPTION:

DIAGNOSE AND REPAIR DIFF ISSUES

SEGMENT# 4 C 2013 00000 07/08/22 07/12/22 08/26/22

WRITE OFF

WRITING OFF LABOR DUE TO CUSTOMER MACHINE COMING BACK

MULITPLE TIMES.

***** WORK ORDER TOTALS *****

PARTS

LABOR

SUB TOTAL==>

TX SPECIAL TAX

TX STATE TAX

CUSTOMER TOTAL