Invoice Number	ACCOMP	ICE NUMBER MUST ANY ALL REMITTANCES RESPONDENCES
P.O. NO		3/8/2023
	SHPTO	
3/8/2023		
004100-01	1	
PRIMARY	1	
STL01	C	
DELIVERY		
Terms NET 30	) Days from Invoice Date	
Due By: 4/14/	2023 <b>Pay: 647</b>	78.09

Item Number	Description	1	Ordered	B/O	Ohles		Unit Price	
1074977	WLDT UPPER CONVEYOR ROLLER		or dered [	ВЮ	Snipped	UOM	I Unit Drice I	Eus Balan
1005274	ADJUSTING SCREW							
5005449	ROLL PIN-MIN QTY 25							
1005275	ADJUSTING SCREW COLLAR							
1048741	BEARING-TAKE UP							
1035212	ADAPTER- MALE SWIVEL							
7970163	CHAIN AND SPROCKET KIT							
1034473	BEARING - E/F- NP							
1136501	LUBRICATING HOSE - 48 IN							
7873221	SB SEGMENT SET- 4 SEG 17 WPH							
7970066	D-STRIP-MAIN BROOM 66"							
ABOR13-01	RD SERVICE							
KEYSTL-01	Miscellaneous Shop Supplies							

S/N:NP2633S CHASSIS HOURS: 6369 MILEAGE:19799

REPLACED UPPER ROLLER AND BEARINGS REPLACED BELT AND SPLICE KIT REPLACED CHAIN & SPROCKETS REPLACED TAKEUP BEARING AND LUBE HOSE TEST ALL WORKS GOOD

	JU.UG
Amount Due	\$6,478.09

COMPLAINT:			
CHECK OUT FUEL B	LEEDING OFF. HARD STARTING		
CAUSE:			
- Fuel was bleeding ba	ack to tank through lift pump.		
CORRECTION:			
- Arrived at machine a started machine all go	and it had extended crank indicating it was losing prime. Remove lood. Cleaned up job site.	d old lift pump and replaced. Primed fuel system and	
PartNumber	Description		
DZ120069	FUEL PUMP		
R460R	O-Ring		
R74012	SEALING WA		
Miscellaneous Cha	irges:		
Enviromental Fee			
Service Supplies			
		Sub-Total:	
/DT1000 Retail			_
COMPLAINT:			
02 Drive Time & Milea	ge		
CAUSE:			
CORRECTION:			
Service Call			
50 miles			
Miscellaneous	Description		

MILEAGE186

MILEAGE - 1.86 PER MILE

Make/Model:	Meter	Serial Number:	EQ ld:	Fleet No:
ELGIN SWEEPER 5-17	6435	PE4045L220809	4045-220809	

#### Gen1- Retail

COMPLAINT:

CHECK OUT FUEL BLEEDING OFF. HARD STARTING

## CAUSE:

- Fuel was bleeding back to tank through lift pump.

# CORRECTION:

 Arrived at machine and it had extended crank indicating it was losing prime. Removed old lift pump and replaced. Primed fuel system and started machine all good. Cleaned up job site.

PartNumber

Description

DZ120069

FUEL PUMP

R460R

O-Ring

R74012

SEALING WA

# Miscellaneous Charges:

**Environmental Fee** 

Service Supplies

# /DT1000 Retail

COMPLAINT:

02 Drive Time & Mileage

CAUSE:

CORRECTION:

Service Call

- 50 miles

Miscellaneous

Description

MILEAGE186

MILEAGE - 1.86 PER MILE

ake/Model:	Meter	Serial Number:	EQ ld:	Fleet No	0:
LGIN SWEEPER	6435	PE4045L220809			
				Total:	\$710.23

## TERMS AND CONDITIONS

TERMS: All accounts due 30 days from date of invoice. A FINANCE CHARGE of 1.5% (ANNUAL PERCENTAGE RATE OF 18%) will be added to unpaid balance. Merchandise must be returned within 30 days - 15% restocking charge.

Received by: Date:
--------------------

COMPLAINT: CHECK OUT COOLANT LEAK  CAUSE:  Plastic was on sealing edge of cooler.  CORRECTION:  Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant. ooked up laptop to check and clear any codes. Ran the machine to make sure there were no other coolant leaks. Cleaned up work site. eturned to machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece in the sealing edge causing the hose to back off. Cleaned up the sealing edge and tightened clamps. Filled with coolant.  Arithmber  Description  Y26576  COOL-GARD TM  Iliscellaneous Charges:  Environmental Fee  Service Supplies  Sub-Total:	IVIAKe/IVIOUEI:		Meter	Serial Number:	EQ ld:	Fleet No:
COMPLAINT: CHECK OUT COOLANT LEAK CHUSE: Plastic was on sealing edge of cooler.  CORRECTION:  Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant. ooked up laptop to check and clear any codes. Ran the machine to make sure there were no other coolant leaks. Cleaned up work site. eturned to machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece in the sealing edge causing the hose to back off. Cleaned up the sealing edge and tightened clamps. Filled with coolant.  Arithmber  Description  COOL-GARD TM  Iliscellaneous Charges:  Enviromental Fee  Service Supplies  Sub-Total:  OMPLAINT:  2 Drive Time & Mileage	ELGIN SWEEPER		6485	PE4045L220809	4045-220809	
Plastic was on sealing edge of cooler.  Porrection:  Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant. cooked up laptop to check and clear any codes. Ran the machine to make sure there were no other coolant leaks. Cleaned up work site. eturned to machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece in the sealing edge causing the hose to back off. Cleaned up the sealing edge and tightened clamps. Filled with coolant.    Arrived at machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece in the sealing edge and tightened clamps. Filled with coolant.    Arrived at machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece and tightened clamps. Filled with coolant.    Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant.    Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant.    Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant.    Arrived at machine and found hose clamp was loose. Tightened clamp and topped off coolant.    Arrived at machine and found hose clamp was loose. Tightened clamp and topped off coolant.    Arrived at machine and found hose clamp was loose. Tightened clamp and topped off coolant.    Arrived at machine and found hose clamp was loose. Tightened clamp and topped off coolant.    Arrived at machine and found hose clamp was loose. Tightened clamp and topped off coolant.    Arrived at machine and found hose	Gen1- Retail					
Plastic was on sealing edge of cooler.  ORRECTION:  Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant. ooked up laptop to check and clear any codes. Ran the machine to make sure there were no other coolant leaks. Cleaned up work site. eturned to machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece in the sealing edge causing the hose to back off. Cleaned up the sealing edge and tightened clamps. Filled with coolant.  arthumber  Description  Y26576  COOL-GARD TM  Iliscellaneous Charges:  Enviromental Fee  Service Supplies  Sub-Total:  OMPLAINT:	COMPLAINT:					
Plastic was on sealing edge of cooler.  ORRECTION:  Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant. ooked up laptop to check and clear any codes. Ran the machine to make sure there were no other coolant leaks. Cleaned up work site. eturned to machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece in the sealing edge causing the hose to back off. Cleaned up the sealing edge and tightened clamps. Filled with coolant.  arthumber  Description  Y26576  COOL-GARD TM  Iiscellaneous Charges:  Enviromental Fee  Service Supplies  Sub-Total:  OMPLAINT:	CHECK OUT COOL	ANT LEAK				
Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant. ooked up laptop to check and clear any codes. Ran the machine to make sure there were no other coolant leaks. Cleaned up work site. eturned to machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece in the sealing edge causing the hose to back off. Cleaned up the sealing edge and tightened clamps. Filled with coolant.    Particular	CAUSE:					
Arrived at machine and found the lower radiator hose was leaking. Found hose clamp was loose. Tightened clamp and topped off coolant. ooked up laptop to check and clear any codes. Ran the machine to make sure there were no other coolant leaks. Cleaned up work site. eturned to machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece in the sealing edge causing the hose to back off. Cleaned up the sealing edge and tightened clamps. Filled with coolant.    Description   Y26576   COOL-GARD TM	Plastic was on seali	ng edge of cooler.				
to the color haptop to check and clear any codes. Han the machine to make sure there were no other coolant leaks. Cleaned up work site.  eturned to machine hose had worked its way off the cooler. Drained down the coolant to figure out what was going on. Found plastic piece in the sealing edge causing the hose to back off. Cleaned up the sealing edge and tightened clamps. Filled with coolant.  artNumber  Description  Y26576  COOL-GARD TM  Iiscellaneous Charges:  Environmental Fee  Service Supplies  Sub-Total:  OMPLAINT:  2 Drive Time & Mileage	CORRECTION:					
Y26576 COOL-GARD TM  liscellaneous Charges: Enviromental Fee Service Supplies  Sub-Total:  OMPLAINT:  2 Drive Time & Mileage	Returned to machine	hose had worked its way off	the cooler. Drain	to make sure there we ned down the coolant to	re no other coolant le	eaks. Cleaned up work site.
Iscellaneous Charges:  Enviromental Fee Service Supplies  Sub-Total:  OMPLAINT:  Drive Time & Mileage	artNumber					
Enviromental Fee Service Supplies  Sub-Total:  OMPLAINT:  Drive Time & Mileage						
Service Supplies  Sub-Total:  OMPLAINT:  Drive Time & Mileage		arges: .				
OMPLAINT:  2 Drive Time & Mileage						
OMPLAINT:  2 Drive Time & Mileage					Sub	-Total:
2 Drive Time & Mileage	PITUUU Ketan					
	OMPLAINT:					
NIOT.	2 Drive Time & Milea	age				

CORRECTION:

Service Call -96 miles

Miscellaneous

MILEAGE186

Description

MILEAGE - 1.86 PER MILE

en3- Retail				
OMPLAINT:				
HECK A/C				
AUSE:				
ailed blower moto	r switch.			
ORRECTION:				
Hooked up gauges ound the blower sw orking and cooling	to check pressures. Found that the compressor wasn't working itch was bad. Had to re-wire blower switch to get it to work. For properly.	ng. Disassembled the da an machine and checke	sh to check out d pressures and	the blower switch A/C was now
rtNumber	Description			
43497	SWITCH			
	•			
			Total:	\$1,589.52
DMC AND CONDIT	ONE			
aceived by:		Date:		

Make/Model:			-0		1012
	Meter	Serial Number:	EQ ld:	Fleet No:	
ELGIN SWEEPER	6534	PE4045L220809	4045-220809		

## Gen1- Retail

COMPLAINT:

CHECK OUT BATTERIES DEAD. CHECK DRAW

#### CAUSE:

Alternator was hooked up wrong causing them to burn out diode and also causing power to back feed causing starter to stay engage causing starter to burn up.

### CORRECTION:

Customer had installed new alternator. Alternator wasn't charging and found it had been hooked up wrong. Starter was also staying engaged and wouldn't work all the time. Ordered parts. Installed new alternator, start relay, and new starter. Ran machine and battery was charging as the alternator being hooked up incorrectly. Installed new diode and everything functioned as it should.

PartNumber	Description
4288109	Diode
RE164448	Starter Relay
SE501343	Alternator Reman
SE501343-CR	CORE for:Alternator Reman
SE501401	STARTER MO
SE501401-CR	CORE for:Starter Motor Reman
Miscellaneous	Description
INFREIGHT	INBOUND FREIGHT

# Miscellaneous Charges:

Environmental Fee Service Supplies

\$2,034.98

COMPLAINT:

SERVICE CALL

CAUSE:

					EVIE
Make/Model:	Meter	Serial Number:	EQ ld:	Fleet No:	
ELGIN SWEEPER	6534	PE4045L220809	4045-220809		

CORRECTION:

Service Calls

75 miles

Miscellaneous

Description

MILEAGE186

-----

MILEAGE - 1.86 PER MILE

\$	
Total:	\$2,502.08