

invoice Number	SS330023677
Invoice Date	11-30-23
Amount Due	9,745.75
Customer PO Number	***************************************
Customer Account #	
PSO/WO.#	

TO VIEW AND PAY ONLINE USE THIS ENROLLMENT CODE:

Make:

MISCELLANEOUS

Equipment #;

Model: 7FDU35

Machine ID #;

Serial #: 60270

Meter Reading: 9097.0

PAGE 1 of 7

SEG DESCRIPTION

PARTS LABOR MISC

- TR CUSTOMER PO NUMBER IS FOR REFERENCE ONLY
- 00 TRAVEL TO/FROM MACHINE
- 01 TROUBLESHOOT MACHINE
- 02 REMOVE & INSTALL COUNTERWEIGHT
- -- 04 REMOVE & INSTALL RADIATOR
 - 05 REMOVE & INSTALL MUFFLER
 - 06 REMOVE & INSTALL IMPLEMENT PUMP
 - 07 RECONDITION PUMP DRIVE
 - 08 FLUSH ENGINE COOLING SYSTEM
 - 09 REMOVE & INSTALL BATTERY
 - 97 WASH ENGINE
 - 98 INSPECT MACHINE

SUBTOTAL

TOTAL

9,745.75

Invoice Date	15. 200
11-30-23	
Amount	
0 745 75	ninter in the second stage

	11-30-23			RCHASE ORDER NUMBER		G	SAI FSMAN	2	PAGE 2 of 7
PSOWO. NO.	DOC. DATE	PC LC	MC	SHIP VIA		1	1N	V. SEQ. NO	
3316504	10-19-23	1C 1C	10		***************************************			412531	
MAKE	MODEL	SERI	AL NUMBER	EQUIPMENT NU	MBER	METE	READING		I ID.NO
22	7FDU35		60270			parameter seals	9097.0	Morce	(IV.NO

CUSTOMER PO NUMBER IS FOR REFERENCE ONLY

TRANSPORT MACHINE

1

TRANSPRT/TOW SVC

930011076

TOTAL MISC CHGS

SEG. TR

SEGMENT TR TOTAL

TRAVEL TO/FROM MACHINE

COMPLAINT: TRAVELED TO MACHINE SOUTH OF QUINTER KS

TO CUSTOMERS SHOP

CAUSE: FORKLIFT IS LEAKING OIL

CORRECTION: TRAVELED TO MACHINE TO TROUBLESHOOT LEAK AND SUGGEST MACHINE BE BROUGHT TO SHOP.

FLD TRAVEL TIME

TOTAL LABOR

SEG. 00

SEGMENT 00 TOTAL

TROUBLESHOOT MACHINE

COMPLAINT: HYDRAULIC PUMP OUTLET TUBE IS LEAKING

OIL

CAUSE: BOLT HOLES IN PUMP ARE STRIPPED OUT CORRECTION: GOT MACHINE INFO AND LOOKED OVER MACHINE ON HOW TO GET TO PUMP. REAR COUNTER WEIGHT WILL HAVE TO COME OFF. THEN RADIATOR AND MUFFLER CAN BE REMOVED TO ACCESS PUMP. GOT WITH PARTS AND HAD PARTS FIND PUMP. GOT APPROVAL FROM CUSTOMER TO ORDER PUMP. MACHINE WILL BE BROUGHT TO SHOP FOR REPAIRS.

FIELD LABOR TOTAL LABOR

SEG. 01

	Invoice Date
\Box	11-30-23
į.	Amount
T	9,745.75

ATE PC	LC	MC	7.5	SHII		G	06	54	2	3 of
	LC	MC		CAN						
				SHILL	VIA.	7-7-		. IN	V. SEQ. N	JMBER.
-23 1C	1C	10				***************************************		1	412531	
	SERIA	LNUMBER	39-31	EQUIPME	NT NUMBER	ME	TER REA	DING	MACH	ID.NO
	6	0270					9097.0)		101110
	WR	P	DESCRIP	PTION	*	UNIT PE	***************************************	100	EXTENSI	ON:
			60270	60270	60270	60270	60270	60270 9097.0	60270 9097.0	SERIAL NUMBER EQUIPMENT NUMBER METER READING MACH

SEGMENT 01 TOTAL

REMOVE & INSTALL COUNTERWEIGHT

COMPLAINT: COUNTERWEIGHT NEEDS REMOVED

CAUSE: NEEDS REMOVED FOR ACCESS.

CORRECTION: REMOVED COUNTERWEIGHT MOUNTING

HAROWARE, UTILIZING SHOP LOADER, RAISED

COUNTERWEIGHT OFF OF MACHINE, SET UP COUNTERWEIGHT

ONTO SUITABLE CRIBBING. REVERSE PROCEDURE FOR

INSTALLATION.

SHOP LABOR

TOTAL LABOR

140004

SEGMENT 02 TOTAL

REMOVE & INSTALL RADIATOR

COMPLAINT: RADIATOR NEEDS REMOVED

CAUSE: NEED TO GAIN ACCESS TO IMPLEMENT PUMP

CORRECTION: REMOVED TIRES TO GAIN ACCESS TO DRAIN,

DRAINED OUT COOLANT, LOOSENED UP FAN DRIVE BELTS,

REMOVED FAN DRIVE, REMOVED HYDRAULIC AND COOLANT

HOSES FROM RADIATOR, REMOVED RADIATOR MOUNTS,

REMOVED RADIATOR FROM MACHINE. TRANSFERRED

COMPONENTS FROM EXISTING RADIATOR TO NEW RADIATOR.

REVERSE PROCEDURE FOR INSTALLATION OF NEW

RADIATOR.

2 9406706021 1 TSA/ZS8015397 Shellzone AF/C 50/S TOYOTA RADIATOR N

TOTAL PARTS

SEG. 04

SHOP LABOR

TOTAL LABOR SEG. 04



3.70	Invoice Date
	11-30-23
	Amount
	9,745.75

CICE HORIDER		CUSTOMER NO	L. GUSTOMER PURCH	ASE ORDER NUMBER	STORE	DIV 8	BALESMAN	TERMS	PAGE
PSO/WO. NO.	11-30-23 DOC. DATE	-	LMC 1	SHIPVIA	Ţ	G I	064	3	4 of
3316504	10-19-23	1C 1C	10	One vo			10	V. SEQ. NO 412531	200
MAKE	MODEL	SER	MAL NUMBER	EQUIPMENT NU	MBER	METER	READING	PROPERTY AND ADDRESS OF THE PARTY OF THE PAR	ID.NO
22	7FDU35		60270			The state of the s	97.0	- Mr.Oji	10.10
QUANTITY	ITEM	*N/R	DESC	RIPTION	UN	IT PRICE	T -	EXTENSION	N.

SEGMENT 04 TOTAL

REMOVE & INSTALL MUFFLER

COMPLAINT: MUFFLER NEEDS REMOVED.

CAUSE: NEEDS REMOVED FOR ACCESS TO HYDRAULIC PUMP.

CORRECTION: REMOVED MUFFLER MOUNTING HARDWARE,

REMOVED MUFFLER FROM MACHINE, REVERSE PROCEDURE

FOR REINSTALLATION.

SHOP LABOR

TOTAL LABOR

SEG. 05

SEGMENT 05 TOTAL

REMOVE & INSTALL IMPLEMENT PUMP

COMPLAINT: IMPLEMENT PUMP NEEDS REPLACED.

CAUSE: DAMAGED HOUSING ON PUMP FOR FOR OUTLET HOSE

MOUNTING.

CORRECTION: REMOVED DRIVE SHAFT MOUNTING BOLTS, REMOVED MOUNTING HARDWARE ATTACHED TO INLET AND OUTLET LINES, DISCONNECTED CASE DRAIN LINE, REMOVED FUMP TO FRAME MOUNTING HARDWARE. REMOVED FUMP FROM MACHINE. TRANSFERRED COMPONENTS FROM OLD PUMP TO NEW, RESEALED FITTINGS AND LINES. FILLED NEW PUMP CASE WITH HYDRAULIC OIL. REVERSE PROCEDURE FOR REINSTALLATION. FILLED HYDRAULIC TANK WITH 10W CAT HYDRAULIC OIL. INSPECTED FOR LEAKS.

6	3145168	HYDO-10W BULK	S
2	05-1592	CAP SCREW	S
2	3B-4510	LOCKWASHER	S
2 .	4K-0367	NUT	S

e de la constante de la consta	Invoice Date
	11-30-23
2	Amount
	9,745.75

WA THERE THE STATE OF THE

INVOICE NUMBER INVOICE DATE CUSTOMER NO. | CUSTOMER PURCHASE ORDER NUMBER | STORE | DIV. | SALESMAN | TERMS 5 of 7 PSO/WO, NO. DOC. DATE PC LC MC SHIP VIA INV. SEQ. NUMBER 3316504 10-19-23 1C 1C 1C 4125310 MODEL SERIAL NUMBER EQUIPMENT NUMBER METER READING MACH ID, NO 22 7FDU35 60270 9097.0 QUANTITY DESCRIPTION ITEM: *N/R UNIT PRICE EXTENSION

> TOTAL LABOR SEGMENT 07 TOTAL

SEG. 07

551 70 *

FLUSH ENGINE COOLING SYSTEM

COMPLAINT: COOLING SYSTEM NEEDS FLUSHED CAUSE: CONTAMINATED WITH HYDRAULIC OIL CORRECTION: FILLED MACHINE WITH RECOMMENDED AMOUNTS OF COOLANT FLUSH AND WATER, OPERATED MACHINE TO GET UP TO OPERATING TEMPERATURE, ALLOWED TEMP TO COOL DOWN, DRAINED OUT FLUID. REPEATED PROCEDURE SEVERAL TIMES TO TRY AND CLEAR OUT HYDRAULIC OIL OUT OF COOLING SYSTEM. LAST FLUSH WATER/CLEANER MIXTURE CAME OUT CLEAN, STILL NOTED SMALL AMOUNTS OF OIL LEFT FLOATING ON TOP. ADVISE CUSTOMER TO RUN THROUGH SEVERAL HEAT CYCLES

3

HD100-6

AND RE-INSPECT COOLING SYSTEM.

Prestone Command HS

TOTAL PARTS

SEG. 08

SHOP LABOR

TOTAL LABOR

SEG. 08

SEGMENT 08 TOTAL

REMOVE & INSTALL BATTERY

COMPLAINT: BATTERY NEEDS REPLACED

CAUSE: BATTERY WILL NOT HOLD A CHARGE CORRECTION: I REMOVED THE OLD BATTERY AND ORDERED

A NEW ONE WITH EQUAL OR GREATER WORKING POWERS. I INSTALLED THE NEW BATTERY AND HADE IT SURE WAS

WORKING CORRECTLY. 1

127-0826

BATTERY

Ν



	Involce Date
	11-39-23
- 4	Amount
	9,745.75

INVOICE NUMBER	INVOICE DATE	CUSTOMER NO. CUSTOMER PURCHA	SE ORDER NUMBER STORE	DIV SALESM	AN TERMS PAGE
FOURIO, NO.	POUG DATE	REPRESENTED A MODILIO CONTRA	SHIP VIA	G 064	2 7 of 7 INV. SEQ. NUMBER
3316504 `	10-19-23	10 10 10			4125310
MAKE	MODEL	SERIAL NUMBER	EQUIPMENT NUMBER	METER READIN	
22	7FD035	60270		9097.0	
QUANTITY	ITEM	*N/R DESCR	IPTION UN	IT PRICE	EXTENSION

TOTAL PARTS SEG. 09

SHOP LABOR

TOTAL LABOR

SEG. 09

SEGMENT 09 TOTAL

WASH ENGINE

COMPLAINT: MACHINE NEEDS WASHED

CAUSE: NEEDS WASHED DURING AND AFTER REPAIRS WHILE

COMPONENTS/AREAS ARE ACCESSIBLE.

CORRECTION: WASHED MACHINE DURING AND AFTER

REPAIRS.

SHOP LABOR

TOTAL LABOR

SEG. 97

SEGMENT 97 TOTAL

INSPECT MACHINE SPECIAL PROGRAM

F/R LBR

-1

INSPECTION ADJ

TOTAL MISC CHGS SEG. 98

SEGMENT 98 TOTAL

LOOKING FOR THE PERFECT GIFT FOR THE CAT ENTHUSIAST IN YOUR LIFE? CHECK OUT OUR GIFT COLLECTION GUIDE AND BE SURE TO REGISTER FOR OUR 12 DAYS OF GIVING SWEEPSTAKES AT FOLEYOFFERS.COM. ASK YOUR FOLEY REP ABOUT A HASSLE-FREE CUSTOMER VALUE AGREEMENT THIS SEASON. A CVA KEEPS YOUR MACHINE IN PEAK OPERATING CONDITION WITH PREVENTATIVE MAINTENANCE AND HELPS AVOID COSTLY REPAIRS AND DOWNTIME.

DUE 30 DAYS FROM INVOICE DATE



PAY THIS AMOUNT

9,745.75 USD

AUDITOR BOY, SOUTHERN BELLEVILLE