

Branch		[REDACTED]	
Date	Time	Page	
01/18/24	[REDACTED]	02	
Account No	Phone No	Inv No	
[REDACTED]	[REDACTED]	W00784	
Ship Via		Purchase Order	
Tax ID No			
		Salesperson	
		DR / DR	

SERVICE INVOICE

STK#/FLB#TH	HRS	PIN/KIN	WARRANTY DATE	HRS
C026084	SKID STEER LOADER	X 525411956		
	T330			
	XP TH HYD FLUID J20			
CRIMP PEE	PRICE/FITTING		2	
DIESEL	DIESEL FUEL		5	
FORCK 3/4" H14512	3/4" ID X 1 1/8		1	
	3/4" ID X 1 1/8" CC 3000 PSI HOSE			
PET	FREIGHT		1	
12U-612-CT OR 1221V	JIC FEMALE SWIV		1	
	JIC FEMALE SWIVEL			
2404-12-12	HYD FITTING 1-1		1	
6661248	BOBCAT FILTER		1	
7222854	control valve		1	
130000021				

SEGMENT TOTAL==>

```

***** WORK ORDER TOTALS *****
INTERNAL          CUSTOMER
PARTS
LABOR
SHOP INTERNAL
INTERNAL TOTAL    6244.67

```

×

Received by

Invoice For	Branch		[REDACTED]	
	Date	Time	Page	
	01/18/24	[REDACTED]	01	
	Account No	Phone No	Inv No	
	INT21		W00784	
	Ship Via		Purchase Order	
	Tax ID No			
			Salesperson	
			DR / DR	

SERVICE INVOICE

STRA/PLKETH	HRS	PTN/EIN	WARRANTY DATE	HRS
C026089	SKED STRBR LOADER	X 525411956		
	T300			

SEGMENT# 1 C 1052P NA 04/20/23 04/20/23

CORRECTION:

Tested pressure at aux couplers, test port on aux circuit next to valve, and loader lift. All pressures but lower aux port read zero at low idle and 3000 at full rpm. Pulled aux spool and swapped with another in cabinet. Lower aux went from 1800psi to 3899. Rc measured pressures, but this time found the loader dead heading its self while raising, applying pressure on both lift and lower side while pressurizing the aux port. Control valve leaking by internally. Made parts list. Cleaned area.

Moved skid loader outside and cleaned area. Pulled inside and took battery out to charge. Started pulling apart inside of machine for valve removal. Removed valve. Moved all components over to new valve. Put new valve in. Ran into pressure issues. Flow tested hydraulic pump. Pump good. Checked charge pressure. Pressure low. Cracked relief valve on hydrostatic pump. Took out case drain filter and cleaned, gained charge pressure. AUX dead heading, found a stem to be bad. Engine coolant also leaking out thermostat housing. Set valve relief pressure, replaced LH track bleeder. Tensioned both tracks. Cleaned up area. Took outside and power washed. Replaced thermostat, resealed housing, and added coolant.

ANTIFREEZE	BULK ANTIFREEZE	1
	BULK ANTIFREEZE 50/50 GALLON	1
BULK HYD	XP TH HYD FLUID	1

CONTINUED ON PAGE 02

✱

Reviewed By

Branch		Date		Time	Page
		03/06/23	22:34:44	(B)	01
Account No	Phone No	Inv No		W00543	
Ship Via	Purchase Order				
Tax ID No					
					Salesperson
					CP

Invoice To: [REDACTED]

SERVICE INVOICE

STK#/FLST#	HRS	PIN/EIN	WARRANTY DATE	HRS
C026084	SKID STEER LOADER	X 525411956		
	T300			

SEGMENT# 1 C 10SEP NA 03/06/23 12/05/22

PDI

CORRECTION:

[REDACTED] Looked over machine and found leaking drive motor.)

[REDACTED] - (Pulled LH track for drive motor replace and track guide repair. Pulled RH track for track guide repair.)

[REDACTED] - (Replaced LH drive motor, welded track guides on, replaced steering shocks, changed hyd fluid and filter, and welded plate on RH side hose cover.)

Zeck - (painted RH hose cover and installed. Put RH track on. Found LH not lining up and ordered deep dish sprocket.)

[REDACTED] (Put LH track on and flushed coolant.)

[REDACTED] (Found leak on pump to drive motor fitting and replace o-ring. Found test port on control valve leaking from tip. Capped off and plugged. Power washed to remove oil. Loader at times not unlocking. Found crack on unlock solenoid and ohmed coil, coil bad. Also noticed crack on park brake coil and found coil above spec on resistance.)

Put RH track back on. Attempted to put LH side on. Sprocket needed changed for track alignment to be correct. Pulled steel line and control valve. Replaced unlock solenoid and stem for bike hydraulics. Replaced park break solenoid during job due to rough shape. Power washed machine and put covers on. Buttoned up machine, added hyd oil, and test ran.

Fused power side of harness running through machine for aux

CONTINUED ON PAGE 02

Branch		
Date	Time	Page
03/06/23	22:34:44 (B)	02
Account No	Phone No	Inv No
DC21		
Ship Via	Purchase Order	
Tax ID No		
		Salesperson
		CP

Invoice To: [REDACTED]

SERVICE INVOICE

STK#/FLEET# HRS PIN/SIN WARRANTY DATE HRS
C026084 SKID STEER LOADER X 525411956
T300

connector. Tied up harness made a cap for connector.
ADDITIONAL DESCRIPTION:
Check machine over, might be loosing hyd oil into chain case.

BULK HYD	XP TH HYD FLUID	6
	XP TH HYD FLUID J20	
FRT	FREIGHT	2
1 GAL ANTI FREEZE	antifreeze	1
51455	HYD FILTER	1
55K214	O-RING	2
6309311	valve solenoid	1
6425-06-06	adapter	1
7024981	OIL, SYN DRV MO	2
7165109	SPROCKET 5.15"	1
7188108	GAS SPRING	2
7401921	BCT-MOTOR DRIVE	1

PARTS
LABOR

10301000 11000021 SEGMENT TOTAL==> 8966.16

SEGMENT# 2 C 103BI NA 03/06/23

PDI
Check machine over, might be loosing hyd oil into chain case.

Branch		
Date	Time	Page
03/06/23	22:34:44 (B)	03
Account No	Phone No	Inv No
PO21		W00543
Ship Via	Purchase Order	
Tax ID No		
		Salesperson
		CP

SERVICE INVOICE

STK#/FLEET# C026084 SKID STEER LOADER T300
 HRS PIN/EIN X 525411956
 WARRANTY DATE HRS

REPAIR LEFT HAND DRIVE

CORRECTION:

Removed old lh drive motor and installed new one
 Removed old wear bars and welded new ones on
 Replaced sprocket for lh drive drained old coolant and replaced with new

10301000 13000021

LABOR
 SEGMENT TOTAL==>

SEGMENT# 4 C 102PF NA 03/06/23 12/05/22
 PDI

10301000 13000021

LABOR
 SEGMENT TOTAL==>

***** WORK ORDER TOTALS *****
 INTERNAL CUSTOMER

PARTS
 LABOR
 SHOP INTERNAL
 INTERNAL TOTAL 10934.84

Customer hereby authorizes dealer to perform the work described above and agrees to pay all amounts due in accordance with the terms and conditions of the service contract.

X