

INVOICE DATE

10/24/2022 8

PAGE:1 of 05

Service Invoice

CUSTOMER-PO

Order No.

MAIN-NUMBER

CUSTOMER-ADVISOR

SALES REP

Cust Unit #
Phone #License #
Contact #COMPLETION DATE:
RTL UNIT:

SERIAL: 1HTSHAAR12H537200

YEAR: 2002 MAKE/MODEL: INTERNATIONAL/4900:IH
MILEAGE: 109,712 MI

Date in Service....:

Engine Make/Model... INTERNATIONAL/DT466

Engine Serial No....:

Trans Model.....: /

Front Diff Model....:

Front Diff Serial...:

Rear Diff Model....:

Rear Diff Serial....:

Job 1 PERFORM STAGE 1 XPRESS CHECK

took on a long test with lap top still cant duplicate problem
put \$75.00 of fuel in truck . test drove 45 minuets to get to act up . found
codes for the cam sensor and damage at pigtail.
quoted a CAM sensor and pigtail.
found left steer axle wheel seal leaking. customer declined repairs.

Sales Qty UOM Item number

Item description

COR Unit rate

Per Extension

LABOR SUBTOTAL:

PARTS SUBTOTAL:

MISC SUBTOTAL..:

COUPON SUBTOTAL..:

EPA FEE SUBTOTAL..:

SHOP SUPPLIES FEE..:

MACHINE CHARGE..:

JOB SUBTOTAL...:

Job 2 camshaft position sensor

changed sensor and connector

Sales Qty UOM Item number

Item description

COR Unit rate

Per Extension

1.000 EA

CAM POSITION SENSOR, T444E

1.000 EA

CONNECTR,CONNECTOR CAMP SENSOR

2.000 EA

SHIPPING AND HANDLING

6.000 EA

CABLE TI

SUBTOTAL

TAX STATUS/STATE

SALES TAX

PLEASE PAY (USD)

CONTINUED

TERMS

Due on Receipt

INVOICE DATE
10/24/2022

PAGE 2 OF 05

Service Invoice

ANY WARRANTIES ON THE PRODUCTS PROVIDED BY RUSH ARE SOLELY THOSE MADE BY THE PRODUCT MANUFACTURER. EXCEPT FOR THE LIMITED SERVICES WARRANTY SET FORTH IN THE RUSH TERMS AND CONDITIONS OF SERVICE REFERENCED IN THE NOTE BELOW, RUSH EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. CORE PARTS MUST BE RETURNED IN THEIR ORIGINAL BOX. PART RETURNS MAY BE SUBJECT TO A RESTOCKING FEE.

CUSTOMER-PO

Order No.

MAIN NUMBER

CUSTOMER-ADVISOR

SALES REP

LABOR SUBTOTAL:
PARTS SUBTOTAL:
MISC SUBTOTAL:
COUPON SUBTOTAL:
EPA FEE SUBTOTAL:
SHOP SUPPLIES FEE:
MACHINE CHARGE:
JOB SUBTOTAL:

Job 3 21 Point Inspection

found left front wheel seal leaking
(Tech 13776 on 2022-10-11 at 09:51:01)
they did not want to fix it
(Tech 13776 on 2022-10-11 at 10:10:09)

Sales Qty UOM Item number

Item description

COR Unit rate

Per Extension

LABOR SUBTOTAL:
PARTS SUBTOTAL:
MISC SUBTOTAL:
COUPON SUBTOTAL:
EPA FEE SUBTOTAL:
SHOP SUPPLIES FEE:
MACHINE CHARGE:
JOB SUBTOTAL:

Job 4 R&R INJECTORS

truck has a slight engine miss, performed fuel injector cut out test
. recommended replacing all injectores.
disconnect batteries remove a/c compressor, turbo pipes, air box, ecm,
ecm mount, and wire harness
pull dog house remove valve cover wire loom and injectors
vac oil out of cylinders and clean fuel spill
install torque all 6 injectors install injector harness
install valve cover/intake, a/c compressor and a/c mount, ecm mount
and ecm wiring harness, air line, air box, turbo pipe belt tensioner
and belt
install doghouse zip tie engine harness and replace clamp nuts and
bolts in engine bay that snapped off from rust during repair showed
icp low pressure code had to clean connector pulled outside and ran

SUBTOTAL

TAX STATUS/STATE

SALES TAX

PLEASE PAY (USD)

CONTINUED

TERMS
Due on Receipt

INVOICE DATE
10/24/2022

PAGE:3 of 05

Service Invoice

CUSTOMER-PO Order No. MAIN-NUMBER CUSTOMER-ADVISOR SALES REP

till up to temp for test drive picked up bay tagged and took cores to parts
oil leak on test drive pull valve cover check gasket
oil leak pull ecm start and check for leaks pull valve cover check
gasket found oil pressure sensor broken during reassembly replaced
started and ran no leaks found park in spot 19

Sales Qty UOM	Item number	Item description	COR Unit rate	Per Extension
6.000 EA		REMANUFACTURED HEUI BI INJECTOR	EXC	
6.000 EA		REMANUFACTURED HEUI BI INJECTOR-CORE CHG		
1.000 EA		SEAL,RING O #214		
1.000 EA		RING O SIZE 124		
1.000 EA		RGT NON-CHLORINATED BRAKE CLEANER		
LABOR SUBTOTAL:				
PARTS SUBTOTAL:				
MISC SUBTOTAL..:				
COUPON SUBTOTAL..:				
EPA FEE SUBTOTAL..:				
SHOP SUPPLIES FEE..:				
MACHINE CHARGE..:				
JOB SUBTOTAL...:				

Job 5 ROADTEST TO VERIFY COMPLAINT

Sales Qty UOM	Item number	Item description	COR Unit rate	Per Extension
LABOR SUBTOTAL:				
PARTS SUBTOTAL:				
MISC SUBTOTAL..:				
COUPON SUBTOTAL..:				
EPA FEE SUBTOTAL..:				
SHOP SUPPLIES FEE..:				
MACHINE CHARGE..:				
JOB SUBTOTAL...:				

Job 43 CORES

CORES

SUBTOTAL TAX STATUS/STATE SALES TAX PLEASE PAY (USD)

CONTINUED

TERMS
Due on Receipt

INVOICE DATE

10/24/2022 09:18:45CST

PAGE: 4 of 65

Service Invoice

ANY WARRANTIES ON THE PRODUCTS PROVIDED BY RUSH ARE SOLELY THOSE MADE BY THE PRODUCT MANUFACTURER, EXCEPT FOR THE LIMITED SERVICES WARRANTY SET FORTH IN THE RUSH TERMS AND CONDITIONS OF SERVICE REFERENCED IN THE NOTE BELOW. RUSH EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. CORE PARTS MUST BE RETURNED IN THEIR ORIGINAL BOX. PART RETURNS MAY BE SUBJECT TO A RESTOCKING FEE.

CUSTOMER-PO

Order No.

MAIN-NUMBER

CUSTOMER-ADVISOR

SALES REP

Sales Qty UOM	Item number	Item description	COR Unit rate	Per	Extension
- 6.000 EA		REMANUFACTURED HEUI BI INJECTOR-CORE RET			
		LABOR SUBTOTAL:			
		PARTS SUBTOTAL:			
		MISC SUBTOTAL:			
		COUPON SUBTOTAL:			
		EPA FEE SUBTOTAL:			
		SHOP SUPPLIES FEE:			
		MACHINE CHARGE:			
		JOB SUBTOTAL:			

Employee(s) on above job :

*TOTAL LABOR:
*TOTAL PARTS:
*TOTAL MISC.:
*TOTAL COUPON.:
*TOTAL EPA.:
*TOTAL SHOP.:
*TOTAL MACHINE:

SUBTOTAL

TAX STATUS/STATE

SALES TAX

PLEASE PAY (USD)

CONTINUED

TERMS

Due on Receipt

[Redacted]

INVOICE DATE
10/24/2022 09:18:45CET
[Redacted]
PAGE 5 OF 05

Service Invoice

[Redacted]

[Redacted]

CUSTOMER-PO	Order No.	MAIN-NUMBER	CUSTOMER-ADVISOR	SALES REP
	[Redacted]	[Redacted]	[Redacted]	

SUBTOTAL	TAX STATUS/STATE	SALES TAX	PLEASE PAY (USD)
[Redacted]	[Redacted]	[Redacted]	3385.13

[Redacted]