

Date	Time	Page
02/03/21	22:31:57 (B)	01

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	900	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

SEGMENT# 1 C 805 NA 12/01/20 12/29/20 12/31/20

PM360 INSPECTION

CORRECTION:

performed pm 360 found exhaust leak /door handle loose/
tensioner spring broke on right side feeder housing for
chain tensioner / filler plates for rotor in wrong spots /
right angle gear box leaking /

ACW5172210

AUGER

RETAIL

1

FRT

FREIGHT

2

Y704742

FLANGE LOCKNUT

RETAIL

2

FLANGE LOCKNUT-1/2"-13,

29780X

WOODRUFF K

RETAIL

1

WOODRUFF KEY-0.2500X1.00

3019856X1

HEX CAP SC

RETAIL

2 N

HEX CAP SCREW-M12 X 80 (

5000005X1

M12 Locknut

RETAIL

2 S

LOCKNUT-M12 X 1.75, CL10

71127313

BEARING FL

RETAIL

4

BEARING FLANGE-1-1/4"

71306660

BALL BEARI

RETAIL

2

BALL BEARING-31.75MM ID

71411483

DOOR HANDLE

RETAIL

CONTINUED ON PAGE 02

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	900	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO
FRT	FREIGHT			4	
V546701900	STUD BOLT			RETAIL	
				1	
	STUD BOLT				
V615881420	SEALING WA			RETAIL	
				2	
	SEALING WASHER				
V615892631	SEALING WA			RETAIL	
				6	
	SEALING WASHER				
V615893036	SEALING WA			RETAIL	
				2	
	SEALING WASHER				
V836667960	STUD BOLT			RETAIL	
				3	
	STUD BOLT				
V836859188	STUD BOLT			RETAIL	
				9 N	
	STUD BOLT				
V836886358	GASKET			RETAIL	
				1 N	
V837073503	SEALING WA			RETAIL	
				4 N	
V837074972	GASKET			RETAIL	
				1	
V837084036	RUBBER ELB			RETAIL	
				1 N	
	RUBBER ELBOW				
V837084638	GASKET			RETAIL	
				2	

CONTINUED ON PAGE 04

Date	Time	Page
02/03/21	22:31:57 (B)	04

1

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	900	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

V837084663	GASKET	GASKET	RETAIL	1
V837084664	GASKET	GASKET	RETAIL	1
79022729	GASKET	COOLANT-EG	RETAIL	6
	COOLANT-EG CN 1G			
10360008				

SEGMENT# 3 C 805 NA 12/01/20 12/29/20 12/31/20

EXHAUST LEAK

CORRECTION:

disassemble right side of engine to remove exhaust manifold
 / clean manifold and head flanges
 replaced all studs for exhaust / install gaskets and one
 turbo gasket / replaced all coolant washers gaskets /
 replaced turbo drain gaskets
 reinstall manifold and turbos and torqued to spec and
 filled with 12.5 gal antifreeze 50/50

10360008

SEGMENT# 4 C 805 NA 12/01/20 12/29/20 12/31/20

REPAIR SEPERATOR FILLER PLATES

CORRECTION:

Date	Time	Page
02/03/21	22:31:57 (B)	05

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	900	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

beans packing behind filler plate / remove and reshape plates and figure out mix matched plate from left side to right side and reinstall and label plates to correct side and location

10360008

SEGMENT# 5 C 805 NA 12/01/20 12/29/20 12/31/20

REPLACE BIN LOADER AUGER/TUBE

CORRECTION:

remove bin loader auger and tube / assemble new auger and tube in stall new bearings and flange's install new universal joint onto auger and drive sprocket and install new auger unit into combine / reinstall all floor grates and lift cylinder and test for proper function

10360008

SEGMENT# 6 C 805 NA 12/01/20 12/29/20 12/31/20

REBUILD VARIABLE SHEAVE CYLINDER

BF2140	1/4 bREATHER	1 N
--------	--------------	-----

FRT	FREIGHT	2
-----	---------	---

3009209X1	M10x40 Fl Bolt	RETAIL
-----------	----------------	--------

1

HEX FLG HD BOLT-M10 X 1.

385362X1	FLAT WASHE	RETAIL
----------	------------	--------

1

FLAT WASHER-X 10-20 X 3

70923603	O-RING-4.7	RETAIL
----------	------------	--------

1 N

CONTINUED ON PAGE 06

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	900	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

O-RING-4.725" X .275"

70923829	O-RING-2.6	RETAIL
		1 N

70923854	O-RING-1.9	RETAIL
		1

70923932	O-RING-5.4	RETAIL
		1 N

O-RING-5.484" X .139"

70924146	O-RING-3.2	RETAIL
		1

O-RING-3.225" ID X .210"

70925284	HEX JAM NU	RETAIL
		1

70930414	BACKUP RIN	RETAIL
		1 N

BACKUP RING-3.273" OD

70933746	BACKUP RIN	RETAIL
		1 N

BACKUP RING-4.801 OD

70933818	FLAT WASHE	RETAIL
		1 N

71159477	THRUST WAS	RETAIL
		1 N

71466346	NUT	RETAIL
		1 N

10360008

***** WORK ORDER TOTALS *****

Date	Time	Page
02/03/21	22:31:57 (B)	07

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	900	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

.....

11339.30

.....

Date	Time	Page
09/02/22	22:31:17 (B)	01

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1243	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

SEGMENT# 1 C 783 NA 08/26/22 08/29/22 09/30/22

A/C ISSUE

CORRECTION:

DROVE 32 MILES TO UNIT AT CUSTOMERS FARM. TROUBLESHOT A/C ISSUE. STARTED MACHINE UP WITH A/C OFF AND EVERYTHING WORKED FINE HAD NO NOISE. HAD CUSTOMER TURN A/C ON AND BELT STARTED SLIPPING AND COMPRESSOR WOULD BARELY TURN. DETERMINED COMPRESSOR WAS THE ISSUE. CALLED BACK TO STORE AND HAD ONE ORDERED ALONG WITH DRYER. DROVE 32 MILES BACK TO SHOP. AFTER RECEIVING PARTS IN I DROVE 32 MILES BACK TO UNIT. RECOVERED FREON WITH MACHINE. REMOVED BELT FROM COMPRESSOR WHILE DOING THIS AND INSTALLED NEW BELT. REMOVED LINES FROM COMPRESSOR AND THEN REMOVED COMPRESSOR. INSTALLED NEW COMPRESSOR AND NEW O-RINGS ON THE LINES. INSTALLED LINES. REMOVED LINES FROM DRYER AND THEN REMOVED DRYER. FLUSHED LINES BEFORE INSTALLING THEM ON BOTH THE COMPRESSOR AND DRYER. INSTALLED NEW O-RINGS ON DRYER LINES. INSTALLED LINES ON DRYER. PULLED VACUUM FOR 30 MINUTES ON A/C SYSTEM. LET SET FOR 10 MINUTES AFTER THAT TO CHECK FOR LEAKS AND HAD NONE. FILLED A/C SYSTEM TO CAPACITY WITH FREON. STARTED MACHINE AND CHECKED A/C AND ALL WORKED FINE WITH NO ISSUES. DROVE 32 MILES BACK TO SHOP.

ADDITIONAL DESCRIPTION:

A/C COMPRESSOR MAKES NOISE WHEN ENGAGED. DIAGNOSE AND REPAIR.

ACW0479330	A/C COMPRESSOR	1 N
FRT	FREIGHT	2
71369761	DRYER RECE	1

DRYER RECEIVER

CONTINUED ON PAGE 02

Date	Time	Page
09/02/22	22:31:17 (B)	02

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1243	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO
71478776	V-BELT-6 R			1 N	
	V-BELT-6 RIB, 1623.5MM				

10360008

2037.99

09/02/22

22:31:17 (B)

03

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1243	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO



Date	Time	Page
09/30/22	22:35:19 (B)	01

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1250	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

SEGMENT# 1 C 783 NA 09/14/22 09/14/22 10/28/22

ROTOR SPEED

CORRECTION:

drove 27 miles to unit in customers field. called tech connect on unit as I was not convinced that it was the seals leaking. was advised by Tech Connect to install an shut off valve on the hose going to the rotor speed adjustment pulley. took fitting out of pulley and customer went to town to get valve. i then removed SV1 and SV2 and inspected them to see if their was any damage on the valve or O-rings and their was not. installed valves. installed shut off valve on line. set rotor speed to customer specs and then shut valve off. unplugged SV1 and SV2 and then rod with the customer for about 30 minutes. monitored rotor speed and it never increased. went to next call. customer called about an hour later and said that he lost about 20 RPM's on the rotor speed. noticed one of the fittings on the shut off valve was leaking and customer was going to put thread tape on fitting to see if rotor speed will stay where he sets it. drove 27 miles back to shop.

ADDITIONAL DESCRIPTION:

ROTOR SPEED INCREASES ON ITS OWN WITHOUT OPERATOR INPUT.

FRT	FREIGHT	1
-----	---------	---

10360008

SEGMENT# 2 C 783 NA 09/14/22 09/14/22 10/28/22

FINAL DRIVE

CONTINUED ON PAGE 02

Date	Time	Page
09/30/22	22:35:19 (B)	02

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1250	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

CORRECTION:

HELPED INSTALL FINAL DRIVE THAT CUSTOMER PICKED UP. 2 ROUND
TRIPS @51 MILES EACH

ADDITIONAL DESCRIPTION:

HELP INSTALL FINAL DRIVE.

ACW3224420

FINAL DRIVE-S42

70934422

HEX HEAD BOLT-1

10360008

D0579194

C0006982

9568.49

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1250	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

2
1
1



Date	Time	Page
07/31/23	22:36:17 (B)	01

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

SEGMENT# 1 C 855 PM360-COM1. 04/05/23 04/05/23 05/26/23

PERFORM PM360 INSPECTION ON COMBINE AS NEEDED.

CORRECTION:

Performed inspection on machine and talked with customer about repairs. 1105 separator hrs.

ADDITIONAL DESCRIPTION:

HRS

1. PERFORM PM360 INSPECTION ON COMBINE AS NEEDED. (PM360-COM1.) 7.00
PERFORM PM360 INSPECTION ON COMBINE PER CHECKLIST AS NEEDED. COMPILE AS LIST OF REPAIRS NEEDED FOR COMBINE.

Quantity

x1

10360008

SEGMENT# 2 C 855 NA 04/05/23 04/28/23 05/26/23

BUBBLE UP AUGER

CORRECTION:

Took bubble auger apart. Replaced u-joints, bearings, auger, and tube. Had to use the forklift to lift augers and tubes out and back into the grain tank of combine. Folded bin extensions down and made sure everything worked properly.

ADDITIONAL DESCRIPTION:

REPLACE BUBBLE UP AUGER AND TUBE.

ACW5172210

AUGER

CONTINUED ON PAGE 02

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO
1137264		3/8	LKNUT	6	
12705		M10	Lock Washer	2	
24148		3/8X1	CB	6	
71127313			BEARING FL	4	
	BEARING FLANGE-1-1/4"				
71306660			BALL BEARI	2 S	
	BALL BEARING-31.75MM ID				
71413012			TUBE	1 N	
	TUBE				
76172		3/8	LOCK Washer	6	
88612		5/16	FLAT WASHE	6	
10360008					

SEGMENT# 3 C 855 NA 04/05/23 05/04/23 05/26/23

ELEVATOR HOUSING

CORRECTION:

Took top and both sides off. Replaces both sides. Replaced the top sprocket. Put new bearings on the shaft with new flanges. Replaced u-joint for bubble up auger. Replaced chain. Put top piece back on. Plugged in wires and ziptied them up. Put belt back on bottom cross auger.

ADDITIONAL DESCRIPTION:

REPLACE CLEAN GRAIN ELEVATOR UPPER HOUSING. INSTALL NEW ELEVATOR CHAIN. PART COVERED BY GOODWILL.

ACW8876900	SIDE, LEFT HAND	1 N
ACW8876910	SIDE, RIGHT HAN	1 N
2412960W1	SPROCKET-1	1

SPROCKET-11T

CONTINUED ON PAGE 03

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO
357639X1			PIN-3/8" X	1	
700717212			BEARING CO	3	
	BEARING COLLAR-1-1/4" ID				
700717635			POP RIVET-	7	
	POP RIVET-3/16" X .126",				
71127313			BEARING FL	8 S	
	BEARING FLANGE-1-1/4"				
71194367			SENSOR COL	1 N	
71306660			BALL BEARI	4 S	
	BALL BEARING-31.75MM ID				
71420213			U-JOINT	2 N	
10360008					

SEGMENT# 4 C 855 NA 04/05/23 05/09/23 05/26/23

FEEDERHOUSE

CORRECTION:

Pulled feederhouse off. Pulled chain out. Chain and sprockets are wore out need replaced. Feederhouse slip clutch is really loose. Had to cut off sprockets on feederhouse shaft to replace. Had to cut bearings of the shaft as well. Took out front drum and replaced bearings. Took out center floor so I could weld the new upper floor plate in. Put new bearings and sprockets on upper shaft. Put new slip clutch on. Put belt back on. Put sensor on. Cleaned up brackets on machine where feederhouse hooks up. Put new chain and bars in that customer supplied. Put feeder house back on combine.

ADDITIONAL DESCRIPTION:

CONTINUED ON PAGE 04

Date	Time	Page
07/31/23	22:36:17 (B)	04

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

REPAIR REAR FEEDERHOUSE FLOOR AS NECESSARY. REPLACE UPPER
BEARINGS AND SPROCKETS. REPLACE FEEDER SLIP CLUTCH. REPLACE
BEARINGS IN DRUM.

ACP0038600	COMPOUND-T	RETAIL
		1
ACW1139860	BALL BEARING-M1	2 N
ACX2947240	CLUTCH	1
SUBLETL	FLOORPAN	1
116108W1	SPROCKET-1	4 N
	SPROCKET-12T	
284	PL 11GA	1 N
402294X1	CABLE TIE-	10
	CABLE TIE-390MM X 7.6MM	
700736840	BEARING-31	2
	BEARING-31.75MM ID X 72M	
70911255	SETSCREW-1	8 N
	SETSCREW-1/2"-13 X 3/4"-	
71440535	LYNCH PIN	2
	LYNCH PIN	

10360008

SEGMENT# 5 C 855 NA	04/05/23 05/09/23 05/26/23
---------------------	----------------------------

STRAW CHOPPER

REPLACE STRAW CHOPPER BLADES. CUSTOMER WILL INSTALL.

ACW2425810	BUSHING	24 N
ACX0063990	KNIFE	70 N
3009226X1	HEX. FLANG	12 N

CONTINUED ON PAGE 05

DATE	TIME	PAGE
07/31/23	22:36:17 (B)	05
Account No.	Phone No.	Fax No.

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO
5000030X1	LOCKNUT-M1	12	N		
	LOCKNUT-M12 X 1.75, CL8.				
71435887	FLAT WASHER-0.4	24	N		
10360008					

SEGMENT# 6 C 855 NA 04/05/23 05/10/23 05/26/23

BRAKES

CORRECTION:

Adjusted slack in brake pedals to master cylinders. Bled brakes. Brake shoes are in good condition and are adjusted correctly.

ADDITIONAL DESCRIPTION:

CHECK BRAKE FUNCTION.

10360008

SEGMENT# 7 C 855 NA 04/05/23 05/16/23 05/26/23

CHAINS

CORRECTION:

Checked unloader sprockets for alignment. Aligned small sprocket and idler sprocket with big sprocket. Had sprocket machined to correct alignment issue. Used shim washers for final fit. Replaced elevator drive chain. Replaced reverser motor chain.

ADDITIONAL DESCRIPTION:

REPLACE CHAINS AS NECESSARY. ALIGN UNLOADER DRIVE SPROCKETS.

ACP0568120	ROLLER CHAIN-#5	1 N
DC4233CL08	#60 CHAIN LINK	1

LINK,CHAIN/60 CONN

CONTINUED ON PAGE 06

Date	Time	Page
07/31/23	22:36:17 (B)	06

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO
DC4550CL08	#50 FULL LINK	1		- -	- -
	LINK, CHAIN/50 CONN				
DX1233050I	CHAIN #60	35			
DX1550100I	50 CHAIN	57			
FRT	FREIGHT	3			
SUBLETL	MACHINE SPROCKE	1			
12627	M20 flat washer	5			
16769	3/4x3-1/2 Hex B	1			
5600001.75	1.75 SHIM WASH	6 N			
70173	Bushing	1			
71419422	#80H MASTER	2 N			
	CONNECTOR LINK-#80				
71439966	CHAIN-#60	1 N			
71439968	CHAIN-#80H	1 S			
	CHAIN-#80HS				
71449019	CHAIN-#60	1 N			
	CHAIN-#60 71 PITCH				
10360008					

SEGMENT# 8 C 855 NA 04/05/23 05/15/23 05/26/23

RIGHT ANGLE GEARBOX

CORRECTION:

The old oil was really dark when I drained it, so I flushed the gearbox with brake cleaner then put new oil in it.

ADDITIONAL DESCRIPTION:

CHANGE OIL IN GEARBOX.

ACP0417090

OIL-GEAR 75W90

RETAIL

CONTINUED ON PAGE 07

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

10360008

SEGMENT# 9 C 855 NA 04/05/23 05/15/23 05/26/23

CLEANING FAN

CORRECTION:

PROBLEM WAS RESOLVED WITH THE ROTOR SPEED ISSUE.

ADDITIONAL DESCRIPTION:

CLEANING FAN SPEED FLUCUATES ON ITS OWN. DIAGNOSE AND REPAIR.

10360008

SEGMENT#10 C 855 NA 04/05/23 05/11/23 05/26/23

ROTOR SPEED

CORRECTION:

Checked voltages at VMM1 and found them to be correct so I went to VMM5 and checked voltage. VMM5 was putting out the correct voltage so I checked at the solenoids. Solenoids had the correct voltage but the rotor still sped up. Started checking the ground circuit and found that it had a bad ground. Cleaned ground connections but it still had the problem. Finally found that the grounds for the solenoids had rubbed on the alternator wiring. The wires were bare and alternator voltage was bleeding to ground causing the issue. Repaired wiring and checked operation. Combine ran for 45 with hot oil and the rotor speed nor the cleaning fan speed changed more than 10 rpm.

CONTINUED ON PAGE 08

Date	Time	Page
07/31/23	22:36:17 (B)	08

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

ADDITIONAL DESCRIPTION:

ROTOR SPEED FLUCUATES ON ITS OWN. DIAGNOSE AND REPAIR.

10360008

SEGMENT#11 C 855 NA 04/05/23 05/10/23 05/26/23

CLAMP ON HYD. LINE

CORRECTION:

Replaced clamp on hyd. line by reverser motor with one from the shop.

ADDITIONAL DESCRIPTION:

REPLACE BROKEN CLAMP AT RIGHT REAR OF MACHINE ON HYD. LINE.

10360008

SEGMENT#12 C 855 NA 04/05/23 05/04/23 05/26/23

ENGINE BELTS

CORRECTION:

Replaced all engine belts. The main belt had no more ribs on it. Water pump belt was almost worn in half. Found a loose clamp on a radiator hose and tightened it. Installed missing turbocharger drain line clamp.

ADDITIONAL DESCRIPTION:

REPLACE ENGINE BELTS. REPLACE BROKEN CLAMP ON TURBOCHARGER OIL DRAIN LINE.

V685040894	MULTIRIBBE	1
	MULTIRIBBED BELT	
V836773645	BAND	2 N
71438552	SERPENTINE	1
	SERPENTINE BELT-1038.6MM	

CONTINUED ON PAGE 09

Date	Time	Page
07/31/23	22:36:17 (B)	09

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO
71463133			BELT, ALTERNATOR		
71478776			V-BELT-6 R		
	V-BELT-6 RIB, 1623.5MM				

10360008

SEGMENT#13 C 855 NA 04/05/23 05/10/23 05/26/23

HYD. OIL LEAK

CORRECTION:

Cleaned off hyd. valve block for the straw spreader to see where the leaks were coming from. Found a bad oring on a fitting. Replaced oring. Confirmed the leak was fixed after running machine.

ADDITIONAL DESCRIPTION:

HYD. OIL LEAK AT STRAW CHOPPER PLUMBING. REPAIR AS NECESSARY.

70058 Oring

10360008

SEGMENT#14 C 855 NA 04/05/23 05/04/23 05/26/23

MACHINE BELTS

CORRECTION:

Replaced straw chopper belt. Found that the top shield bracket was broke so I welded it up. Replaced main separator drive belt on rear of combine.

ADDITIONAL DESCRIPTION:

REPLACE MACHINE BELTS AS NECESSARY.

CONTINUED ON PAGE 10

Date	Time	Page
07/31/23	22:36:17 (B)	10

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO
71447360		V-BELT-433			
	V-BELT-4339MM				
71448503		V-BELT-397			
	V-BELT-3978MM				

10360008

SEGMENT#15 C 855 NA 04/05/23 05/18/23 05/26/23
 DEF FAULT
CORRECTION:
 Found def solenoid wire connection and cleaned it. The code never came back after that.
ADDITIONAL DESCRIPTION:
 DEF FAULT CODE SPN 3363 FMI 5. DEF TANK HEATER VALVE SOLENOID CURRENT BELOW NORMAL/OPEN CIRCUIT. DIAGNOSE AND REPAIR.

10360008

SEGMENT#16 C 855 NA 04/05/23 05/10/23 05/26/23
 BEATER
CORRECTION:
 Replaced all paddles except the outside ones with new hardware. Replaced angled wear plate with new hardware.
ADDITIONAL DESCRIPTION:
 REPLACE INSIDE BEATER PADDLES AND WORN INLET ANGLE.
 ACW0997840 CARRIAGE BOLT-I
 ACW1023940 M10 FLANGE NUT-
 3019052X1 TAPPING SCREW-M

CONTINUED ON PAGE 11

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		
700702916		WASHER/SPE		1 N	
	WASHER/SPE				
71432171		ANGLE		1 N	
71432249		PLATE-4T,		28 N	
	PLATE-4T, 160MM X 47MM X				

10360008

SEGMENT#17 C 855 NA 04/05/23 05/16/23 05/26/23

HYD. OIL TEMP

CORRECTION:

Cleaned radiator out. Sensor tested good so I cleaned the connection. Finally found bare wires and after repairing them the code did not come back up.

ADDITIONAL DESCRIPTION:

HYD. OIL TEMP WARNING DISPLAYS AT TIMES. DIAGNOSE AND REPAIR.

10360008

SEGMENT#18 C 855 NA 04/05/23 05/11/23 05/26/23

TAILINGS ELEVATOR

CORRECTION:

Pulled clutch off and found that brass bushing on pulley was worn out. Replaced with new. Installed missing set screws. Put new slip clutch on. Replaced bottom sprocket and bearing with new flanges.

ADDITIONAL DESCRIPTION:

REPLACE SLIP CLUTCH.

CONTINUED ON PAGE 12

Date	Time	Page
07/31/23	22:36:17 (B)	12

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		
FRT	FREIGHT				2
K3518	LOCKING CO				1 N
	LOCKING COLLAR-1-1/8"				
61085	SQUARE KEY				1
703199	HEX CAP SC				1
704064HE1	HEX JAM NUT-3/8				2 N
70590709	BEARING-1-				1
	BEARING-1-1/8 ID				
70709	Cotter Pin				1
70923326	3/8x1 Set Screw				2
	SETSCREW-3/8"-16 X 1"				
71127313	BEARING FL				1
	BEARING FLANGE-1-1/4"				
71157144	BUSHING-1"				1
	BUSHING-1" ID X 1-3/4" O				
71371290	TORQUE LIM				1 4
	TORQUE LIMITER				
9863030W1	SPROCKET-8T				1 N
10360008					

SEGMENT#19 C 855 NA 04/05/23 05/26/23 05/26/23

FINAL DRIVE

CORRECTION:

Took apart and found that a bearing was out. Split case and pulled bearing from axle shaft. Knocked out bearing races. Cleaned up parts. Took bearings off stub shaft. Installed new seals and bearings. Put final drive together and set bearing preload to spec.

CONTINUED ON PAGE 13

Date	Time	Page
07/31/23	22:36:17 (B)	13

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

ADDITIONAL DESCRIPTION:

REBUILD LEAKING FINAL DRIVE.

ACP0039320	LOCTITE 222 LOW	1
ACP0039740	COMPOUND-Sealan	1
Y52894	RETAINING RING	2 N
3012025X1	M16x40 Bolt	4 N
700717365	HEX HEAD BOLT-M16 X 40 C	
	LIP SEAL-X	1 S
	LIP SEAL-X 47,625 X 69,9	
70210011	BEARING CO	1 N
	BEARING CONE	
70210012	BEARING CU	1 N
	BEARING CUP	
70923816	O-RING-X 3	1
	O-RING-X 3,53 X 82,14 MM	
71162781	BEARING CO	1 N
	BEARING CONE	
71162782	BEARING CU	1 N
	BEARING CUP	
71304271	BEARING CA	1
71417111	BEARING CU	1 N
	BEARING CUP	
71417112	BEARING CO	1 N
71453761	BEARING CU	1 N
71453762	BEARING CO	1 N
7744477	DOUBLE LIP	1 N
	DOUBLE LIP SEAL-X 158,75	

10360008

CONTINUED ON PAGE 14

]

Date	Time	Page
07/31/23	22:36:17 (B)	14

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

SEGMENT#20 C 855 NA 04/05/23 05/26/23 05/26/23

BATTERIES

CORRECTION:

Replaced batteries with new. The old ones would not take a charge.

ADDITIONAL DESCRIPTION:

REPLACE BAD BATTERIES WITH NEW.

31P-MHD

BATTERY

GROUP 31 950 CCA POST TYPE BATTERY

10360008

SEGMENT#21 C 855 NA 04/05/23 07/24/23 05/26/23

CLUTCH

CORRECTION:

Disassembled pulley and replaced orings. After running the machine there were no leaks.

ADDITIONAL DESCRIPTION:

CLUTCH ON RIGHT ANGLE GEARBOX

FRT	FREIGHT	1
70923603	O-RING-4.7	1 N
	O-RING-4.725" X .275"	
70923829	O-RING-2.6	1 N
70923854	O-RING-1.9	1 N
70923932	O-RING-5.4	1 N
	O-RING-5.484" X .139"	
70924146	O-RING-3.2	1 N
	O-RING-3.225" ID X .210"	

CONTINUED ON PAGE 15

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO
70930414	BACKUP RIN			1 N	
	BACKUP RING-3.273" OD				
70933746	BACKUP RIN			1 N	
	BACKUP RING-4.801 OD				
10360008					
<hr/>					
D0652974	C0006982				30479.37

CONTINUED ON PAGE 16

Date	Time	Page
07/31/23	22:36:17 (B)	16

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0000675	2015 CH 560E COMBI	1548	C560E0FHC18114	05/01/20	
TN401	560E	2	D59482-NEW		NO

