

DATE	TIME	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
	00	PETERBILT 379	1XP5DB9X9YN505330		78561/78561	T110	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
30JUN00 DD			17:00 15NOV23			CASH	06DEC23
R.O. OPENED		READY	OPTIONS: DLR:B269 ENG:Caterpillar 3406				

16:59 14NOV23 11:00 06DEC23

LINE OPCODE TECH TYPE HOURS

A RAPID CHECK (TRIAGE DIAG 1)

DG231 RAPID CHECK (TRIAGE DIAG 1)

2454 CPS

7226 CPS

1 RTL018918BPHWEL TRANSMISSION-REMAN, HALO  
W/INT PUMP

CORE CHARGE C

1 105C137 YOKE-CLUTCH RELEASE

1 127760DAN BRAKE-CLUTCH 2.000-10 SPLINE HD

1 6306LLUA1C3/2E BEARING

1 1425868 SEAL GP-CSHF

1 24240PTX THREADLOCKER-MED STR BLUE 36ML BTL  
6/CS

1 308925-20 CLUT EP 15.5,1860TORQ,VCT DAMPR,  
7-SPRNG

-1 RTL018918BPHWEL CORE RETURN

5 EC50PLA CLAMP-EXHAUST WB PREFRMD 5" ALMZ

1 550026915 OIL-SPIRAX S6 AXRME 75W-90-PAIL  
18.9L/5G

1 06-01150-540 LINK-CLUTCH LWR AL HEXBAR

1/2-20NF D&T

1 10R8501 INJ GP FUEL

CORE CHARGE C

1 8S9191 BOLT

-1 10R8501 CORE RETURN

SUBL FLYWHEEL RESURFACING FEE PO#8517

Pulled unit into shop for diagnostic. Found clutch not operating properly removed plate on bottom of bell housing found metal. Removed lines, wires, drive shaft and transmission. Found input shaft broken. the rear main seal was leaking replaced that as needed. replaced the

WARRANTY STATEMENT: PURSUANT TO MISSISSIPPI LAW, CONSUMERS HAVE SPECIFIC IMPLIED WARRANTY RIGHTS IN CONNECTION WITH THIS REPAIR. ANY WARRANTIES BY A MANUFACTURER OR SUPPLIER OTHER THAN OUR DEALERSHIP HOWEVER, ARE THEIRS, NOT OURS, AND ONLY SUCH MANUFACTURER OR SUPPLIER SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. NO EXPRESS WARRANTIES ARE GIVEN BY OUR DEALERSHIP IF THIS REPAIR IS NOT PERFORMED IN CONNECTION WITH A CONSUMER TRANSACTION, THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR.

\*SHOP SUPPLY COSTS: We have added a charge equal to 12% of the total cost of labor and parts, not to exceed \$2500.00, to this Repair Order for shop supplies used in connection with this repair.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES *	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	00	PETERBILT 379	1XP5DB9X9YN505330		78561/78561	T110
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
30JUN00 DD			17:00 15NOV23			
R.O. OPENED	READY	OPTIONS: DLR:B269 ENG:Caterpillar_3406				
16:59 14NOV23	11:00 06DEC23					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

pilot bearing as needed. replaced clutch and installed new clutch brake with a new fork and installed new transmission. put new oil in the trans and adjusted clutch. had to replaced the band clamps on the exhaust do to rust. had to cut the old clamps off to remove the exhaust from the stacks.

5405: Test drove the unit after repair. The clutch did not fully contact the stop brake which caused the transmission to be difficult to put in gear. The engine had a misfire also. Checked the clutch and found the adjusting rod had been adjusted out to its limit. Ordered a longer clutch rod. Connected the computer to the truck and performed a cylinder cutout test. Cylinder #2 had a dead injector. Contacted the customer for approval to repair. Removed the front valve cover and inspected the camshaft but it was good. Checked the valve lash settings on the cylinder but they weren't much out of spec. Replaced the #2 injector and the misfire stopped.

\*\*\*\*\*

CUSTOMER PAY SHOP CHARGE FOR REPAIR ORDER

CHECK NOISE @ TRANSMISSION

ASK US ABOUT OUR DPF CLEANING SPECIALS.  
WE CLEAN LIGHT, MED & HEAVY DUTY FILTERS.

**WARRANTY STATEMENT:** PURSUANT TO MISSISSIPPI LAW, CONSUMERS HAVE SPECIFIC IMPLIED WARRANTY RIGHTS IN CONNECTION WITH THIS REPAIR. ANY WARRANTIES BY A MANUFACTURER OR SUPPLIER OTHER THAN OUR DEALERSHIP, HOWEVER, ARE THEIRS, NOT OURS, AND ONLY SUCH MANUFACTURER OR SUPPLIER SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. NO EXPRESS WARRANTIES ARE GIVEN BY OUR DEALERSHIP IF THIS REPAIR IS NOT PERFORMED IN CONNECTION WITH A CONSUMER TRANSACTION, THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR PRODUCTS OR THE REPAIR.

\* **SHOP SUPPLY COSTS:** We have added a charge equal to 12% of the total cost of labor and parts, not to exceed \$2500.00, to the Repair Order for shop supplies used in connection with this repair.

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

DATE	CUSTOMER SIGNATURE	AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE
------	--------------------	--

DESCRIPTION
LABOR AMOUNT
PARTS AMOUNT
GAS, OIL, LUBE
SUBLET AMOUNT
MISC. CHARGES *
TOTAL CHARGES
LESS INSURANCE
SALES TAX
<b>PLEASE PAY THIS AMOUNT</b>

14299.29

**ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.**

SOLD BY		6-15-72	
NAME		-1	
ADDRESS			
CITY			
<input type="checkbox"/> CASH <input type="checkbox"/> C.O.D.		<input type="checkbox"/> CHARGE <input type="checkbox"/> PAID OUT	
		<input type="checkbox"/> MOSE. RET'D <input type="checkbox"/> PD. ON ACCT	
QUAN	DESCRIPTION		
1	New Radiator		
2	HVC 010181 SK		
3			
4			
5			
6			
7			
8			
9	Rad		
10	1112		
11			
12			
13			
14			
15			
16			

RECEIVED BY

11623/23

Thank You

## Invoice

EK4163

7/22/2021

46236

P.O. No.

Terms

Salesman

Ship

Via

Unit Number

Charlie

Due on receipt

TMB

7/22/2021

Cust. Pickup

16307

Quantity

Item Code

Description

Price Each

Amount

Parts  
Labor  
1 Parts  
1 Parts

Repair Eaton DS404 Differential 3.70:1  
Parts  
Labor  
127437 Axle Shaft  
127438 Axle Shaft

PAID  
CH #10643

Received By

Total

\$2,248.22

This unit has a 90 day unlimited mileage warranty. This warranty is strictly limited to repair or replacement of defective part or unit, and excludes labor charges therefor. Improper installation of part or unit, misuse or abuse of part or unit, use of worn or faulty attaching parts (linkage, motor mounts, universal joints, yokes, flanges, etc.) not included with our assemblies or failure to properly clean and lubricate part or unit will void this warranty. All other warranties, express or implied, including but not limited to warranties of merchantability and of fitness, are hereby excluded.



Invoice

EK4163

7/22/2021

46234

P.O. No.	Terms	Salesman	Ship	Via	Unit Number
Charlie	Due on receipt	TMB	7/22/2021	Cust. Pickup	16306

Quantity	Item Code	Description	Price Each	Amount
	Parts Labor	Repair Eaton RS404 Differential 3.70:1 Parts Labor  Paid CN # 10643		
Received By			Total	
			\$1,150.00	

This unit has a 90 day unlimited mileage warranty. This warranty is strictly limited to repair or replacement of defective part or unit, and excludes labor charges therefor. Improper installation of part or unit, misuse or abuse of part or unit, use of worn or faulty attaching parts (linkage, motor mounts, universal joints, yokes, flanges, etc.) not included with our assemblies or failure to properly clean and lubricate part or unit will void this warranty. All other warranties, express or implied, including but not limited to warranties of merchantability and of fitness, are hereby excluded.

2/22/2023

Invoice

EK4143

SP37194

PS10387:2/22/2023

All Cores Are Due  
Within 60 Days And  
MUST Be In  
Original Box To  
Receive Full Core  
Credit

New Turbo 2/22/23

1

177148

TURBOCHARGER

S.N.# 04A274210047

Credit

Total: 1,750.00

Signature