

*** PROFORMA INVOICE ***

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:		Bus Phone: Prv Phone:		Invoice Number: Invoice Date: 06/13/2023 Location: 18 Work Order Number: Payment Type: Account Page: 1 of 4	
Make/Model:		Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 5520			LV5520S452541	Z10586RZ	

Service Reminders:

Gen- Retail

COMPLAINT:

Door Glass

CAUSE:

CORRECTION:

Removed damaged and broken hinges from left side of cab. Installed new weather stripping onto new left door glass as well as two new hinges, handle and latch. Installed new door glass and adjusted the door to where it would shut and open properly.

PartNumber	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7478	LOCK NUT	2.00				N
19M7866	SCREW	3.00				N
21M7392	SCREW	1.00				N
24M7055	WASHER	1.00				N
24M7298	WASHER	1.00				N
56M7007	BALL JOINT	1.00				N
AL115310	HANDLE KIT	1.00				N
AL117519	WELD NUT	4.00				N
AL174358	GAS OPERAT	1.00				N
AL228235	HINGE	1.00				N
AL228236	HINGE	1.00				N
L115989	WASHER	1.00				N
L155606	SEALING WA	6.00				N
L77651	WASHER	2.00				N
L78703	CAP	1.00				N
L78704	SEALING WA	1.00				N
L78768	WASHER	1.00				N
L78769	WASHER	1.00				N
L78851	BUSHING	1.00				N
PM37421	Sealant	1.00				N
R198624	DOOR	1.00				N
R201072	RIVET	1.00				N
R216014	BALL STUD	1.00				N
R263632	WEATHERSTR	158.00				N

ENTERED ON: 6/21/23
BY:

SCANNED

6/29/23

RECEIVED

JUN 15 2023

JACK COL

*** PROFORMA INVOICE ***

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	
		Invoice Date:	06/13/2023
		Location:	18
		Work Order Number:	
		Payment Type:	Account
		Page:	2 of 4

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 5520		LV5520S452541	Z10586RZ	

Service Reminders:

R97588	BALL STUD	1.00
RE262463	HANDRAIL	1.00

Labor:	Parts:	OL&M:	Misc:	Sub-Total:
--------	--------	-------	-------	------------

Gen-Chassis & Frame Retail

COMPLAINT:

Antenna

CAUSE:

CORRECTION:

Removed top right front cover from cab. Tried to remove the antenna base from the cab but it is hard wired into the antenna wire that goes back to the radio. After looking up parts I found that you can not just install a new antenna base since the part has been up dated from the original. I would have to install a complete new base, antenna wire from the base to the radio and a antenna whip. Customer decided to hold off on the repair for now.

Labor:	Parts:	OL&M:	Misc:	Sub-Total:
--------	--------	-------	-------	------------

Gen-Electrical Retail

COMPLAINT:

Missing 2 rear lug nuts

CAUSE:

CORRECTION:

Installed missing bolt, washer, and nut on right rear wheel dish.

PartNumber	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7212	BOLT	1.00				
14M7276	NUT	1.00				
24M7241	WASHER	1.00				

Labor:	Parts:	OL&M:	Misc:	Sub-Total:
--------	--------	-------	-------	------------

Gen-Electrical1 Retail

COMPLAINT:

*** PROFORMA INVOICE ***

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Invoice Number:	
		Invoice Date:	06/13/2023
		Location:	18
		Work Order Number:	
		Payment Type:	Account
		Page:	3 of 4

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 5520		LV5520S452541	Z10586RZ	

Service Reminders:
Clutch Slipping

CAUSE:

CORRECTION:

Removed engine hood and front weights from the tractor. disconnected and plugged all hydraulic, fuel, and coolant lines between the engine and cab. Disconnected all electrical wiring between the cab and engine. Split tractor between engine and clutch housing and inspected the clutch. Found that the clutch was burnt so I removed the damaged clutch and set it aside. Removed the engine fly wheel, drove out the pilot bearing and installed a new bearing. Reinstalled engine flywheel. Removed the clutch release bearings and installed new bearings. Installed new clutch assembly as well as a pto clutch disk onto engine fly wheel and check for proper clutch finger adjustment. Once the adjustments had been checked and made to spec I reassembled the tractor in reverse order, reconnecting all hydraulic, fuel, coolant lines as well as all electrical connections. Next I reinstalled the engine hood and front weights, topped off the cooling system and hydraulic system. I test ran the tractor after all repairs were completed to check for proper operation. No further issues were present.

PartNumber	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
JD9449	BALL BEAR	1.00				
R10093	O-RING	1.00				
R139807	SHIFT COLL	1.00				
R141076	SLEEVE	1.00				
R141077	BUSHING	1.00				
RE173314	BALL BEAR	1.00				
RE173315	BALL BEAR	1.00				
RE227648	CLUTCH DIS	1.00				
SJ32011	CLUTCH	1.00				
T143169	O-RING	1.00				
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
FREIGHT	FREIGHT	1.00				

Miscellaneous Charges:

SERVICE ACCESSORIES

\$

Labor:	Parts:	OL&M:	Misc:	Sub-Total:
--------	--------	-------	-------	------------

Customer PO No:
Tax Exempt No: N
Advisor:

Job Total:
Sales Tax:
Total: \$6,900.94

*** PROFORMA INVOICE ***

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number:	
Invoice Date	06/13/2023
Location:	18
Work Order Number:	
Payment Type:	Account
Page:	4 of 4

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 5520		LV5520S452541	Z10586RZ	

Service Reminders:

TERMS AND CONDITIONS

See numbers above for after hours service. The presentation of an agriculture exemption certificate, that renders any product tax exempt, implies its use is exclusively for agriculture production. Upon signing below I agree to the terms stated above. Thank you for choosing United Ag & Turf, we appreciate your business!

Received by:

Date: