

Repair Order

11/15/2023
10:12 am1993 *MAC *CH613
*MACK
VIN : 1M2AA14Y1PW022325
Mileage : 8
Unit : *1
1

Unit # 1

Technician Service Description

Parts Labor Job Total

JM Ck for cause of frt diff housing moving.. Remove ubolts, lift saddles and found the housing broke. Remove wheels and tires, driveshafts, etc to remove complete axle housing complete. Had to cut out bolts for torque arms. Clean donor axle, remove axle seats and repair areas for mounts. Tear down old axle, remove diff, brakes, etc. Install diff,, hubs, brakes and axles. Install needed thru shaft bearing. Install and mount axle in truck. Square and torque ubolts. Align axle to rear. Put oil in diff. Install driveshafts and upper cross torque arm. Replace 1 bent 3030 chamber and one leaking one.

	Part Number	Part Description	Part Price Each	Quantity	Extended
N	10MMB16140	BOLTS 16-2.0 X 140			
N	3947334	VENT PIPE KIT			
N	3088-X121207	DIFF PLUG			
	3030	BRAKE CHAMBER 3030			
	80/90 GEAR OIL	80/90 GEAR OIL PER GAL			
N	11-14418-000	AXLE GASKET 8 HOLE			
N	046584ETN	THROUGH SHAFT BEARING			
N	EH127720	OIL SEAL			
	RTV37464	GRAY RTV (TUBE)			
S	CLEANER/2413	PARTS CLEANER			
JM	R & R CAB AIR BAG:				
	21128980	CAB AIR BAG			
N	8076265	CAB AIR BAG CLIP			
	MISCELLANEOUS PARTS				
	WJ201A	LATCHES FOR MMI BED			

Repair Order Notes



Thank you for your business.

Repair Order

12/29/2023
10:13 am1993 *MAC *CH613
*MACK
VIN : 1M2AA14Y1PW022325
Mileage : 10
Unit : *1

Unit # 1

Y

Technician	Service Description	Parts	Labor	Job Total
JM	install a new pinion nut removed and installed a new pinion nut as per kelvin			
	<u>Part Number</u> <u>Part Description</u> <u>Part /</u>			
N	2719-95207 YOKE NUT			
N	95205 YOKE NUT			
JM	weld driver side chain bushing cleaned up and welded the shaft to the bushing MISCELLANEOUS PARTS			
	<u>Part Number</u> <u>Part Description</u> <u>Part /</u>			
S	TOL80B12H-1 1/2X17 SPROCKET 12 TOOTH 17 SPLINE			
N	777 BANJO HOUSING			

Repair Order Notes

TOTAL PARTS
TOTAL LABOR
SUBLET
Supply Chrg
SUBTOTALOTHER FEES
SALES TAX

REPAIR ORDER TOTAL \$1,980.61

PAID
DUE

Repair Order

5/31/2023
10:14 am

1993 *MAC *CH613
*MACK
VIN : 1M2AA14Y1PW022325
Mileage : 3
Unit : *1

Unit # 1

Technician	Service Description	Parts	Labor	Job Total
DE	ADJUST CLUTCH			
BRAD	REPAIR DRIVESHAFT UNDER BED(Remove driveshaft, had new shaft built, installed and ran load off, no problems found.			
	<u>Part Number</u> <u>Part Description</u> <u>Part</u>			
	80SK15 SPROCKET 15 TOOTH			
	00050-2624-401 BOLT SK HUB			
S	UCF208-24 BEARING PEER 1 1/2 4 BOLT FLANGE			
SUB	ANI INV#(S7-2537298)			
	<u>Part Number</u> <u>Part Description</u> <u>Part</u>			
N	20-30-22-7400 TUBE SHAFT			
JRC	REPLACE ALL REAR HUBS			
N	REVRM-D02-47691 WHEEL SEAL			
S	OTR1601B BRAKE DRUM 16.5 X 7.0			
N	93700 24 5 STEEL HUB PILOT WHEELS			
BRAD	Pressure charge air cooler(found cooler leaking, reassemble)			
	<u>Part Number</u> <u>Part Description</u> <u>Part</u>			
N	IRSC1119 CHARGE AIR COOLER			
	FREIGHT			
SUB	Mount/dismount tires			
<u>Parts Recommended To Customer</u>				
2	ATM209 4973	UNITIZED SPINDLE NUT		

Repair Order Notes



Thank you for your business.

Repair Order

3/15/2022
10:22 am

1993 *MAC *CH613
*MACK
VIN 1M2AA14Y1PW022325
Mileage : 1
Unit : *1

Unit # 1

SALES EQUIPMENT

Service Requests:

Technician Service Description

Parts Labor Job Total

1RG	fix compressor Drained coolant to uninstall compressor. Replaced compressor. Filtered coolant back into radiator.			
	<u>Part Number</u> <u>Part Description</u> <u>Part P</u>			
N	101M/5396-3558042X AIR COMPRESSOR			
1RG	R&R AIR DRYER Replaced air dryer with new air dryer air dryer that customer had provided.			
1RG	SUSPENSION SYSTEM R.R front left leaf spring keeps rubbing inner tire. Positioning studs on leaf springs and housing were broken and missing. Made new positioning studs on axle and leaf spring. R.R front axle. front axle is leaking from housing left side. Replaced front left axle control arm. Grinded out cracks where axle was leaking. heat treated and welded axle for leaking cracks. Reassembled and aligned front axle with new control arm and mounting hard ware.			
	<u>Part Number</u> <u>Part Description</u> <u>Part</u>			
N	345-815 TORQUE ROD			
N	7834 U-BOLTS			
1RG	CHECK AC looked for leak in system high pressure side was leaking. Replaced high pressure side hose. Recharged air conditioning system.			
	<u>Part Number</u> <u>Part Description</u> <u>Part</u>			
N	777 CUSTOM HOSE			
	134A FREON FREON PER LB			
SUB	OIL FILTER TOOL: MAC TOOL			

Repair Order Notes



Thank you for your business.