

# Main Location

Vehicle:		Tech Work Order:		
Year:	2001	Alt. Vehicle:	Status:	Closed
Make:	Freightliner	WO Type:	Opened:	5/9/2022 10:21 AM
Model:	FLD120	Reference #:	Completed:	5/17/2022 7:46 AM
Color:	White	Downtime Hrs: 0.00	:Employee	*SHOP
Engine:	Detroit 12.7	Hour Estimate:		*SHOP
Trans:	Rockwell M016G10C	Requested By:	Vendor:	
VIN:	1FUPDSEB01LF45409	Reason:		
Meter 1:	798985.0	Delay Code:	Customer:	
Meter 2:	0.0			/

Item	Code	Description	Misc	Quantity
Parts	OTR 286171	Brake Foot Valve		
		FP 98784578		
	ABP/N83-2040-21009	AC Compressor - Truck 33		
	ABP/N83-308375	Expansion Valve - Truck 33		
	ABP/N83-319615	Receiver/Dryer - Truck 33		
	22-32466-001	Condenser - Truck 33		
		Freightliner 813023453		
	ABP/N83-307010	Evaporator - Truck 33		
		Freightliner 813023453		
	R134A	R134A Freon-12oz can		
Service	6010	Chassis- Air Valves-Replace brake foot valve		
	0100	Misc. Repairs		
	0100	Misc. Repairs		
	0100	Misc. Repairs		

## Notes:

replaced brake foot valve on firewall due to complaint of brake pedal stiff/sticking Tried to charge AC system but found the compressor was making no pressure. Ordered compressor, receiver/dryer and expansion valve. Removed lines from compressor and found metal shavings throughout system. Determined that it could not be flushed out and ordered new evaporator and condenser. Replaced entire AC system and charged with freon. Tested and blows 40\* out of vents.

**REPAIR ORDER INVOICE**

Customer Number:	Phone:	Invoice Number:		
Tax Status	Terms	P.O.#		
EXP	-----	LF45409	Service Date	Invoice Date
			8/06/2020	8/11/2020

Serial Number	Unit Number	Make / Model	Year	License Number	Mileage
1FUPDSEB01LF45409		FREIGHTLINER/CEN	2004		779425

OPERATION 1

COMPLAINT: VEHICLE INSPECTION  
 VMRS CODE: 05-999-999-999-06-00  
 CORRECTION: INSPECT-TOTAL VEHICLE-TOTAL VEHICLE-NO FAILURE  
 PERFORMED INSPECTION.

Labor Total --

SVC1220-Z200059	COUPON - \$25OFFDOT/CV	1	25.00-	-----
			Parts Total	--
			Total Operation 1	--

OPERATION 2

COMPLAINT: CHECK AND REPLACE CLUTCH IF NEEDED  
 VMRS CODE: 01-023-002-000-03-12  
 CORRECTION: REPLACE WITH NEW-CLUTCH-CLUTCH-BROKEN  
 CHECKED CLUTCH FOUND BROKEN SPRINGS PULLED TRANSMISSION I  
 PULLED THE HEAD SHAFT WE HAVE THE WRONG PARTS HEAD SHAFT KIT  
 AND CLUTCH. WAITING TO SEE WHEN PARTS CAN GET THE PARTS.  
 INSTALLED NEW HEAD SHAFT AND REMOVED OLD CLUTCH REMOVED  
 OUT PUT SEAL, INSTALLED NEW SEAL, REMOVED FLYWHEEL, TURNED  
 FLYWHEEL, INSTALLED FLYWHEEL, INSTALLED CLUTCH, INSTALLED  
 TRANSMISSION, HOOKED EVERYTHING UP, INSTALLED PTO PUMP,  
 INSTALLED DRIVE LINE, ROAD TEST NO ISSUES AT THIS TIME.

Labor Total --

308925-82	EP 15.5, 1700 TORQ, DA	1	800.00	-----
KPNBCB1220-M20AUGDE	COUPON - EATON CLUTCH	1	40.00-	-----
TDAK1T5389	OUTPUT SEAL TRANSMISSI	1	84.38	-----
K1T5367WEL	INPUT SHAFT	1	325.00	-----
FREIGHT	CHARGE FREIGHT	1	25.00	-----
14311FUL	GASKET	1	2.42	-----
4305294	GSKT SHIFT LEVER(43034	1	20.27	-----
			Parts Total	--
			Total Operation 2	3,972.57

## REPAIR ORDER INVOICE

Customer Number:	101145	Phone:	(417) 682-9577	Invoice Number:	R00283700253667
Tax Status	Terms	P.O.#		Service Date	Invoice Date

### OPERATION 3

COMPLAINT: BRAKE INSPECTION  
VMRS CODE: 01-013-000-000-06-00  
CORRECTION: INSPECT-BRAKES-BRAKES-NO FAILURE  
PERFORMED INSPECTION.

Labor Total --

SVC0820-N20JULAUG1 COUPON - BRAKE INSPEC 1 25.00-  
Parts Total --  
Total Operation 3 --

### OPERATION 4

COMPLAINT: COOLANT INSPECTION  
VMRS CODE: 01-042-000-000-06-00  
CORRECTION: INSPECT-COOLING SYSTEM-COOLING SYSTEM-NO FAILURE  
PERFORMED INSPECTION.

Labor Total --

1 30.00-  
Parts Total --  
Total Operation 4 --

### OPERATION 5

COMPLAINT: HVAC INSPECTION  
VMRS CODE: 01-001-000-000-06-00  
CORRECTION: INSPECT-AIR CONDITIONING, HEATING & VENTILATING SYSTEM-AIR  
CONDITIONING, HEATING & VENTILATING SYSTEM-NO FAILURE  
PERFORMED INSPECTION.

Labor Total --

SVC1220-N20MAYDEC1 COUPON - HVAC INSPECT 1 50.00-  
Parts Total --  
Total Operation 5 --

## REPAIR ORDER

Customer Number: 101145	Phone: (417) 682-9577	Invoice Number: R00283700253667
-------------------------	-----------------------	---------------------------------

\*  
\*  
\*

**Labor Total**  
**Parts Total**  
**Shop Supplies**  
**Coupons**  
**Freight**

Customer Copy

**TOTAL DUE**

**4,318.83**

**REMIT TO:**

MMIC25000 (02/18)

HOME:	CONT:	7 CELL:	SERVICE ADVISOR:	TRUCKS		
COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG
	01	FREIGHTLINER FRTLNR	1FUPDSEB01LF45409		765131/765131	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
17JUL00 DD			17:00 30MAY19			30MAY19
R.O. OPENED	READY	OPTIONS: DLR: SDFD 1) UNIT#29				
10:21 30MAY19	17:59 30MAY19					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CHECK AND ADVISE WONT ACCELERATE INTERMITTENTLY  
EA EXPRESS ASSESSMENT

5185 CPT

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE  
\*\*\*\*\*

B CHECK AND ADVISE TRUCK WILL START BUT WILL DIE SHORTLY AFTER  
99 MISC OPERATION

5185 CPT

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE  
\*\*\*\*\*

C CHECK AND ADVISE CEL  
99 MISC OPERATION

5304 CPT

PARTS: 0.00 LABOR: 270.00 OTHER: 0.00 TOTAL LINE  
765131 5304-FOUND ECM POWER SUPPLY FAULT. INSPECTED HARNESSES AND  
FOUND NO OBVIOUS ISSUES. CHECKED POWER AND GROUND TO ECM AND HAD  
WIRING HOLDS. LOAD GOOD INSTALLED TEST ECM AND RAN TRUCK. HAD NO  
RETURN AND ENGINE STAYED RUNNING NEEDS NEW ECM.

\*\*\*\*\*

D\*\* REPLACE ECM WITH REMAN AND PROGRAM

99 MISC OPERATION

5192 CPT

1 DDE/R23519307 ECM DDECIV 2131.19 1

CORE CHARGE C

8 DDE/23512307 ISOLATOR 9.60

-1 DDE/R23519307 CORE RETURN 2131.19

PARTS: 1723.78 LABOR: 337.50 OTHER: 0.00 TOTAL LINE

765131 5192 DISCONNECTED AND REMOVED ECM. INSTALLED NEW ECM WITH  
NEW ISOLATORS. PROGRAMMED ECM TO ESN# VERIFIED NO FAULT AFTER  
REPLACEMENT. NEED TO TEST DRIVE TO VERIFY REPAIR.

\*\*\*\*\*

SHOP SUPPLIES

	DESCRIPTION	TOTALS
	LABOR AMOUNT	
	PARTS AMOUNT	
	GAS, OIL, LUBE	
	SUBLET AMOUNT	
	MISC. CHARGES	
	TOTAL CHARGES	
	LESS INSURANCE	
	SALES TAX	
	PLEASE PAY THIS AMOUNT	

BUD:		MAKE/MODEL		VIN	LICENSE	MILEAGE IN/OUT		TAG
COLOR	YEAR	01	FREIGHTLINER FRTLNR	1FUPDSEB01LF45409		765131/765131		
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PONO.	RATE	PAYMENT	INV. DATE	
17JUL00 DD			17:00 30MAY19				30MAY19	
R.O. OPENED	READY		OPTIONS: DLR:SDFD 1) UNIT#29					
10:21 30MAY19	17:59 30MAY19							
LINE	OPCODE	TECH	TYPE	HOURS		LIST	NET	TOTAL
				5.30.19 HKC				

Our goal is to repair your vehicle correctly, on time, the first time. We hope we have succeeded. If not, please let us know so we can better serve you. Thank you for choosing to do business with us!

The Terms and Conditions of this transaction are set forth in the Terms and Conditions which may be viewed on the Web at [www.joplinfreightliner.com](http://www.joplinfreightliner.com) ("Web Terms and Conditions"). The Web Terms and Conditions are incorporated by reference herein and are hereby made a part of the contractual relationship between Customer (you) and Dealer (us). If you do not have access to the Web, please ask our representative to print out a copy of the Web Terms and Conditions for your review before entering into this contractual relationship.

By signing this page, Customer hereby authorizes the repair work listed to be done (above) with the necessary materials.

STATEMENT OF DISCLAIMER  
The factory warranty constitutes all of the warranties with respect to the sale of this item. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	2404.18
LESS INSURANCE	0.00
SALES TAX	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

PLEASE PAY  
THIS AMOUNT

	Unit #:
	Asset: 2001 Freightliner FLD120 Miles 765,131
	Serial #: 1LF45409
	VIN: 1FUPDSEB01LF45409
	Engine: DET DD15
Cust #:	Engine Hours: 0

Item	Operation	Labor	Parts	Core Charge	Total
1	CHECK AND ADVISE WONT ACCELERATE INTERMITTENTLY				0
2	CHECK AND ADVISE TRUCK WILL START BUT WILL DIE SHORTLY AFTER				0
3	CHECK AND ADVISE CEL				0
4	REPLACE ECM WITH REMAN AND PROGRAM Parts: (1.0) ECM				8

Parts:

Labor:

Core:

Haz.

Waste:

Shop:

Freight:

Tax:

**TOTAL: \$2,512.95**

# Main Location

Vehicle:		Tech Work Order: 1		
Year:	2001	Alt. Vehicle:		Status: Closed
Make:	Freightliner	WO Type:		Opened: 1/29/2021 5:32 PM
Model:	FLD120	Reference #:	21E011	Completed: 2/16/2021 2:08 PM
Color:	White	Downtime Hrs:	0.00	Employee: *SHOP
Engine:	Detroit 12.7	Hour Estimate:		*SHOP
Trans:	Rockwell M016G10C	Requested By:		Vendor:
VIN:	1FUPDSEB01LF45409	Reason:		
Meter 1:	790730.0	Delay Code:		Customer:
Meter 2:	0.0			/

Item	Code	Description	Misc	Quantity
Parts	DDE/R23537686	Fuel Pump & Gasket-Truck 33		
	DDE/R23537686Cr	Dirty Core / Fuel Pump & Gasket-Truck 33		
		Automatically Added at Check-out		
	3376891	Diesel Fuel/Oil Dye		
		T00285600883251		
	DDE/05234702	Injector O-Ring-Truck 33		
	DDE/05234699	Injector O-Ring-Truck 33		
	F31S-800	Battery-Group 31 750CA		
		68213674		
	DDE/R5236977	Fuel Injector-Truck 33		
		60784106		
	DDE/R5236977Cr	Dirty Core / Fuel Injector-Truck 33		
		Automatically Added at Check-out		
	DDE/R5236977	Fuel Injector-Truck 33		
		60786106		
	DDE/R5236977Cr	Dirty Core / Fuel Injector-Truck 33		

## Notes:

R&R fuel pump. Looking into dye to put into fuel to find internal leak; had freightliner quote injector cups/o rings for reference 2/3/21--Ran dye through fuel system, found leak at Injector #3, decided to replace o rings on all injectors. Looked up specs for overhead and ordered injector height tool. 2/4/21--Pulled out of shop and waiting on injector height tool and rest of gaskets from Freightliner before pulling injectors 2/5/21--Received gaskets from freightliner, still waiting on injector height tool 2/8/21--Pulled into shop and removed injectors and replaced o-rings, going back together using injector height tool purchased online. Will not need Jake Brake tune-up kit that Freightliner sold us so will return that 2/9/21--Found leaking injector body on #3 injector, re....

# Main Location

Vehicle:		Tech Work Order:		
Year:	2001	Alt. Vehicle:		Status: Closed
Make:	Freightliner	WO Type:		Opened: 1/29/2021 5:32 PM
Model:	FLD120	Reference #:	21E011	Completed: 2/16/2021 2:08 PM
Color:	White	Downtime Hrs:	0.00	:Employee *SHOP
Engine:	Detroit 12.7	Hour Estimate:		*SHOP
Trans:	Rockwell M016G10C	Requested By:		Vendor:
VIN:	1FUPDSEB01LF45409	Reason:		
Meter 1:	790730.0	Delay Code:		Customer:
Meter 2:	0.0			/

Item	Code	Description	Misc	Quantity
Parts		Automatically Added at Check-out		
	15w40	Bulk Oil		
Service	5022	Engine- Fuel Pump	P. Allen	
	5020	Engine- Fuel Injector	J. Chairez	
	5020	Engine- Fuel Injector	P. Allen	
	5020	Engine- Fuel Injector	P. Allen	
	5020	Engine- Fuel Injector	J. Chairez	
	5020	Engine- Fuel Injector	J. Chairez	
	5020	Engine- Fuel Injector	P. Allen	
	1620	Fluid Change- Oil	J. Chairez	

## Notes:

R&R fuel pump. Looking into dye to put into fuel to find internal leak; had freightliner quote injector cups/o rings for reference 2/3/21--Ran dye through fuel system, found leak at Injector #3, decided to replace o rings on all injectors. Looked up specs for overhead and ordered injector height tool. 2/4/21--Pulled out of shop and waiting on injector height tool and rest of gaskets from Freightliner before pulling injectors 2/5/21--Received gaskets from freightliner, still waiting on injector height tool 2/8/21--Pulled into shop and removed injectors and replaced o-rings, going back together using injector height tool purchased online. Will not need Jake Brake tune-up kit that Freightliner sold us so will return that 2/9/21--Found leaking injector body on #3 injector, re....

**BILL TO****SHIP TO**

<b>Sales Order #</b>	<b>Customer PO #</b>	<b>Payment Terms</b>	<b>Shipment</b>	<b>Sales Rep</b>	<b>Invoice Date</b>
154943				Website	09/25/2018
<b>#</b>	<b>Part Number</b>	<b>Part Name</b>	<b>Ordered</b>	<b>Unit Price</b>	<b>Total Price</b>
1	555603	FREIGHTLINER 4 ROW BOLT TOGETHER RADIATOR: 1985-1998 FLD 112, 120, 132, CLASSIC XL MODELS	1 ea		
2	Shipping Truck Freight	Truck Freight Shipment	1 ea		

<b>Payment Method</b>	<b>Date</b>	<b>Amount</b>
	09/25/2018	\$ 1,015.00

<b>Package</b>	<b>Tracking Number</b>
Generic Box 1	00464312257

***Subtotal:******Tax:******Payments:******Total:***

QTY.	MATERIAL	PRICE	AMOUNT
2	A3280F9392 Solenoid		
1	A2230X1194 PISTON		
1	TAS65001 Sleeping Box (P. Core)		

TO \_\_\_\_\_

PHONE \_\_\_\_\_

ORDER TAKEN BY Alex

Terms:

DESCRIPTION OF WORK	AMOUNT
<u>STUCK in HIGH RANGE</u>	<u>Paul Mc.</u>
<u>FOUND BROKEN WIRE BETWEEN SHIFTER &amp; SOLENOIDS</u>	
<u>SLEEPING BOX SEALS LEAKING</u>	

LABOR	HOURS	RATE	AMOUNT	TOTAL LABOR
				TOTAL MATERIALS
				TOTAL OTHER
				TAX
				<b>TOTAL</b>

Signature \_\_\_\_\_ Date \_\_\_\_\_

*Thank You*

**CUSTOMER'S NAME**

WORK ORDER NO.

# Main Location

Vehicle:		Tech Work Order:	
Year:	2001	Alt. Vehicle:	Status: Closed
Make:	Freightliner	WO Type:	Opened: 9/15/2022 6:41 AM
Model:	FLD120	Reference #:	Completed: 10/4/2022 1:57 PM
Color:	White	Downtime Hrs: 0.00	:Employee *SHOP
Engine:	Detroit 12.7	Hour Estimate:	*SHOP
Trans:	Rockwell M016G10C	Requested By:	Vendor:
VIN:	1FUPDSEB01LF45409	Reason: Transmission	
Meter 1:	807723.0	Delay Code:	Customer:
Meter 2:	0.0		/

Item	Code	Description	Misc	Quantity
Parts	9999	Used Meritor MO16G10C-M18 Transmission		
		Vander Haag 5-144767		
	9999	Core Charge		
		Vander Haag 5-144767		
	329202X	PTO Shift Indicator		
		FP 102325515		
	9999	G212 12" Grease hose		
		Bumper to Bumper 78-174357		
	9999	216200 90* 1/8" Brass Street Elbow		
		Bumper to Bumper 78-174357		
	KIT5389	Output Shaft Seal, Transmission - Truck 33		
		Freightliner 813030713		
	9999	00590-16A 5" OD/OD 90* Elbow, 6" Radius/15.5" Arms		
		FP 102354715		
	M5510	Muffler, 5" I/Ox10" Round		
		FP 102354715		

## Notes:

Replace transmission, service, air dryer Swapped input shaft from old transmission into new transmission. Swapped bellhousings and replaced clutch fork, shafts and bushings. Installed grease hoses for clutch fork shafts. Found driveshaft from trans to front rear very tight after putting new ujoints in. Sent driveshaft with new ujoints to Fleetpride to have them check for bent ears on yokes. They were able to square ears on driveshaft and sent back to us. Replaced ABS harnesses from cab to ABS valves/sensors due to exhaust leak burning up harness. Replaced exhaust from turbo adapter elbow all the way back to tip. Muffler and elbows for exhaust were rusted out. Installed PTO light into dash and ran new harness to PTO switch due to old connector being broken off. ....

# Main Location

Vehicle:		Tech Work Order:		
Year:	2001	Alt. Vehicle:	Status:	Closed
Make:	Freightliner	WO Type:	Opened:	9/15/2022 6:41 AM
Model:	FLD120	Reference #:	Completed:	10/4/2022 1:57 PM
Color:	White	Downtime Hrs: 0.00	:Employee	*SHOP
Engine:	Detroit 12.7	Hour Estimate:		*SHOP
Trans:	Rockwell M016G10C	Requested By:	Vendor:	
VIN:	1FUPDSEB01LF45409	Reason: Transmission		
Meter 1:	807723.0	Delay Code:	Customer:	
Meter 2:	0.0			/

Item	Code	Description	Misc	Quantity
Parts	9999	105C-137 Clutch Fork FP 102356809		
	9999	12815 Clutch Fork Shaft Bushings FP 102356809		
	5-281X	U-Joint 1810 Full Round Midwest Wheel 2944914-00		
	B233	Differential Filter		
	PF7748	Fuel Filter		
	BW5137	Coolant Filter		
	BT287-10	Hydraulic Filter		
	15w40	Bulk Oil		
	PA2705	Air Filter		
	9999	10590-16A 5" ID/OD Exh. Elbow FP 102376379		
	9999	A06-25989-000 ABS Harness Freightliner 813030724		
	9999	A06-27064-000 ABS Harness		

## Notes:

Replace transmission, service, air dryer Swapped input shaft from old transmission into new transmission. Swapped bellhousings and replaced clutch fork, shafts and bushings. Installed grease hoses for clutch fork shafts. Found driveshaft from trans to front rear very tight after putting new ujoints in. Sent driveshaft with new ujoints to Fleetpride to have them check for bent ears on yokes. They were able to square ears on driveshaft and sent back to us. Replaced ABS harnesses from cab to ABS valves/sensors due to exhaust leak burning up harness. Replaced exhaust from turbo adapter elbow all the way back to tip. Muffler and elbows for exhaust were rusted out. Installed PTO light into dash and ran new harness to PTO switch due to old connector being broken off. ....

# Main Location

Vehicle:		Tech Work Order:		
Year:	2001	Alt. Vehicle:		Status: Closed
Make:	Freightliner	WO Type:		Opened: 9/15/2022 6:41 AM
Model:	FLD120	Reference #:		Completed: 10/4/2022 1:57 PM
Color:	White	Downtime Hrs:	0.00	:Employee *SHOP
Engine:	Detroit 12.7	Hour Estimate:		*SHOP
Trans:	Rockwell M016G10C	Requested By:		Vendor:
VIN:	1FUPDSEB01LF45409	Reason:	Transmission	
Meter 1:	807723.0	Delay Code:		Customer:
Meter 2:	0.0			/

Item	Code	Description	Misc	Quantity
Parts		Freightliner 813030724		
	9999	OTR 955205 Air Dryer Assembly		
		FP 102427844		
	9999	04-16566-003 Heat Shield and Clamp		
		Freightliner 813030855		
	9999	Freight		
		Freightliner 813030855		
	02-09174-001	Clutch Fork Shaft, Short Side-Truck 33		
		Freightliner 813030845		
	02-09788-007	Clutch Fork Shaft, Long Side-Truck 33		
		Freightliner 813030845		
	9999	1-1/4" Close Nipple		
		Isenhour 154973		
	9999	1-1/4" Pipe Plug		
		Isenhour 154982		
	9999	02-12249-001 Clutch Rod Spacer		
		Freightliner 813030987		

## Notes:

Replace transmission, service, air dryer Swapped input shaft from old transmission into new transmission. Swapped bellhousings and replaced clutch fork, shafts and bushings. Installed grease hoses for clutch fork shafts. Found driveshaft from trans to front rear very tight after putting new ujoints in. Sent driveshaft with new ujoints to Fleetpride to have them check for bent ears on yokes. They were able to square ears on driveshaft and sent back to us. Replaced ABS harnesses from cab to ABS valves/sensors due to exhaust leak burning up harness. Replaced exhaust from turbo adapter elbow all the way back to tip. Muffler and elbows for exhaust were rusted out. Installed PTO light into dash and ran new harness to PTO switch due to old connector being broken off. ....

# Main Location

Vehicle:		Tech Work Order:		
Year:	2001	Alt. Vehicle:	Status:	Closed
Make:	Freightliner	WO Type:	Opened:	9/15/2022 6:41 AM
Model:	FLD120	Reference #:	Completed:	10/4/2022 1:57 PM
Color:	White	Downtime Hrs: 0.00	:Employee	*SHOP
Engine:	Detroit 12.7	Hour Estimate:		*SHOP
Trans:	Rockwell M016G10C	Requested By:	Vendor:	
VIN:	1FUPDSEB01LF45409	Reason: Transmission		
Meter 1:	807723.0	Delay Code:	Customer:	
Meter 2:	0.0			/

Item	Code	Description	Misc	Quantity
Parts	CAC40-400X6	Charge Air Boot		
	CAC40-400X6	Charge Air Boot		
	620TB406	Charge Air Boot Clamp		
	9999	H6 22940 Reverse Switch		
		Midwest Wheel 2953103-00		
	9999	A18-22127-004 Dash Panel		
		WheelerFleet.com #7136761		
	9999	A18-22178-017 Dash Panel		
		WheelerFleet.com #7136761		
	288239	Dash Valve, Trailer Brakes - Truck 33		
		Midwest Wheel 2965742-00		
	PPG500ZPK	Exhaust Clamp, 5" U-bolt		
	PPG500ZPK	Exhaust Clamp, 5" U-bolt		
	PPG500ZPK	Exhaust Clamp, 5" U-bolt		
	TES500	Clamp 5" Stainless Flat Band		
	TES500	Clamp 5" Stainless Flat Band		
	Hyd Oil	Hydraulic Oil		

## Notes:

Replace transmission, service, air dryer Swapped input shaft from old transmission into new transmission. Swapped bellhousings and replaced clutch fork, shafts and bushings. Installed grease hoses for clutch fork shafts. Found driveshaft from trans to front rear very tight after putting new ujoints in. Sent driveshaft with new ujoints to Fleetpride to have them check for bent ears on yokes. They were able to square ears on driveshaft and sent back to us. Replaced ABS harnesses from cab to ABS valves/sensors due to exhaust leak burning up harness. Replaced exhaust from turbo adapter elbow all the way back to tip. Muffler and elbows for exhaust were rusted out. Installed PTO light into dash and ran new harness to PTO switch due to old connector being broken off. ....

# Main Location

Vehicle:		Tech Work Order:		
Year:	2001	Alt. Vehicle:	Truck 33	Status: Closed
Make:	Freightliner	WO Type:		Opened: 9/15/2022 6:41 AM
Model:	FLD120	Reference #:		Completed: 10/4/2022 1:57 PM
Color:	White	Downtime Hrs:	0.00	:Employee *SHOP
Engine:	Detroit 12.7	Hour Estimate:		*SHOP
Trans:	Rockwell M016G10C	Requested By:		Vendor:
VIN:	1FUPDSEB01LF45409	Reason:	Transmission	
Meter 1:	807723.0	Delay Code:		Customer:
Meter 2:	0.0			/

Item	Code	Description	Misc	Quantity
Parts	Syn 50w	Synthetic 50w		
	B495	Oil Filter-Truck 7/33		
Service	9033	Truck 33 Service		
		Service Added From PM Warnings.		
		Drain plug = Square plug		
	6001	Replace Air Dryer		
		Service Added From PM Warnings.		
		OTR 065624-Truck 12, 42, 56, 82		
		OTR 107794- Truck 6, 19, 25, 57, 67, 72, 77, 83		
		OTR 950011- Truck 3, 7, 13, 28, 33, 38, 46, 47, 48, 50, 51, 60, 61, 62, 66, 68 78, 81		
	2000	Drive Train- Trans R&R		
	3075	Cab- Misc		
	0100	Misc. Repairs		
	0100	Misc. Repairs		
	0100	Misc. Repairs		

## Notes:

Replace transmission, service, air dryer Swapped input shaft from old transmission into new transmission. Swapped bellhousings and replaced clutch fork, shafts and bushings. Installed grease hoses for clutch fork shafts. Found driveshaft from trans to front rear very tight after putting new ujoints in. Sent driveshaft with new ujoints to Fleetpride to have them check for bent ears on yokes. They were able to square ears on driveshaft and sent back to us. Replaced ABS harnesses from cab to ABS valves/sensors due to exhaust leak burning up harness. Replaced exhaust from turbo adapter elbow all the way back to tip. Muffler and elbows for exhaust were rusted out. Installed PTO light into dash and ran new harness to PTO switch due to old connector being broken off. ....

# Main Location

Vehicle:		Tech Work Order:		
Year:	2001	Alt. Vehicle:	Status:	Closed
Make:	Freightliner	WO Type:	Opened:	9/15/2022 6:41 AM
Model:	FLD120	Reference #:	Completed:	10/4/2022 1:57 PM
Color:	White	Downtime Hrs: 0.00	:Employee	*SHOP
Engine:	Detroit 12.7	Hour Estimate:		*SHOP
Trans:	Rockwell M016G10C	Requested By:	Vendor:	
VIN:	1FUPDSEB01LF45409	Reason: Transmission		
Meter 1:	807723.0	Delay Code:	Customer:	
Meter 2:	0.0			/

Item	Code	Description	Misc	Quantity
Service	0100	Misc. Repairs		

## Notes:

Replace transmission, service, air dryer Swapped input shaft from old transmission into new transmission. Swapped bellhousings and replaced clutch fork, shafts and bushings. Installed grease hoses for clutch fork shafts. Found driveshaft from trans to front rear very tight after putting new ujoints in. Sent driveshaft with new ujoints to Fleetpride to have them check for bent ears on yokes. They were able to square ears on driveshaft and sent back to us. Replaced ABS harnesses from cab to ABS valves/sensors due to exhaust leak burning up harness. Replaced exhaust from turbo adapter elbow all the way back to tip. Muffler and elbows for exhaust were rusted out. Installed PTO light into dash and ran new harness to PTO switch due to old connector being broken off. ....