User: Catalog #:

745C Articulated Trucks, 2017 SN: 0TFK01642 Current Hours (SMU): 3677 Sale Date: 09/18/2017

Delivery Date: Unknown

## Service History

Service Date	Invoice Type	Hours	Description	Service Notes
06/22/2023	Service	5505	TAKE&ANALYZE SOS SAMPLE MACHINE	CUSTOMER COMPLAINT CAUSE OF FAILURE CORRECTION TOOK SAMPLES FROM ALL FLUIDS AND SENT OUT FOR SAMPLING CONTINGENT DAMAGE IF ANY COMPLICATIONS IF ANY
06/22/2023	Service	5505	TROUBLESHOOT TRANSMISSION	TRANSMISSION SLIPPING AND THROWING CODES
06/22/2023	Service	5505	REMOVE AND INSTALL TRANSMISSION OIL COOLER	TRANSMISSION SLIP CODES  CAUSE OF FAILURE PERFORMED PS54750 ON MACHINE. HAD TO INSTALL NEW OIL COOLER, FLUSH HOSES AND TUBES.  CORRECTION CLEANED OUT ALL TRANSLINES AND HOSES FROM THE DEBRIS IN THE TRANSMISSION, TOOK EXTRA TIME TO DO THIS. NEW TRANSCOOLER WAS INSTALLED, THE OLD TRANS COOLER HAD A LOT OF DEBRIS FROM THE TRANSFAILURE.  CONTINGENT DAMAGE IF ANY
06/22/2023	Service	5505	INSPECT TIMING/ACCESSORY GEARS	TRANSMISSION SLIP CODES ON TRANSMISSION
06/22/2023	Service	5505	PERFORM SERVICE LTR AUTHORIZATION	TRANSMISSION SLIP CODES  CAUSE OF FAILURE PERFORMED PS54750 ON MACHINE. USED A REMAN TRANSMISSION FOR THE SWING.  CORRECTION DRAINED TRANSMISSION OIL AND COOLANT.  REMOVED ALL ELECTRICAL AND HOSES TO CAB.  REMOVED CAB. BEGAN REMOVING ALL ELECTRICAL AND HYD AND TRANSMISSION LINES GOING TO AND ABOVE TRANSMISSION. REMOVED BOTH PUMPS AND DRIVESHAFT. RIGGED TRANSMISSION UP AND INSTALLED SUPPORT UNDER ENGINE. REMOVED BELLHOUSING BOLTS AND TRANS MOUNTING BOLTS. REMOVED TRANSMISSION AND SET TO THE SIDE. WASHED MACHINE AND RIGGED ONTO NEW TRANSMISSION. SWAPPED ALL FITTING OVER AND HOSES. CLEANED OUT ALL TRANS LINES AND HOSES FROM THE DEBRIS IN THE TRANSMISSION.  INSTALLED THE REMAN TRANSMISSION IN BOLTED BELLHOUSING LIP AND TRANSMISSION IN BOLTED

06/22/2023	Service	5505	PERFORM SERVICE LTR AUTHORIZATION	CUSTOMER COMPLAINT PERFORM PS47336 ON MACHINE, REMOVE RETARDER LEVER CAUSE OF FAILURE CORRECTION PREFORMED PRODUCT SUPPORT PS47336 ON THE MACHINE CONTINGENT DAMAGE IF ANY COMPLICATIONS IF ANY
06/22/2023	Service	5505	REPAIR FOR WARRANTY: TRANSMISSION LINES/HOSES	CUSTOMER COMPLAINT OIL LEAK UNDER THE CAB  CAUSE OF FAILURE  CORRECTION HAD TO RAISE THE CAB TO INSPECT FOR THE LEAK, FOUND A HOSE 3946782 HOSE WAS LEAKING OIL REMOVED THE HOSE AND INSTALLED NEW. LOWERED THE CAB. RAN THE MACHINE. RAISED THE CAB TO CHECK FOR LEAKS, WERE NONE. LOWERED THE CAB BACK DOWN.  CONTINGENT DAMAGE IF ANY  COMPLICATIONS IF ANY