INVOICE

INV00201

DATE

11/01/2023

BALANCE DUE

DESCRIPTION RATE OTY AMOUNT

DUMP TRUCK 8.2 DETROIT REMOVE AND INSTALL - LABOR REMOVED HOOD AND FRONT CLIP, REMOVED ENGINE. FOUND LIFTER WAS NOT MOVING WHEN ROTATING, FOUND CAM WAS FLAT. ORDERED ALL PARTS, FULLY DISSASSEMBLED AND CLEANED. INSTALLED NEW CAM BEARINGS, CAM AND LIFTERS, INSTALLED NEW PISTONS AND KIT CAME WITH TURBO RINGS SO HAD TO GET NON TURBO RINGS.

ASSEMBLED ALL NEW BEARINGS AND CHECKED CLEARANCES. INSTALLED HEADS AND TORQUED ALL BOLTS. COULD NOT FIND CORRECT OIL PAN GASKET, NON AVAILABLE THROUGH MANY PLACES. MADE A GASKET AND SILICONE WORK. ADJUSTED ALL VALVES AND INJECTORS, INSTALLED ENGINE INTO TRUCK AND FINISHED FINAL ASSEMBLY AND FILLED WITH ALL FLUIDS. MADE SURE OIL PRESSURE AND COOLANT TEMP SENSORS WERE WORKING.

DUMP TRUCK 8.2 DETROIT OVERHAUL + LABOR

OVERHAUL KIT - PARTS

CAMSHAFT - PARTS

LIFTERS - PARTS

INJECTOR SEAL KIT - PARTS

NON TURBO PISTON RINGS - PARTS

		INVOO04
	93	DAT
		07/27/202
	100	
	- 89	
	- 8	
	1	

TOTAL

\$673.67

**DUMP TRUCK LABOR** 

Exhaust band clamp

Payment Info

BY CHECK

REMOVED SIEZED HYDRAULIC CABLE, INSTALLED NEW KIT AND ROUTED FREE FROM EXHAUST, FIXED EXHAUST PIPE HANGING AWAY FROM CLAMP AND MISSING MUFFLER INLET.

OIL, COOLANT, FILTERS, ETC		
Payment Info	TOTAL	\$6,451.52
BY CHECK	THE REAL PROPERTY.	

INVOICE INV0010 DATE 04/18/2024 DESCRIPTION **DUMP TRUCK U-JOINTS** CARRIER BEARING LABOR SUBTOTAL Payment Info SALES TAX (0%) BY CHECK \$678.79 TOTAL PAYMENT Check