

SERVICE PRELIMINARY

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C0020726	TRUCK		X XH619829		
22804	4700				
PLATE LIGHTS NOT WORKING. FOUND POOR CONNECTIONS AND BAD					
WIRING TO BE THE CAUSE. REPAIR WIRING AND REPLACE LICENSE					
PLATE LIGHT BULB. LIGHTS THEN WORKED PROPERLY.					
B-100			TERM;WIRE		
16GA			WIRE		
	16 GAUGE PRIMARY WIRE				
97			BULB		

10300001

***** WORK ORDER TOTALS *****

SUB TOTAL==> 5942.96

C0020726
22804

TRUCK
4700

HRS PIN/EIN
X XH619829

WARRANTY DATE HRS

SEGMENT# 1 5 736 NA

04/29/19 05/02/19 06/30/19

TRANSMISSION

COMPLAINT:

15.00

TRUCK BROUGHT IN FOR TRANSMISSION INTERNAL FAILURE.

CAUSE:

INTERNAL TRANSMISSION FAILURE.

CORRECTION:

TEST DRIVE AND CHECK OPERATION. FOUND TRANSMISSION TO GRIND
BETWEEN FIRST AND SECOND GEARS AND SLIP IN THIRD GEAR.
DIAGNOSE INTERNAL TRANSMISSION FAILURE. REMOVE DRIVE LINE
AND EXHAUST FOR ACCESS. REMOVE PTO PUMP. DRAIN OIL FROM
TRANSMISSION. REMOVE TRANSMISSION FROM TRUCK. SWAP ALL
FITTING AND SENSORS TO REMAN TRANSMISSION. REMOVE PTO ANS
INSTALL ON NEW TRANSMISSION. OIL PANS HAD TO BE SWAPPED
FROM OLD TRANSMISSION TO REMAN TRANSMISSION. TRANSMISSION.
R&R REAR MAIN SEAL. FLUSH TRANSMISSION COOLER LINES. R&R
EXTERNAL TRANSMISSION FILTER. INSTALL REMAN TRANSMISSION.
REINSTALL DRIVE LINE, PTO PUMP, AND EXHAUST. FILL
TRANSMISSION WITH NEW OIL. R&R TRANSMISSION SHIFT HANDLE.
TEST DRIVE AND CHECK OPERATION.

AT540C	CORE CHARGE	1-
AT540CC	CORE CHARGE	1
CHE35P9-2	GSKT	2
FRT	FREIGHT	1
N1841139C93	KIT REAR M	RETAIL
		1 N

KIT REAR MAIN SEAL

N2504178C91	KT KNOB, KIT SHI	RETAIL
		1 N
		CON