

Engine Log

Serial # _____

South Dakota

Aviation Services

5/19/2020 Tach: 3992 ACTT: 12,717 ETT: 0

- Installed rebuilt engine P/N: RENPL-RT8164, S/N: RL-20761-39E in Cessna 172P N63628, S/N: 75458.
- Installed new engine isolator mounts.
- Installed new alternator drive belt.
- Installed new engine compartment hoses.
- Installed new air filter.
- Serviced engine with 7qts Aeroshell w100 mineral oil.
- Repaired baffling as needed.
- Ground run, rigging, and ops check performed with no discrepancies noted.

Andy G

South Dakota

Aviation Services

6/18/2020 Tach: 4026 ACTT: 12,751 ETT: 0

License

Date

BROUGHT

10/

Aviation

11/19/

Andy

Aviation

1/08/20

Engine Log

Serial # _____

South Dakota

Aviation Services

April 26, 2024

TTAF = 13,628 Tach = 4903 *FTE = 911*

Performed operation one inspection IAW Cessna service manual D2065-3-13 Rev. 9. Inspected magnetos in accordance with 500-hour inspection. Changed oil and filter. Ground run and ops checked with no defects noted.

Maintenance Release

The aircraft and/or component identified were repaired/inspected in accordance with current Federal Aviation Regulations and are approved for return to service.

[Signature]

South Dakota

Aviation Services

06/17/2024 Tach: 4952 ACTT: 13677 ETT: 960

- Performed operation #2, #3, & #4 IAW Cessna 172 Service Manual D2065-3-13 Rev 9.
- Drained oil, serviced engine with 7qts Acroshehl 100W.
- Cut and inspected oil filter, no contaminants noted. Installed new CH48111-1 filter.
- Installed new #3 cylinder rocker cover gasket.
- Ground run & ops check completed with no discrepancies noted.

Maintenance Release

The engine and/or component identified were repaired/inspected in accordance with current Federal Aviation Regulations and are approved for return to service.

Andy Lin

Page Total: _____

Brought Forward: _____

All repair data must bear the endorsement of a certified mechanic, and his/her rating certificate number MUST be shown.

Engine Log

Serial # _____

South Dakota

Wrong logbook 11-23-24 Andy Lin

Aviation Services

11/27/24 Tach: 4886.5 ACTT: 4886.5 ETT: 1013

- Performed operation #1, #2, #3, #4, #5, #22 & #23 IAW Cessna 20611 Maintenance Manual 20611MM Rev 26.
- AD2024-21-02 indicating red bushings does not apply engine build date 4/27/20.
- Performed AD2015-01-07 of fuel injector lines and clamps, no defects noted at this time.
- Performed AD2022-05-01, inspected v-band clamps IAW para. RT-17, no defects noted at this time.
- Performed 500 hr inspection on RH and LH magnetos.
 - Installed new brush points, rotor gear and impulse coupling on LH magneto.
 - Installed new brush points, rotor gear and impulse coupling on RH magneto.
- Drained oil, serviced engine with 1 qt Acroshehl 100W. Cut and inspected removed oil filter, no contaminants noted at this time. Installed new CH48111-1 filter.
- Installed overhauled boost pump P/N: 11005508, S/N: 251205.
- Cleared fuel nozzles.
- Ground run & ops check completed with no discrepancies noted.

Maintenance Release

The engine and/or component identified was repaired/inspected in accordance with current Federal Aviation Regulations and is approved for return to service.

Andy Lin

South Dakota

Aviation Services

2/13/25 Tach: 4975 ACTT: 13,700 ETT: 983

- AD2024-21-02 does not apply, engine assembly date 4/27/2020.
- Ops check complete with no discrepancies noted.

Maintenance Release

The aircraft and/or component identified was repaired/inspected in accordance with current Federal Aviation Regulations and is approved for return to service.

Andy Lin

Page Total: _____

Brought Forward: _____

Total to Date: _____

All repair data must bear the endorsement of a certified mechanic, and his/her rating certificate number MUST be shown.