

Invoice To Account No	Deliver To:	Deliver To:		SERVICE INVOICE		
				Invoice Number:		11866118
				Invoice Date		03/13/2025
	ll l			Location:		03
	ll l			Work Order Number:		
				Payment Type:		
Prv Phone:	Prv Phone:			Page:		1 of 2
Make/Model:	M	leter	Serial Number:	EQ Id:	Fleet No:	
JOHN DEERE 8760			RW8760H004175	25346W		

## EXPERT-1000000033460 Retail

COMPLAINT:

01. Repair for Throttle Breaking.

## CORRECTION:

15 mi one way two trips

Removed the fan belts and fan.

Removed the alternator belts and alternator.

Removed the fan drive and mounting plate.

Removed the injection pump gear cover.

Rolled the engine onto TDC #1.

Removed the injection pump gear.

Removed all of the lines from the injection pump.

Removed the injection pump.

Cleaned the mounting surfaces of the pump and cover.

Installed the pump.

Installed the pump gear.

Checked the pump timing.

Installed the injection pump cover.

Installed all of the fuel lines.

Installed the fan drive.

Installed the fan and alternator.

Installed the belts.

Primed the fuel system.

Started the machine checked for leaks.

PartNumber	Description	Quantity
AR86745	FILTER ELE	1.00
R51936	SEALING WA	13.00
R520520	Gasket	1.00
R67092	SEALING WA	9.00
R67264	PACKING	7.00
RE52702	CLAMP	2.00
TY22450	BULK HOSE	8.00
Miscellaneous	Description	Quantity
PT3750	FREIGHT JD - PARTS SC	1.00

# OL&M Charges:

Description

REBUILD GOVERNOR AND CALIBRATE



Total:

\$3,354.63

Invoice To Account No: Deliver To:			SERVICE INVOICE			
				Invoice Number: Invoice Date Location: Work Order Number: Payment Type:		03/13/2025 03
Prv Phone:	Prv Phone:	(100)710	-0100	Page:		2 of 2
Make/Model:		Meter	Serial Number:	EQ ld:	Fleet No:	
JOHN DEERE 8760			RW8760H004175	25346W		
NJECTION PUMP						



## SERVICE INVOICE

Invoice Number: 09/26/2024 Invoice Date Location: 03 Work Order Number: Payment Type: Prv Phone: Prv Phone: Page: 1 of 2 Make/Model: Meter Serial Number: EQ Id: Fleet No: JOHN DEERE 8760 RW8760H004175 25346W

## EXPERT-1000000033460 Retail

#### COMPLAINT:

01. Diagnose and Repair Axle PTO Low Pressure Code.

## CORRECTION:

Arrived at the tractor and diagnosed for the light.

Found the switch wiring was tapped up so I removed the sensor.

Found mouse markings on the switch wiring, so decided to jump the harness and see if light went out.

It did.

Ordered a switch.

During the testing found the alternator was not charging.

Tested the exciter wiring.

It tested fine so I jumped the wiring and still was not getting anything from the alternator.

Ordered a new one.

Installed new pressure switch and tested.

It was working great.

Installed new alternator and tensioned belts.

Tested and it was working great.

<u>PartNumber</u>	Description	Quantity
R26286	O-RING	1.00
RE156641	Pressure Switch	1.00
SE501371	ALTERNATOR	1.00
QE501271_CD	CODE for Alternator Damon	-1.00

1	
Total: \$934.32	Total: